



INGEKOMEN 22 SEP 2005

مكتب المدير العام
Office of the Director General

دولة الامارات العربية المتحدة
الهيئة العامة للطيران المدني
UAE General Civil Aviation Authority

Ref: 20150/4342/2005

Date: 03 September 2005

Mr G. J. Vogelaar
Accredited Representative
Dutch Transport Safety Board
c/o Raad v.d. Transportveiligheid
2509 CK The Hague
The Netherlands

أبوظبي
ص.ب: ٦٥٥٨، الامارات العربية المتحدة
هاتف: +٩٧١ ٢ ٤٤٤ ٧٦٦٦
فاكس: +٩٧١ ٢ ٤٠٥ ٤٤٨٥

دبي
ص.ب: ٣٠٥٠٠، الامارات العربية المتحدة
هاتف: +٩٧١ ٤ ٢٨٢ ٨٢٧٠
فاكس: +٩٧١ ٤ ٢٨٢ ٦٢٢٣

After Greetings,

SUBJECT: KISH AIRLINES ACCIDENT – UNITED ARAB EMIRATES


Please find enclosed three copies of the Final Report of the investigation into the accident involving Kish Air Fokker F27 Mk50, EP-LCA, near Sharjah International Airport on 10 February, 2004. You are kindly requested to pass on a copy to the Civil Aviation Authority of the Netherlands and to Stork (Fokker Services B.V.)

The Dutch Transport Safety Board is recommended to note the circumstances of this accident.

The Civil Aviation Authority of The Netherlands is recommended to ascertain the modification status of the Skid Control Unit of all Fokker F27 Mk.050 aircraft and to strongly urge non-compliant operators to modify the Skid Control Units. As the Kish Air accident was the second fatal accident within 15 months, whereby the unmodified Skid Control Unit was a contributory factor, this recommendation is presented as a means of achieving the sole objective of prevention of accidents and incidents.

The assistance given to the GCAA by your organisation during the investigation is most appreciated.

Please accept the assurances of my highest consideration,

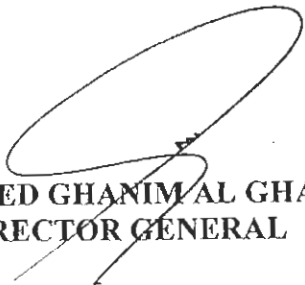
MOHAMED GHANIMAL GHAITH
DIRECTOR GENERAL





الإمارات العربية المتحدة
مجلس الطيران المدني
UAE General Civil Aviation Authc

AIRCRAFT ACCIDENT 01/04

preven

FINAL REPORT ON THE ACCIDENT INVOLVING KISH AIRLINES FOKKER F27 MK.050, IRANIAN REGISTERED AS EP-LCA ON APPROACH TO SHARJAH INTERNATIONAL AIRPORT UNITED ARAB EMIRATES ON 10 FEBRUARY, 2004

OBJECTIVE

In accordance with Annex 13 to the Convention on International Civil Aviation, it is not the purpose of aircraft accident investigation to apportion blame or liability. The sole objective of the investigation and the Final Report is the prevention of accidents and incidents.

INTRODUCTION

SYNOPSIS

The aircraft involved was a Fokker F27 Mk.050, owned by the Kish Airlines, based at Ekbatan in the Islamic Republic of Iran. The Islamic Republic of Iran was the State of Registry and the State of the Operator. The Netherlands was the State of Design and the State of Manufacture. On this particular flight, IRK 7170, EP-LCA, was operating a scheduled passenger flight from Kish Island to Sharjah, UAE, and was approaching to land on runway 12 at Sharjah International Airport in good daylight visibility. The aircraft was observed to pitch down and suddenly turn to the left. The aircraft continued to descend and turn at high pitch and roll angles and impacted a sandy area within a residential area 2.6 nm from the runway threshold. Immediately a large explosion was seen. The aircraft was destroyed and there were 43 fatalities.

The cause of the accident was attributed to the movement of the propellers from the Flight Control Range to the Ground Control Range.

Four safety recommendations have been made. Unless otherwise indicated, recommendations in this report are addressed to the regulatory authorities of the State having responsibility for the matters with which the recommendation is concerned. It is for those Authorities to decide what action is taken.

ACCIDENT DETAILS

The accident details are as follows;

Registered Owner	:	Kish Airlines
Registered Operator	:	Kish Airlines
Aircraft type & model	:	Fokker F27 Mk.050
Nationality	:	Islamic Republic of Iran
Registration	:	EP-LCA
Place of Accident	:	2.6 nm final to Sharjah International Airport, United Arab Emirates Runway 12 Latitude : 25° 21.35' N Longitude : 055° 28.63' E
Date & Time	:	10 February 2004 1138 hours local UAE time 10 February, 2004 0738 hours UTC

Note: Except where discussing DFDR, CVR and ATC times, all times in this report are local UAE time, which is Coordinated Universal Time (UTC) plus 4 hours.

Persons on board	:	2 Flight crew
	:	2 Cabin crew
	:	2 Security personnel
	:	40 Passengers
Fatalities	:	43
Injuries	:	3 Serious

ORGANIZATION OF THE INVESTIGATION

The GCAA was notified within minutes of the accident and an Aircraft Accident Investigation Committee was established under a Ministerial Decree identifying the GCAA as the authority responsible for the conduct of the investigation. Notification to ICAO and applicable States was completed on the day of the accident. Officials from the following State of Operator/Registry, State of Design and individual States of Manufacturer of the aircraft, engine and propellers were granted Accredited Representation in accordance with ICAO Annex 13 and corresponding UAE Civil Aviation Regulations. Officials representing the Type Certificate holder of the aircraft manufacturer of engines and propellers also assisted in the investigation and were granted observer status.

State of Operator/Registry	-	Iranian Civil Aviation Organization (CAO)
State of Design/Manufacture (aircraft)	-	Dutch Transport Safety Board & Civil Aviation Authority
State of Manufacture (engine)	-	Canadian Transportation Safety Board
State of Manufacture (propeller)	-	UK Air Accidents Investigation Branch
State of Manufacture (skid control unit)	-	US National Transportation Safety Board

GCAA Investigators, assisted by experts from the Dutch Type Certificate holder Fokker Services B.V. and by technical and operational experts from the CAO, Kish Airlines and the engine manufacturer, Pratt & Whitney Canada, examined the site of the accident to secure material evidence. The wreckage was later removed to a secure site within Sharjah International Airport. The French Bureau Enquêtes-Accidents was requested to provide assistance with the flight recorder read-outs and analysis and this was conducted within a week of the accident. Representatives from the propeller manufacturer Dowty joined the investigators and work continued on the first findings of the recorders and on the aircraft components. The technical investigation was closely coordinated and controlled by the GCAA during the initial onsite investigation and the collection of technical information, DFDR/CVR readouts, as well as the examination of the components removed from the wreckage.

The first factual findings of the investigation were published in an ADREP Preliminary Report issued on 01 March, 2004.

FINAL REPORT

This Final Report was released on 21 April, 2005 by the GCAA under the authority of the GCAA Director General.

TABLE OF CONTENTS

1.	FACTUAL INFORMATION
1.1	History of the flight
1.2	Injuries to persons
1.3	Damage to aircraft
1.4	Other damage
1.5	Personnel information
1.6	Aircraft information
1.7	Meteorological information
1.8	Aids to navigation
1.9	Communications
1.10	Aerodrome information
1.11	Flight recorders
1.12	Wreckage and impact information
1.13	Medical and pathological information
1.14	Fire
1.15	Survival aspects
1.16	Tests and research
1.17	Organizational and management information
1.18	Additional information
1.19	Useful or effective investigation techniques
2.	ANALYSIS
2.1	General
2.2	Flight Operations
2.3	Event
2.4	Technical
2.5	Human Factors
2.6	Summary
3.	CONCLUSION
3.1	Findings
3.2	Cause
3.3	Contributory cause
4.	RECOMMENDATIONS

5. **APPENDICES**

1. Sharjah Approach Plots
2. ATC Transcript
3. CVR Transcript
4. Report on CVR Spectrum Analysis
5. DFDR Graphs
6. Dowty Propeller Reports and Analysis
7. Accident Photographs

ABBREVIATIONS USED IN THIS REPORT

agl	Above Ground Level
amsl	Above Mean Sea Level
ALT	Altitude
AOM	Aircraft Operating Manual (Kish Airlines)
ATC	Air Traffic Control
BEA	Bureau Enquêtes Accidents
CAA-NL	Civil Aviation Authority – The Netherlands
CAO	Civil Aviation Organization (Islamic Republic of Iran)
cm	centimetre(s)
CRM	Crew Resource Management
CVR	Cockpit Voice Recorder
DFDR	Digital Flight Data Recorder
DME	Distance Measuring Equipment
EEC	Electronic Engine Controller
EMI	Electromagnetic Interference
FF	Fuel Flow
ft	Feet
GCAA	General Civil Aviation Authority (UAE)
h	hour(s)
HDG	Heading (Magnetic)
hPa	Hectopascals
IAS	Indicated Air Speed
ICAO	International Civil Aviation Organization
kg	Kilogram(s)

km	Kilometre(s)
kt	Knots
lbs	pounds
LH	Left Hand
m	Metre(s)
M	Magnetic (heading)
MDA	Minimum Descent Altitude (for non precision approach)
MHz	Megahertz
min	Minute(s)
MLG	Main Landing Gear
mm	Millimetre(s)
mph	Miles per hour
Nh (NH)	High pressure rotor speed
nm	Nautical Mile(s)
NP	Propeller Speed
PCU	Propeller Control Unit
PEC	Propeller Electronic Control
PF	Pilot flying
PLA	Power lever angle
PLP	Propeller Low Pitch
PNF	Pilot not flying
QNH	Setting on altimeter sub scale to indicate altitude above mean sea level
QRH	Quick Reference Handbook (Kish Airlines)
RH	Right Hand

SCU	Skid Control Unit
sec	Second(s)
SHJ	Sharjah Aeronautical Designator
SOP	Standard Operating Procedure(s) (operator)
TAT	Total Air Temperature
TQ	Torque
UAE	United Arab Emirates
UTC	Coordinated Universal Time
VMC	Visual Meteorological Conditions
VOR	VHF Omni-directional Radio Range
V _{REF}	Threshold Speed

1. FACTUAL INFORMATION

1.1 History of the flight

1.1.1 The aircraft was operating as a scheduled flight from Kish Island, Iran to Sharjah, UAE with the Captain initially as the pilot flying (PF). The crew reported nothing unusual to ATC for the take-off at Kish Island and the aircraft operated to Sharjah on the 35 min flight without event. The accident occurred on approach to Sharjah runway 12. The aircraft was operated in a dedicated passenger configuration as flight IRK 7170 and the radio call-sign was "Kish Air 7170".

1.1.2 At 1124 hours local time, the aircraft contacted Dubai Arrivals and was cleared from 9000 ft to 5000 ft and instructed to expect a VOR/DME approach to runway 12 at Sharjah International Airport. At 1129 hours the aircraft was further cleared to 2500 ft and cleared for the approach. The aircraft was under its own navigation and the daylight conditions were fine with excellent visibility. At 1135 hours the aircraft was instructed to contact Sharjah Tower and the pilot reported that the aircraft was established on the VOR final approach for runway 12. The Tower cleared IRK 7170 to land and advised that the wind was calm. This was acknowledged and there were no further radio transmissions from IRK 7170.

Another aircraft was positioned at the holding point of Sharjah runway 12 and the pilot was observing the progress of the Fokker F27 Mk.050 as he had been given a clearance to line up after this aircraft. The pilot stated that he saw the aircraft on what appeared to be a normal approach when it suddenly pitched down. It then commenced a steep left-hand spiral dive, which continued until impact with terrain. As far as he could recall, the aircraft impacted the ground approximately 10-15 seconds after the initial nose down movement in what he estimated to be a 60° nose down attitude. Impact was followed by a large volume of flame and smoke. Prior to impact, he stated that the aircraft appeared to be totally intact without any signs of fire. This was collaborated by the First Officer, who also witnessed the accident.

1.1.3 The crash alarm was activated immediately and rescue and fire trucks dispatched to the scene. The runway was closed and all inbound traffic diverted to regional aerodromes.

1.1.4 The aircraft impacted in a vacant sandy area within a residential area. The aircraft missed houses by about 60 m and crossed a bitumen road before coming to rest 50 m from the initial impact point. Local residents were able to assist with the rescue of those surviving passengers.

Place of Accident: 2.6 nm final to Sharjah International Airport,
United Arab Emirates Runway 12
Latitude : 25° 21.35' N
Longitude : 055° 28.63' E
Elevation : 110 ft amsl

Date & Time : 10 February 2004 - 1138 hours local UAE time
10 February, 2004 - 0738 hours UTC

1.2 Injuries to persons

There were a total of 43 fatalities and 3 survivors. Initially there were four survivors although one later died in hospital. Due to the severity of the injuries and subsequent fire, only a third of the fatalities were able to be recognized without the need of DNA sampling. The crew consisted of a Captain, First Officer, Purser, Cabin Crew member and two security personnel

Injuries	Nationality	Crew	Passengers	Total in Aircraft	Others
Fatal	Iranian	6	11	17	0
	Indian	0	13	13	0
	Egyptian	0	3	3	0
	Algerian	0	2	2	0
	Filipino	0	1	1	0
	Bangladeshi	0	1	1	0
	Cameroonian	0	1	1	0
	Emirati (UAE)	0	1	1	0
	Nepalese	0	1	1	0
	Nigerian	0	1	1	0
	Sudanese	0	1	1	0
	Syrian	0	1	1	0
	Total	6	37	43	0
Serious	Iranian	0	1	1	0
	Egyptian	0	1	1	0
	Filipino	0	1	1	0
	Total	0	3	3	0
Minor		0	0	0	0
None		0	0	0	0
Total		6	40	46	0

1.3 Damage to aircraft

Most of the aircraft was completely destroyed on impact and the ensuing fire and only the tail section was relatively intact.

1.4 Other damage

Apart from a deep scrape in a bitumen road next to the wreckage there was no third party damage, nor any environmental damage.

1.5 Personnel information**1.5.1 General.**

The required flight crew complement for the Fokker F27 Mk.050 was a Captain and First Officer. It was established that the Captain was occupying the left seat and was at the controls at the start of the events leading up to the accident. All crew members held the required licences, experience and training specific to their appointment.

- 1.5.2 Captain : Iranian National
Male 48 years
- Licence : Valid ATP Licence
Fokker F27 Mk.050 command type rating
- Medical Certificate : Class 1 valid until 21 February, 2004
- Flying experience : Total all types - 6440 hours
Other Types flown - Fokker F27-500
- Fokker F28
- Military aircraft
Total on Fokker F27 Mk.050 - 1516 hours
Last 90 days on F27 Mk.050 - 207.27 hours
Last 7 days on F27 Mk.050 - 28.40 hours
Last 24 hours on F27 Mk.050 - 5.13 hours
- Duty Times : Last 7 days - 47.54 hours
Last 48 hours - 13.48 hours
- Training : Fokker F27 Mk.050 initial - 07 April 02
Last Line Check - 04 August 02
Last Pilot Proficiency Check - 04 October 03
- 1.5.3 First Officer : Iranian National
Male aged 50 years
- Licence : Valid ATP Licence
Fokker F27 Mk.050 co-pilot type rating
- Medical Certificate : Valid until 26 March, 2004
- Flying experience : Total all types - 3978 hours
Other Types flown - Fokker F27-500
- Military aircraft
Total on Fokker F27 Mk.050 - 517 hours
Last 90 days on F27 Mk.050 - 132.29 hours
Last 7 days on F27 Mk.050 - 18.00 hours
Last 24 hours on F27 Mk.050 - 3.36 hours

Duty Times	:	Last 7 days	-	30.00 hours
		Last 48 hours	-	14.30 hours
Training	:	Fokker F27 Mk.050 initial	-	19 March 03
		Last Line Check	-	10 April 03
		Last Pilot Proficiency Check	-	03 October 03

1.5.4 Cabin Crew.

Documents were presented that indicated that the cabin crew member had conducted a formal cabin crew training course.

1.6 Aircraft information

1.6.1 General Information

Certification of Registration	:	Registered in Iran as EP-LCA
Certificate of Airworthiness	:	Issued 03 March, 2003 and valid
Registered Owner	:	Kish Airlines
Registered Operator	:	Kish Airlines
Aircraft Manufacturer	:	Fokker Aircraft BV (Netherlands)
Type	:	Fokker F27 Mk.050
Serial No.	:	20273 manufactured in 1993
Total airframe hours	:	20466 hours
Total cycles	:	19845 cycles

1.6.2 Maintenance Details.

Maintenance performed in accordance with the manufacturer's Maintenance Schedule for Fokker F27 Mk.050.

Date of last inspection	:	"A" Check conducted 24 December, 2003
Next maintenance review	:	20600 hours or 31 April, 2004

1.6.3 Technical Considerations.

The aircraft maintenance documents indicated that the aircraft had no deferred defects since the last daily inspection on 10 February, 2004. The Aircraft Technical Flight Log indicated that the aircraft was serviceable at the initial departure aerodrome of Kish Island. There was full compliance with Airworthiness Directives and Service Bulletins.

1.6.4 Engine Details

	Left	Right
Manufacturer	Pratt & Whitney	Pratt & Whitney
Type	PW-125B	PW-125B
Serial No.	124197	125068
Operating hours	11,196	24790
Cycles	8383	21437

There were no recorded defects for the flight or unscheduled maintenance since installation on 22 January, 2004.

1.6.5 Propeller details

	Left	Right
Manufacturer	Dowty Propellers	Dowty Propellers
Date of manufacture	13 January, 1988	12 August, 1992
Type	R352/6-123-F/1	R352/6-123-F/2
Serial No.	DRG/9401/87	DAP/0044
Operating hours	25868 hours	17161 hours
Time Since Last Overhaul	5730 hours	2380 hours

There were no recorded defects or unscheduled maintenance since overhaul and the aircraft technical logbooks indicated that there had been no scheduled or unscheduled maintenance conducted on the aircraft propeller components since the commencement of operations with Kish Airlines in March, 2002.

1.6.6 Skid Control Unit

The operation of an unmodified Skid Control Unit was determined to have a bearing on this accident. There was a known undesirable condition during the landing gear lowering sequence, whereby the secondary stop protection solenoid was energized through the Skid Control Unit and the subsequent loss of protection could allow the power lever movement into a ground control range in flight if the power levers were moved through the mechanical stop. This component is fully described at paragraph 1.16. There were no entries in any of the aircraft log books regarding the servicing or replacement of this component.

1.6.7 Operational details

A review of operational documentation indicated that the crew had all information for flight planning available prior to departure and there were no abnormalities found. The Kish Airline's Weight and Balance Manifest was a combined load sheet and weight and balance sheet and reflected the actual load of the aircraft. The details for this flight from Kish Island to Sharjah were;

Dry Operating Weight	-	13515 kg
Traffic Load	-	2980 kg
Zero Fuel Weight	-	16495 kg
Fuel	-	2000 kg (Jet A1)
Take-off Weight	-	18495 kg (Max 20820 kg)
Calculated % TO MAC	-	34.9
Estimated trip fuel	-	500 kg
Estimated Landing Weight	-	17995 kg (Max 19730 kg)
Estimated % LDG MAC	-	34.7
Average Passenger Weights	-	71.5
Cabin baggage	-	120
Cargo	-	0

1.7 Meteorological information**1.7.1 General.**

There was a general forecast of a weakening high pressure gradient covering the area with no low level instability expected. The actual weather at the time of the accident was fine with bright sunlight, slightly hazy with light and variable winds. Investigators at the scene reported clear skies and light variable winds with conditions as stated in the meteorological reports. Photographs taken from 2 km away and shortly after the accident occurred show the smoke rising almost vertically without wind effect.

1.7.2 Weather Conditions.

1.7.2.1 Sharjah Weather Report (Forecast). The forecast issued for the period 0000 to 2400 hours on 10 February, 2004 was 140/04 kt; CAVOK; BECMG 320/13 kt.

1.7.2.2 Sharjah Weather Report (Actual). The weather conditions recorded at 0730 UTC (8 minutes before the accident) and at 0746 hours UTC (8 minutes after the accident), were the same as recorded on the Airfield Terminal Information Service (ATIS). There were no reports of turbulence prior to the accident and helicopter crews operating into the accident site reporting smooth flying conditions.

	0730 hours UTC	0746 hours UTC
Wind :	Variable 3 kt (variable 300-100°)	360/05 kt
Visibility :	> 10000 m	>10000 m
Cloud :	nil	nil
Temperature :	23° C; Dewpoint 09° C	24° C; Dewpoint 07° C
QNH :	1022 hPa	1022 hPa
Warnings :	Nil	Nil

1.8 Aids to navigation**1.8.1 Navigation Aids.**

The navigation aids at Sharjah are VOR/DME for runway 12 as well as an ILS for runway 30. They conform to, and are in compliance with, Annex 10, Volume 1, Radio Navigation Aids. The runway 12 VOR/DME was operating on 112.30 MHz and there was no known unserviceability or abnormality prior to the accident. A functional check was conducted shortly after the accident, which confirmed normal operation.

1.8.2 Approach Chart

From the CVR, the Captain was heard to instruct the First officer to set 410 ft for the MDA, (published as 500 ft) and a final approach track of 118° M (published

as 117° M). No approach charts were found in the wreckage. All Sharjah approach charts were reviewed and apart from a reference of 410 (ft/min) in the Descent Gradient column, there were no references to these incorrect figures in the Jeppesen chart or the UAE AIP for VOR/DME runway 12. (Refer to Appendix 1).

1.8.3 Radar Plot.

The radar returns from Kish Air 7170 plot were recorded from the radar head at Dubai every 5 seconds from 10 nm. As a normal procedure to verify the aircraft's altitude corresponds to that observed on radar, an altitude check was requested by Dubai Approach when IRK 7170 was indicated as cruising at 9000 ft, just prior to descent. This altitude was confirmed by the aircraft. The radar plot, together with superimposed same time ATC communications, was available to the Investigation Team. The returns from the aircraft indicated that the aircraft intercepted the VOR/DME approach for runway 12 near position SAMAK (13 DME on the final approach track) at 2500 ft and when cleared for the approach at 8 nm DME descended to 900 ft at approximately 1500 ft/min remaining above the approach chart profile at a ground speed of 200 ± 2 kt. Approaching 1000 ft and after 4 DME the rate of descent reduced, the ground speed reduced sharply by 30 kt in 20 seconds and shortly after the returns became erratic with a "NMC" (No Mode Charlie on the altitude encoding) followed by an indication of 100 ft altitude. The indications from the last three plot returns were:

Time (UTC)	Lat/Long	Bearing/distance from SHJ VOR	Mode C (alt)	Groundspeed (kt)	Radar track (° M)
07 h 38 min 15s	N 25° 21' 24.9" S 055° 28' 09.5"	298/3.23 nm	900 ft	187	118
07 h 38 min 20s	N 25° 21' 11.7" S 055° 28' 13.3"	295/3.06 nm	NMC	177	No record
07 h 38 min 25s	N 25° 21' 19.2" S 055° 28' 32.6"	300/2.87 nm	100 ft	168	No record

1.9 Communications

All transmissions to the aircraft, as well as inter-agency telephone conversations, made by UAE ATC were clear, in the English language, and recorded. Transcripts were made of all communications involving IRK 7170 and the initial emergency response. There were no transmissions made by IRK 7170 indicating a problem and all conversation was given in a clear and unhurried manner. It was determined that the First officer made the communications to ATC from IRK 7170, except for all transmissions to Sharjah Tower. During all transmissions, no aircraft warning noises were heard. There was no transmission made on the recorded distress frequency of 121.5 MHz.

For arrivals into Sharjah, the Emirates Area Control Centre control and vector the aircraft until the aircraft approaches the Dubai airspace and the responsibility for arrival is transferred to Dubai Approach Control. For VOR/DME operations at Sharjah, Dubai Approach Control vector the aircraft towards the inbound VOR radial in accordance with Local Air Traffic Services Instructions and then transfer control to Sharjah Tower.

The UTC timing on the tapes was determined to be correct UTC time. (Refer to Appendix 2 for transcript). As all instructions issued by ATC were correctly acknowledged, radio communications between ATC and IRK 7170 were not considered a factor in this accident.

1.10 Aerodrome information

1.10.1 Aerodrome

Sharjah International Airport is a UAE international airport with full facilities. Runway 12 is aligned at 121° M and dimensions are 4060 m x 45 m with a Landing Distance Available of 3850 m. The approach to runway 12 is over a sparsely populated residential area with sandy vacate areas approximately 100 ft amsl.

1.10.2 Air Traffic Control

At the time of the accident the control tower was manned by correctly licensed and validated personnel.

1.10.3 Fire Services

Sharjah Airport Fire Services are categorised as Rescue and Fire Fighting (RFF) Category 9. The RFF facility was determined to be operating to RFF Category 9 at the time of the accident.

1.11 Flight recorders

1.11.1 Recovery

The Cockpit Voice Recorder, a Fairchild Model A100A, S/N 62252, and the Digital Flight Data Recorder (DFDR), a Fairchild Model F800, S/N 05023 were retrieved from the relatively undamaged tail section of the aircraft in very good condition. They remained under GCAA control and were presented to the Bureau Enquetes Accidents (BEA) in Le Bourget, France on 16 February, 2004 for extraction of the DFDR data and CVR transcription. The opening of the recorders and downloading of the data were witnessed by members of the GCAA Investigation Team. Both the DFDR and CVR timings were adjusted to UTC time.

1.11.2 Cockpit Voice Recorder

1.11.2.1 General. A satisfactory replay was obtained, which covered the conversations between crewmembers in Farsi and English, communications with Tehran, Dubai and Sharjah ATC in English and general cockpit sounds. The 32 minute duration recording was a good quality recording on 4 separate tracks (area microphone; Captain radio; First Officer radio and timing track). The replay commenced as the aircraft was climbing to 9000 ft after departure from Kish Island and ended within seconds of impact. Throughout the recording the crew is heard to conduct the approach briefing and pre-descent checklist in accordance with SOPs. The calculated threshold speed (V_{REF}) was stated as 100 kt, the company final approach speed ($V_{REF} +10$) was stated as 110 kt and the final figure for the company approach speed corrected for headwind was stated as 115 kt. At no time does the crew make any reference to an unserviceability or abnormality. A full transcript was made commencing from the time the aircraft intercepted the final approach track until after the recording stopped at impact. (Refer to Appendix 3 for full transcript).

1.11.2.2 Approach Anomalies

The Captain instructs the First officer to set 410 ft for the MDA, and not 500 feet as published on the Jeppesen chart and UAE AIP for VOR/DME runway 12. The Captain also instructed the First officer to set a final approach track of 118° M, and not the published track of 117° M.

1.11.2.3 Human Factors

From the CVR, the Captain is heard to hand over control of the aircraft to the First Officer during the descent to 2500 ft and to tell the First Officer that this will be the First Officer's flight. The First Officer is not expecting this and he does not accept this willingly as he is not confident of his ability to conduct the VOR/DME approach into Sharjah. The First Officer is heard to say that he doesn't have the same experience as the Captain to conduct this approach and the Captain insists. The Captain, in an attempt to boost the First Officer's confidence, is heard to encourage him and continued to assist him during the conduct of the approach. This generates some discussion and the First Officer continues to fly with the Captain giving advice on inbound track capture and approach profile. There is an inconsistency with this exchange as the First Officer had over 4000 flight hours, of which 600 hours were on the F27 Mk.050 aircraft and he had another 2400 hours as pilot in command on large turbo-prop aircraft (C-130). It was difficult for the Investigation Committee to understand why this pilot believed he didn't have the necessary experience to conduct a simple straight-in non precision approach in day VMC conditions. However, from the DFDR and radar plot, the First Officer positioned the aircraft above the normal approach profile, at a high airspeed and not configured for landing. At the time the Captain takes over control, the aircraft is at least 50 kt over the normal final approach speed, above a normal approach profile of 3° glide slope, and less than 3 nm from the threshold. This may be indicative that the First Officer did not know the SOP approach speed and configuration.

The CVR indicated that the Captain took over control of the aircraft and intended to hand over control again to the First Officer once the aircraft was on the correct profile for landing. The flap lever and landing gear selector are heard on the CVR to be moved when above their respective Aircraft Flight Manual limiting speeds. When compared with the DFDR data, the landing gear was determined to be selected down at approximately 185 kt (limiting speed of 170 kt). This was calculated to be 14 sec before there was an audible increase in propeller noise.

1.11.2.4 Final Approach and Landing.

The First Officer discusses the limiting altitudes and DME distances to be observed. On reaching the 4 nm point from the DME the First Officer is heard to disconnect the autopilot and shortly afterwards call for "Flap 10" then "landing gear down". The Captain then states that he has control. A few seconds later the propeller(s) RPM noise is heard increasing.

1.11.2.5 Spectrum Analysis

A spectrum analysis was conducted on the CVR area mike from 07 hr 38 min 10-12 s to determine if any sound on the CVR could be identified as the power levers moving into the ground control range. The spectrum analysis was based on the work carried out by the BEA during the investigation into the accident involving Luxair as well as further trials using the same aircraft type. (refer to Appendix 4). The target sounds heard were compared with a reference noise, and when analysed, presented several similarities in their shape, cadence and frequencies. The conclusion was the identification on the target noise as the movement of the ground range selector and then movement of the power levers. A further sound was heard similar to the movement of the power levers to a forward position

1.11.2.6 Combined CVR Comments and Spectrum Analysis

The following relevant comments and sounds are heard shortly after the autopilot is disconnected approaching 900 ft amsl (approximately 800 ft agl), 4 DME, at 185 kt in a clean configuration. The results of the additional spectrum analysis are included in *italics*

UTC Time		Comment
07 h 37 min 54 sec	-	Flap 10 command from First Officer (PF)
57 sec	-	click similar to flap lever hitting detent
58 sec	-	Landing gear down command from First Officer
	-	Click similar to landing gear lever hitting stop
	-	Wind noise similar to landing gear and door movement
38 min 01 sec	-	Click similar to flap lever hitting detent
03 sec	-	"With Me" as Captain takes over (PF)
05 sec	-	"I will make it" response from First Officer
06 sec	-	Triple chime commences (flap to 25° without landing gear)

07 sec	-	"I will give it back to you" from Captain
08 sec	-	"Okay" from First Officer
10 sec	-	Triple chime stops (when landing gear down)
11.3 sec	-	<i>sound consistent with lifting of ground range selectors</i>
12 sec	-	Increase in propeller noise
12 sec	-	"Why! (or woe betide us)" from Captain
12.6 sec	-	<i>sound consistent with release of ground range selectors</i>
14.1 sec	-	<i>sound consistent with movement of power levers (forward)</i>
15 sec	-	"Push it forward" (possibly power levers)
16 sec	-	"Can't raise it" (possibly nose attitude)

1.11.3 Digital Flight Data Recorder

1.11.3.1 General. A satisfactory extraction of the data was obtained but it was determined that there were no parameters for the landing gear, flying controls (aileron, elevator, rudder), power levers and lateral acceleration.

1.11.3.2 Approach & Event. The DFDR indicated that the aircraft had intercepted the final approach track for the VOR/DME runway 12 and descended from 2500 ft to 900 ft at an average airspeed of 195 kt, an average rate of descent of approximately 1000 ft/min and in a clean configuration. For the purposes of this report, event is defined as the movement of propellers into the ground control range.

UTC Time		Comment
07 h 37 min 48 sec	-	Autopilot disconnected
51 sec	-	Torque reduction (LH 5%; RH 0%)
57 sec	-	Flap angle moves from 0° at 186 kt at 960 ft amsl
38 min 06 sec	-	Then from Flap 10° at 183 kt at 950 ft amsl
10 sec	-	Reaches Flap 25° at 162 kt at 1000 ft amsl
38 min 11 sec	-	Commencement of event
11-13 sec	-	Low pitch lights on indicating both propellers move below a nominal 10° blade angle
	-	Both propeller RPM increase,
	-	commencement of gradual pitch down to 27°
	-	commencement of gradual bank to left of 35°
		Both engines reduce slightly below 74.01% NH (which is the flight idle setting)
		Reduction in fuel flow
15 sec	-	Sudden increase in
	•	LH fuel flow
	•	LH Engine torque
	•	LH Inter-turbine temperature (ITT)
21 sec	-	reduction in pitch and roll angles
26 sec	-	Roll angle 12° to left

- Pitch 17° nose down
- commencement of increase in pitch and roll angles
- 29.5 sec - Recording stops
- Heading 062° M
- Speed 113 kt
- Roll angle 47°
- Pitch 17° nose down

1.11.3.3 Low Pitch (LO PITCH) indications

The DFDR parameter for the low propeller pitch lights indicate that the left propeller entered the ground control range about 1 sec prior to the right propeller, yet the propeller RPM parameters indicated that both propellers moved simultaneously into the ground control range. This discrepancy of the low pitch lights could be explained by the parameter sampling rate, which is 1 per sec. It is conceivable that the time difference was only a fraction of a second but the low pitch light of the right propeller was recorded in the next sample. (Refer also to paragraph 1.16.2.7)

1.11.3.4 Engine/propeller relationship. The engine, aircraft and propeller manufacturers were in agreement that propeller behaviour in a ground control range during flight was unpredictable. However, from analysis of the DFDR data, there was a general consensus as to the propeller behaviour. The analysis estimations are summarized in the following table and reference should be made to paragraph 1.16 for further explanation and description.

1.11.3.5 Initial Power Lever Position. There is no DFDR parameter to indicate the position of the power levers. At time 07 h 37 min 51 sec, there is a power reduction, which equates to the power levers being at the flight idle detent even though there is a slight residual torque on the left engine. At the time of the event at 07 h 38 min 11 sec the DFDR indicated a reduction in fuel flow for both engines. At 07 h 38 min 12 sec the DFDR indicated a reduction in both engine high pressure rotor speed (Nh) below that calculated for flight idle. The command for a reduction in fuel flow can only be made by a power lever thus confirming both power levers were moved to a position below flight idle.

1.11.3.6 DFDR Summary. The following table indicates the DFDR engine and propeller data with the propeller pitch change event commencing at 07 h 38 min 11 sec.


TIME	TAT	IAS	ALT	HDG	TQ LH	TQ RH	NP LH	NP RH	PLP LH	PLP RH	NH LH	NH RH	FF LH	FF RH
hh:mm:ss	deg C	kts	ft	deg	%	%	%	%	disc	disc	%	%	lbs/hr	lbs/hr
7:38:01	23,8	183	951	116	3,6	0,0	85,3	85,2	0	0	76,1	77,0	275	245
7:38:02	23,8	179	954	116	3,6	0,0	85,3	85,1	0	0	75,8	76,8	268	245
7:38:03	23,8	178	954	116	3,6	0,0	85,3	85,1	0	0	75,9	76,8	275	250
7:38:04	23,8	173	960	115	3,6	0,0	85,3	85,1	0	0	75,8	76,8	268	250
7:38:05	23,8	169	973	116	3,6	0,0	85,1	85,0	0	0	75,9	76,8	274	245
7:38:06	23,3	168	990	116	4,5	0,0	85,3	85,1	0	0	76,5	76,6	281	239
7:38:07	23,3	164	990	116	3,9	0,0	85,2	85,1	0	0	77,2	76,3	303	239
7:38:08	23,3	161	995	116	3,5	0,0	85,2	85,1	0	0	77,0	76,2	291	240
7:38:09	23,2	156	1004	116	2,1	0,0	85,2	85,1	0	0	75,8	76,2	262	245
7:38:10	23,8	153	1004	115	2,9	0,0	85,2	85,1	0	0	75,2	76,5	256	227
7:38:11	23,8	153	1008	115	0,0	0,0	86,1	85,3	1	0	74,5	75,2	250	187
7:38:12	23,3	146	1006	115	1,3	0,0	94,5	94,2	1	1	72,9	73,4	209	187
7:38:13	23,8	139	974	113	4,5	0,0	89,7	99,0	1	1	72,3	73,6	202	338
7:38:14	23,3	135	950	113	6,8	0,0	86,1	101,3	1	1	78,6	78,0	401	245
7:38:15	23,3	135	923	114	13,6	0,0	85,9	102,0	1	1	81,2	77,7	375	397
7:38:16	23,2	132	884	112	44,5	0,2	88,9	105,5	1	1	87,5	82,6	583	413
7:38:17	22,7	127	824	107	82,6	0,0	88,4	106,5	1	1	93,4	81,8	914	338
7:38:18	22,7	127	764	103	98,8	0,0	86,1	106,5	1	1	96,0	81,1	1141	374
7:38:19	22,7	124	692	100	35,0	0,0	75,1	104,5	1	1	90,6	80,5	1071	221
7:38:20	22,7	123	621	94	23,7	0,0	67,3	100,8	1	1	83,1	76,8	338	233
7:38:21	22,7	130	543	87	6,8	0,0	76,4	98,3	1	1	82,7	75,5	410	239
7:38:22	22,7	129	454	82	4,0	0,0	87,8	97,3	1	1	79,8	75,2	287	250
7:38:23	22,7	131	355	78	5,5	0,0	87,5	97,2	1	1	77,9	75,4	250	250
7:38:24	23,3	130	264	74	3,4	0,0	85,2	97,0	1	1	76,4	75,9	234	368
7:38:25	23,8	128	182	71	12,8	1,9	87,4	101,8	1	1	79,2	82,0	293	560
7:38:26	23,8	124	106	67	39,0	0,0	88,9	106,1	1	1	87,2	85,1	573	354
7:38:27	23,3	122	38	61	56,8	0,0	87,1	106,8	1	1	90,4	83,1	750	362
7:38:28	23,3	116	4975	53	69,0	2,8	85,9	106,8	1	1	92,1	83,1	867	391

Flight Data Recorder information for propeller/engine (Commencement of event in red)

- 1.11.3.7 Human Factors. From the DFDR data, the flap and landing gear is selected above their respective limiting speed. Flap 10 is selected at 186 kt (limiting speed of 180 kt); Flap 25 is selected at 183 kt (limiting speed of 160 kt), and the landing gear is selected at approximately 185 kt (limiting speed of 170 kt). The approach is non standard as the speed is 60 kt fast and the aircraft is not configured with flap 10, landing gear down as required in the Kish Airlines AOM Volume 2.
- 1.11.3.8 Previous Flight. A check was conducted on the DFDR data from the previous landing conducted by this aircraft to ensure that there was no abnormality with the propeller ground/flight mode for the take-off and landing. The data indicated normal operations and discounted any power lever/engine control rigging possibilities.

1.12 Wreckage and impact information

- 1.12.1 There was a single crater found in a flat sandy area on the opposite side of the road to where the majority of the wreckage was found. The scorched sand crater indicated an impact explosion but no impact information such as aircraft attitude or heading could be determined. As the wreckage of the cockpit, fuselage and tail section was located within 30m of the initial impact crater, it could be determined that the aircraft had a low horizontal velocity at the time of impact. There was evidence of scraping across the road in the direction of where the burnt out cabin was located indicating that the momentum of the aircraft on impact was towards 050° M. The severed tail section was aligned 330° M. whilst the burnt out fuselage wreckage indicated that the aircraft came to rest on a heading of 340° M. No aircraft components were found outside this small debris field.

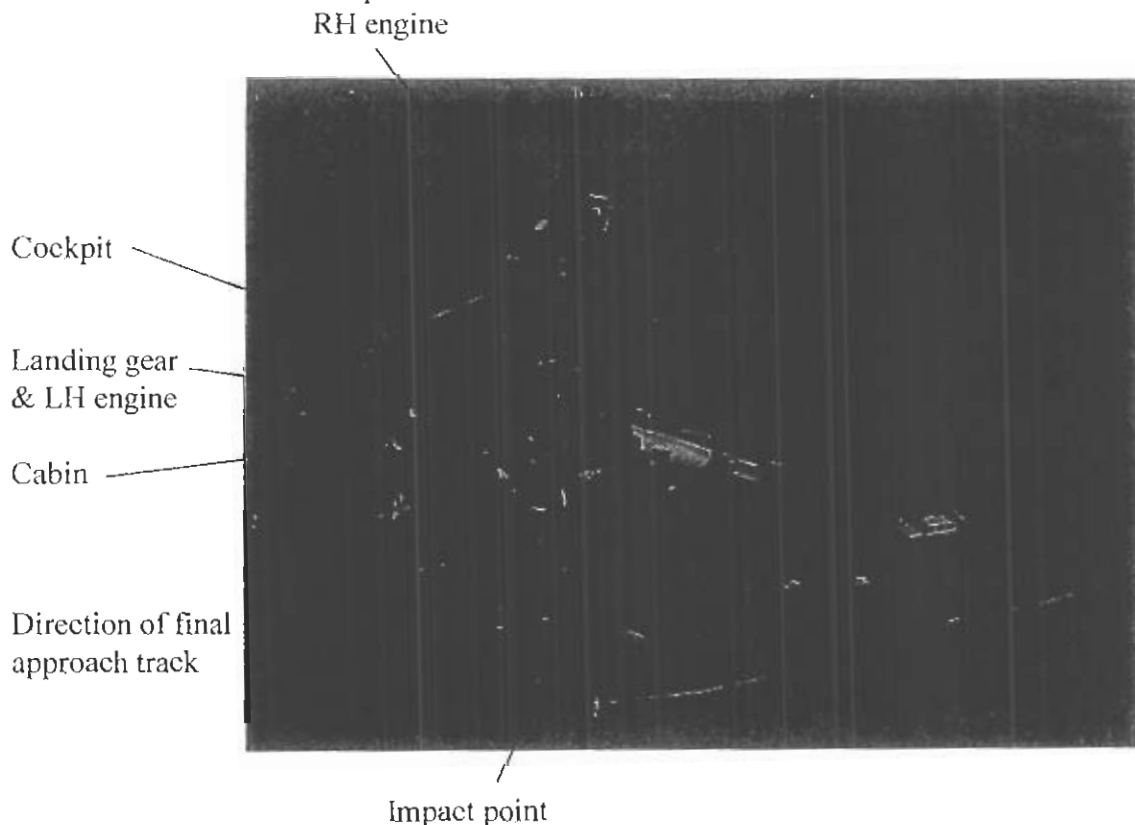

1.12.2 Landing Gear.

The landing gear was recovered from the main fuselage area and it could be determined that it was down and locked at the time of impact.

1.12.3 Flaps.

The flap jacks were all recovered and it was established that Flap 25° was set.

1.12.4 Cockpit.

Parts of the instrument panel were found but all cockpit instruments were totally destroyed. From one section of the centre console, it was clearly established that the landing gear lever was in the down position. Part of the power lever quadrant was recovered with the left power lever almost full forward and the right power lever about mid travel. The ground idle stop mechanism was burnt out and the position could not be established.

1.12.5 Engines.

The left engine was severely burnt as it was in the main wreckage whilst the right engine was thrown 50m clear on impact. Both of the power turbines were observed to be undamaged. Both the left and right hand engines displayed circumferential deformation to the compressor low pressure impellers characteristic of the gas generators being powered at the time of impact. There was no evidence of any release of internal engine components, nor evidence of bird ingestion, on any engine.

1.12.6 Propellers.

All propeller blades had sheared at the hubs on impact and were recovered from various sections of the debris field. Being of composite construction no impact information could be determined. The hubs were recovered as well as the applicable beta tubes, Propeller Control Units, Propeller Electronic Controllers, overspeed governors, but only one feathering pump could be found.

1.12.7 Skid Control Unit

The Skid Control Unit was found in a severely burnt condition.

1.12.8 Cabin Baggage and Freight

The recovered cabin baggage reflected that stated on the weight and balance manifest.

1.12.9 Weapon

A loaded 0.38 inch pistol, of Spanish make, serial number 13707 was found in the wreckage. Kish Airlines advised that a Sky Marshall was authorized to carry this

weapon with 36 bullets. Forensic testing confirmed that the weapon was one issued to the Sky Marshall and had not been fired.

1.13 Medical and pathological information

1.13.1 Investigation of the flight crewmembers' medical history confirmed that they met the CAO and ICAO Annex 1 medical standards for the licences held. Both pilots had a limitation for the wearing of glasses whilst exercising the licence privileges. There were no indications of any disorder that could have had a bearing on this accident.

1.13.2 The results of the pathological and toxicological examinations detected no carbon monoxide, drugs or alcohol in either pilot's system.

1.13.3 There was no evidence that physiological factors or incapacitation affected the performance of flight crew members.

1.14 Fire

1.14.1 From the scorching of the impact crater, adjacent power line and road, and further substantiation by witnesses, there was a large explosion on impact. The fire immediately engulfed the remains of the cockpit section. The fire spread to the main cabin area, totally destroyed it.

1.14.2 The rescue and fire fighting vehicles were not at the scene for almost 25 min after the accident. The access to the site by the rescue and police services was hampered by the number of private vehicles and people crowded into the restricted residential area. The fire was extinguished about 30 minutes after the accident but the wreckage continued to smoulder for a further hour.

1.15 Survival aspects

There were four survivors initially found in the fuselage section however one died on the way to hospital. A witness, who was on the scene very quickly, stated that the main fuselage was still intact when he arrived and he could hear people inside requesting help. Attempts were made to gain access to these passengers through the front door but it would not move as it appeared to be crushed and fire prevented access to the cabin through open sections of the fuselage. The fire intensified very quickly forcing rescuers away and it quickly engulfed that section of the fuselage. A photograph taken approximately 10 minutes after the accident showed the cabin totally engulfed. There may have been more survivors if immediate access to the cabin had been achievable. The survivors could not remember any details of their seating position although it was most likely that they were seated in the middle section of the main cabin behind the wing.

1.16 Tests and research

1.16.1 General.

The DFDR determined that both propellers entered a ground control mode as the propeller low pitch light illuminated. The Investigation Committee conducted the following research into the propeller(s) system and associated components.

1.16.2 Propeller

- 1.16.2.1 Description. The engine drives a variable-pitch, constant speed propeller. The pitch ranges from feathered, through zero pitch to full reverse. The propeller pitch angle varies in flight from $+15^\circ$ to approximately $+45^\circ$. Propeller pitch is controlled by balancing oil pressure provided by a high pressure pump driven by the propeller gear box, against the coarse pitch seeking force provided by counterweights attached to the blade roots. Should the oil pressure fail, such as after an engine failure, the counterweights assist the propeller blade angle to auto-coarsen to $+55^\circ$, which is a low drag windmilling condition. Automatic or manual feathering would achieve a blade angle of $+82.5^\circ$. The propeller pitch angle in the ground control range varies on the ground from $+15^\circ$ to -17° . Please refer to the Dowty Propeller report at Appendix 6 for a more detailed explanation of the propeller system, normal operation and analysis. Illustration 1 below indicates the power lever angle (PLA) and propeller pitch angle relationship.

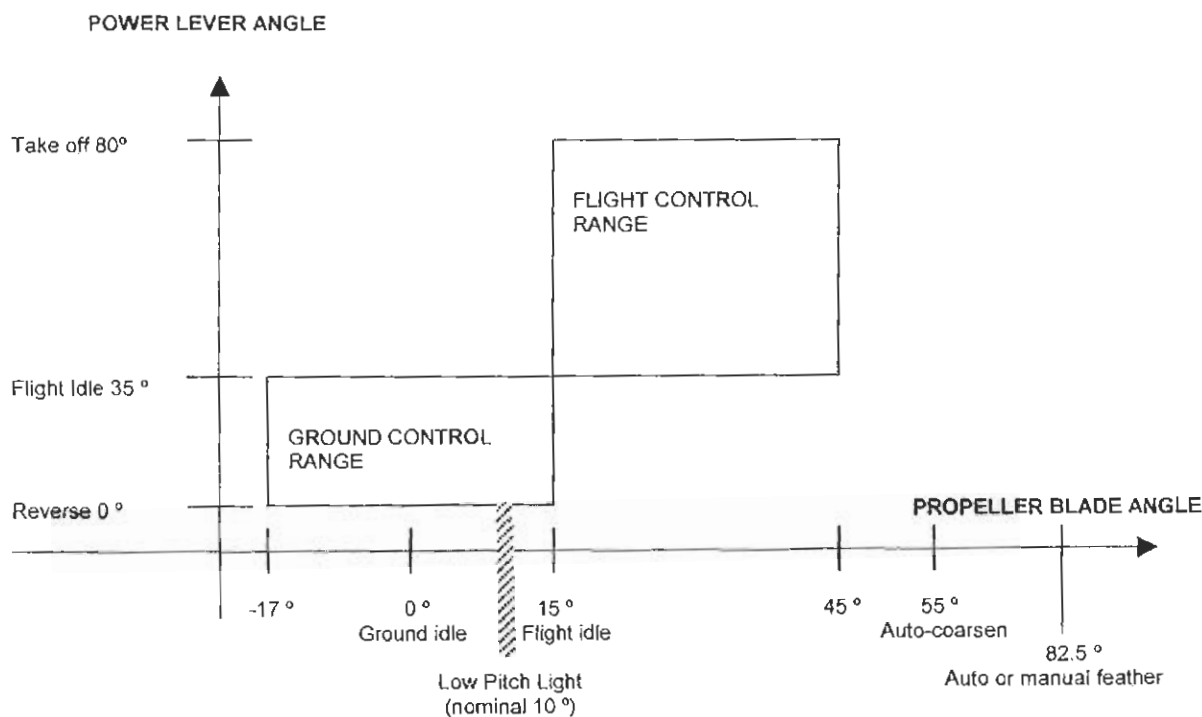


ILLUSTRATION 1

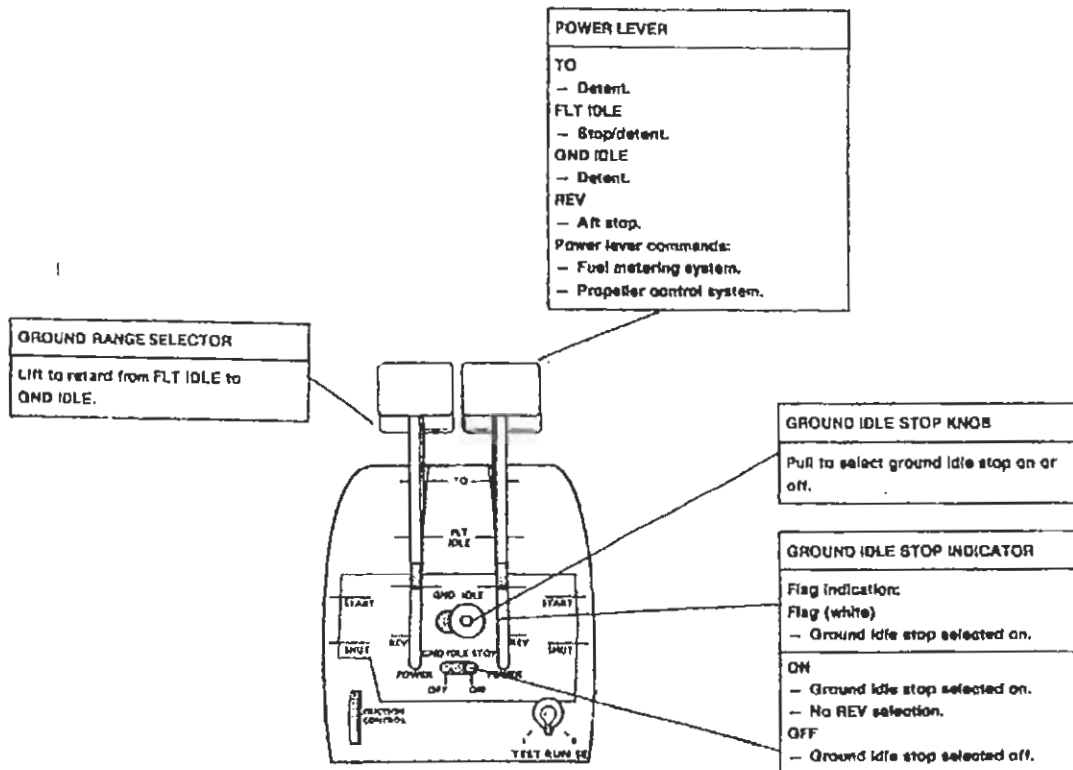


ILLUSTRATION 2

1.16.2.2 Control Ranges. There are two control ranges.

- Flight Control Range.** When the power levers are positioned at, or above, the flight idle detent, constant speed control is regulated automatically. This range is used for take-off and all phases of flight until landing. The Propeller Electronic Controller unit (PEC) controls propeller speed by varying the blade angle and propeller synchronizing is automatic.
- Ground Control Range.** On the ground, when the power levers are positioned at the ground idle detent, propeller pitch is directly controlled by the power lever position. The transition from constant speed control as described in paragraph (a) and direct propeller pitch control occurs when the power lever is positioned about half way the range between the ground idle detent and the flight idle detent. Below the ground idle detent position propeller pitch moves to reverse. The ground control range is also referred to the beta range as propeller pitch is controlled directly by varying high oil pressure through a beta tube to achieve the desired blade angle according to the power lever position. The ground control range is used for propeller braking effect such as for varying taxi speed and deceleration after landing.

1.16.2.3 Flight Protection. For a Fokker F27 Mk.050 in flight, should both propellers move into a ground control range, the resultant drag would affect the lift over the wings and tail plane and the aerodynamic lift/weight and thrust/drag moments would be altered. There may be an asymmetric condition to further affect the

controllability of the aircraft and the responsiveness of the engine may be affected by the propeller behaviour. The use of the ground control range in flight is considered by the Certification Authority (CAA-NL) to be a catastrophic event and as such, the effects on the aircraft controllability, propeller behaviour, and engine responsiveness have not been explored by the manufacturers. However, it is accepted that this condition would be extremely dangerous. Therefore, for the Fokker F27 Mk.050, the power levers are prevented from moving into the ground control range in flight by;

- (a) Mechanical flight idle stop (primary stop). To select ground control range after landing, the power levers must be in the flight idle position. The Ground Range Selector, which is fixed to the power levers, must be then physically lifted by a pilot to remove the mechanical stop so that the power lever can be moved backwards. This mechanism is designed to require a positive action by a pilot and cannot be accidentally moved. Refer to Illustration 3.

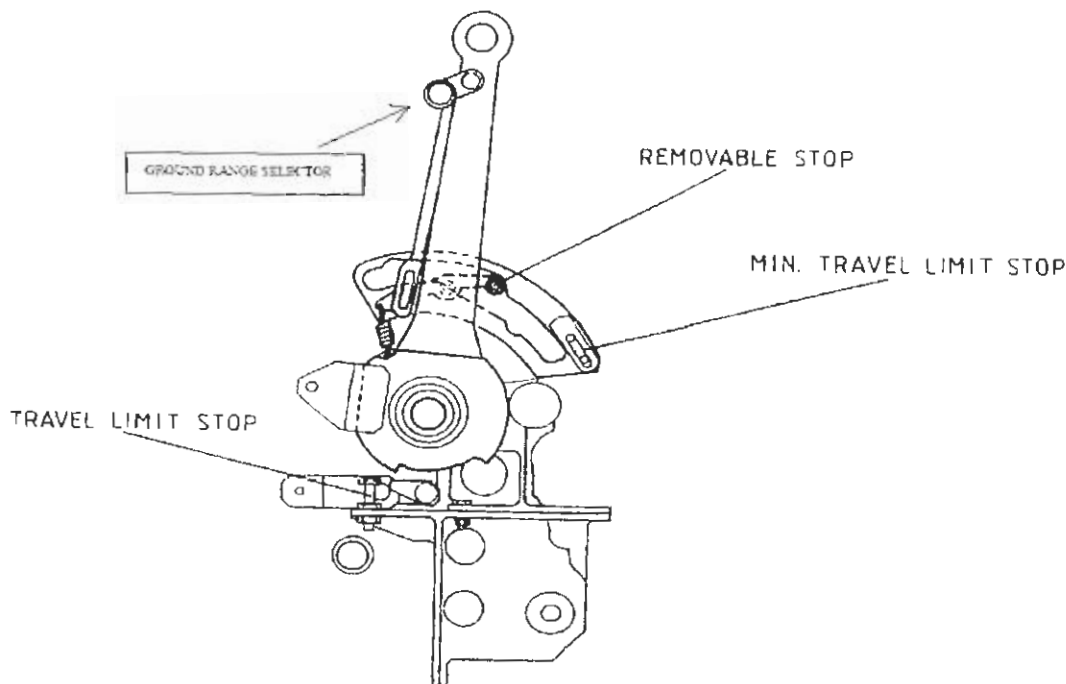


ILLUSTRATION 3

- (b) Electrical flight idle solenoid (secondary stop). Although not a requirement at the time the Fokker F27 Mk.050 was type certificated, there is an electrical flight idle solenoid (secondary stop) for each propeller located on each engine. Once energized the solenoid removes a flight idle lock lever. Each solenoid is powered through one Skid Control Unit and/or the Ground/Flight switches (refer paragraph 1.16.5 and Illustration 5). The solenoid prevents the corresponding power lever from moving from the flight idle position into a ground control range. Refer to Illustration 4.

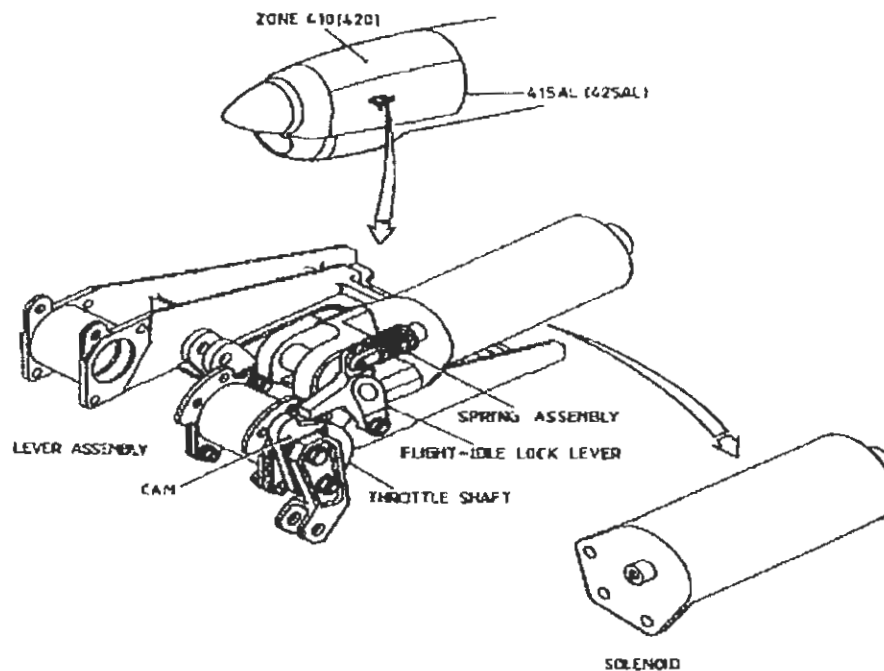


ILLUSTRATION 4

1.16.2.4 Loss of Protection in Flight

The electrical flight idle solenoid is designed as a back up safety feature to provide protection in case the primary protection fails or is removed by the pilot. Other than the reasons listed below, the aircraft manufacturer determined that there could be no system failure, or a combination of system failures, which could simultaneously overcome both electrical stops and place both propellers into the ground control range whilst airborne. The only known reasons for this secondary stop being deactivated in flight are as follows and except for (e) below, the loss of protection is limited to a period of 16 sec.

- (a) Lowering of the undercarriage when both up-lock switches are de-energized within approximately 40 micro sec of each other and only with a Skid Control Unit Part Number (6004125); or
- (b) EMI disturbance signals to either Skid Control Unit Part Numbers 6004125 or 6004125-1, or an unmodified aircraft (SBF50-32-035)
- (c) Use of the anti-skid test function to either Skid Control Unit Part Numbers 6004125 or 6004125-1; or
- (d) Cycling of the TOW switch (enables towing of the aircraft) to Skid Control Unit Part Numbers 6004125; or
- (e) Failure of one of the Ground/Flight switches to the Ground mode.

For this accident, the aircraft manufacturer indicated that (b) above; the likelihood of EMI on both wheel speed signals exactly at the same time was most unlikely and that (c) and (d) above could be discounted as the data provided by the flight recorders indicated that these switches were not activated and there was no evidence of an associated system failure. The reference to "aircraft manufacturer" means Fokker Aircraft B.V or Fokker Services B.V (refer also to paragraph 1.17.4).

1.16.2.5 Propeller Precaution

To ensure that pilots are aware of the danger of attempting to move a propeller into the ground control range in flight, the Fokker F27 Mk.050 Aircraft Operating Manual, Chapter 2, page 2.06.01 states:

PROPELLER OPERATING LIMITS

WARNING: DO NOT ATTEMPT TO SELECT GROUND IDLE IN FLIGHT. IN CASE OF FAILURE OF THE FLIGHT IDLE STOP, THIS WOULD LEAD TO LOSS OF CONTROL FROM WHICH RECOVERY MAY NOT BE POSSIBLE.

1.16.2.6 Ground Idle Stop Knob. A selectable Ground Idle Stop knob is installed at the pedestal to prevent selection of the power levers to the reverse position during a rejected take-off. This knob moves a mechanical lock so that the power levers cannot be moved from the ground idle detent towards reverse. Kish Airlines had issued a written instruction that the Ground Idle Stop knob was to be left in the "ON" position at all times for all flights. There was no reference heard on the CVR during the approach checklist indicating the position of the Ground Idle Stop knob. The positioning of this knob was not considered relevant as it had no effect on the resultant propeller behaviour.

1.16.2.7 Low Propeller Pitch Light. Should the power lever be brought into a ground control range, a blue light (LO PITCH) illuminates at a nominal figure of +10° propeller pitch angle and this is a recorded parameter on the DFDR. From the DFDR, both propellers low pitch lights illuminated and remained on until impact. As the right propeller was just in a flight control range on impact, further research was conducted on the tolerances of a low pitch light switch to determine how this could occur. The propeller manufacturer indicated the setting of the light switch could be within the range of 10° - 13.5° and that once the switch was set, there would be virtually no change to this range. The conclusion therefore was that the right propeller blade angle was moving within the ground control range towards the flight control range at impact and the next recording of the DFDR low pitch light parameter, which is every second, most likely would have indicated a change to the light off position.

1.16.3 Propeller Technical Analysis

1.16.3.1 General. The propeller components such as the propellers, hubs, beta tubes, pitch control units, feathering pumps and propeller electronic controllers were sent to the manufacturer Dowty Propellers of Gloucester, United Kingdom for further analysis under the direct supervision of the GCAA Investigation Team.

The research involved the propeller pitch settings on impact and any obvious malfunctions. Although the two propeller electronic controllers included a memory chip, it was established that any faults recorded, which could have indicated a propeller system fault, would activate a warning light on the pilot master panel in the cockpit. No single warning chime was heard on the CVR and there was no discussion by either pilot regarding any system faults. In addition, the propeller electronic controllers are only effective when the power levers are in the flight control range (above flight idle).

1.16.3.2 Relationship between Power Lever and Beta Tube Movement

Propeller pitch is linked mechanically to the position of the beta tubes in the PCU. When a power lever is moved to flight idle on approach for landing, the PCU hydro-electrical control system normally pressurises the fine pitch oil way to drive the beta tubes forward towards finer pitch. This is in order to maintain propeller RPM when the airspeed is low. The propeller is then being operated in beta control. The beta tubes and propeller stop moving toward fine when the propeller pitch reaches 15° because, below this point, the porting in the beta sleeve in the PCU cuts off fine pitch oil from the propeller and allows the coarse pitch-seeking counterweight forces to hold pitch at 15° . This is a key feature of the propeller system design and specifically addresses safety aspects as required by the certifying authorities.

In order for propeller pitch to fall below 15° and into the ground control range, only the power lever can determine the beta sleeve position through the PCU. Therefore the Ground Range Selector, which is fixed to the power levers, must be physically lifted by a pilot to remove the mechanical stop so that the PCU could position the beta tubes accordingly. Should there be a disconnect in the linkage between the beta sleeve and the power lever, a spring in the PCU would move the beta sleeve back to a 19.4° position, so preventing access to the ground control range.

1.16.3.3 Findings. The propeller manufacturer concluded that the propeller system was capable of correct operation up to the point of impact. Only a power lever movement could have caused the propeller pitch to move into the ground control range. The left hand propeller was determined to have impacted the ground at a blade angle of approximately -18° , which equates to the full reverse position and the right hand propeller was found to have impacted the ground at a blade angle of approximately $+15^{\circ}$, which is just in the flight control range. The accuracy of these positions was considered as $\pm 2^{\circ}$. Refer to Appendix 6 for the report from Dowty Propellers.

1.16.4 Propeller Behaviour

1.16.4.1 DFDR Analysis. The following propeller behaviour and power lever positions are based on the DFDR data and is summarised in the following table and accompanying notes.

Time reference	Engine related crew actions	Left hand powerplant		Right hand powerplant	
		Propeller pitch	Engine power	Propeller pitch	Engine power
7:38:10		+23 degrees	Idle	+23 degrees	Idle
7:38:11	Power levers pulled back into the ground range [1]	Between +3 and -2 degrees [2]	Idle	Between +7 and +3 degrees [3]	Idle
7:38:12		Moving to reverse	Idle	No change	Idle
7:38:13	Power levers slammed to the take-off position [4]	Moving to reverse	98 SHP	No change	Idle
7:38:14		Moving to reverse	144 SHP	No change	Idle
7:38:15		Moving to reverse	287 SHP	No change	Idle
7:38:16		Moving to reverse	973 SHP	No change	Slight increase in Nh, fuel flow limited by propeller overspeed governor.
7:38:17		Moving to reverse	1793 SHP	No change	Fuel flow limited by propeller overspeed governor.
7:38:18		-17 degrees	2090 SHP (max CRZ is 2030)	No change	Fuel flow limited by propeller overspeed governor.
7:38:19	Power levers pulled back to flight idle	No change	646 SHP	No change	Idle
7:38:20		Moving out of reverse [5]	391 SHP	No change	Idle
7:38:21		Moving out of reverse	128 SHP	No change	Idle
7:38:22		No change	86 SHP	No change	Idle
7:38:23		No change	118 SHP	No change	Idle
7:38:24	Power levers pushed forward.	Moving to reverse	71 SHP	No change	Idle
7:38:25		Moving to reverse	274 SHP	No change	Slight increase in Nh
7:38:26		Moving to reverse	853 SHP	No change	Slight increase in Nh, fuel flow limited by propeller overspeed governor.
7:38:27		Moving to reverse	1215 SHP	No change	Fuel flow limited by propeller overspeed governor.
7:38:28		Moving to reverse	1456 SHP	Increasing [6]	Fuel flow limited by propeller overspeed governor.

Notes:

- [1] The propeller low pitch signals on the DFDR data indicates that both power levers were moved into the ground range. The exact position to where they were moved cannot be determined, but it can be narrowed down as follows:
 - The highest position is the point where full beta control is established. Beta control should start when the power levers are retarded to a position approximately halfway between flight and ground idle.
 - The lowest position is ground idle because the SOP of Kish Air requires the ground idle stop to be ON during all phases of flight and no comments or noises were identified on the CVR tape that could suggest that the stop was selected to the OFF position.
- [2] The propeller blade angles associated with the power lever positions specified in [1] are +7 degrees (nominal) for the beta entry point and -2 degrees (nominal) for ground idle. Since the left hand propeller subsequently moved to the reverse position when the power lever was returned to the flight range, it can be concluded that the initial propeller pitch was at or below the self pitch change neutral point (where the sum of the aerodynamic, centrifugal and counterweight blade twisting moments is zero) when coarse pitch oil pressure was lost, which is estimated to be approximately +3 degrees for a propeller speed of 90 percent and an indicated airspeed of 140 knots, but not lower than -2 degrees.
- [3] The right hand propeller moved eventually to the minimum flight idle position and must therefore have been at or above the self pitch change neutral point, which is estimated to be approximately +3 degrees for a propeller speed of 100 percent and an indicated airspeed of 140 knots, but not higher than +7 degrees.
- [4] The variations in high pressure rotor speed (Nh) on both engines show that the crew continued to operate both power levers synchronously after beta entry (see figure 1). The excursions on the right hand engine are however much smaller due to interference from the propeller overspeed governor. The power increase on the left hand engine between 7:38:13 and 7:38:18 indicates that the power levers were placed in the take-off position.
- [5] The increase in propeller speed at 7:38:20 and 7:38:21, while engine power is still declining, indicates that the propeller is partly coming out of the full reverse position. This only happens during the period that the left hand propeller speed is below the selected constant speed setting (i.e. 85 percent).
- [6] The pitch angle of the right hand propeller may have increased during the final second(s) because the (coarse) self pitch changing moment became higher due to the reduction in forward speed.

1.16.4.2 Research-Movement Into Ground Control Range. Should a power lever be moved into the ground control range whilst airborne and the secondary stop did not function, it was possible for the propeller to quickly achieve a blade angle corresponding to the power lever position. The DFDR data and CVR spectrum analysis determined that the power levers were positioned into the ground control range. All manufacturers agreed that propeller behaviour within the ground control range in flight was unpredictable.

1.16.4.3 Research-Movement Back Into Flight Control Range.

All manufacturers agreed that propeller behaviour from the ground control range to the flight control range was unpredictable due to many variable factors. The following additional information is provided to explain those factors.

(a) Control modes.

The Fokker F27 Mk.050 propeller control system has two basic control modes:

- (1) Beta control for ground handling with a fixed relationship between power lever position and propeller blade angle. This control mode is active in the range from full reverse up to halfway between ground and flight idle. Propeller pitch is controlled in both directions (i.e. coarse and fine) by means of oil pressure.
- (2) Constant speed control for in-flight operation. This control mode is active above the beta range. Propeller pitch is changed in coarse direction by means of counterweights on the propeller blades and controlled in fine direction by means of modulated oil pressure. Fine pitch selections are limited in the constant speed range by a minimum blade angle set by the power lever position. This minimum blade angle will be reached in-flight only with a flight idle selection at very low forward speeds.

Either control mode can be selected by placing the power lever above or below the halfway position between ground and flight idle.

(b) Counterweight forces.

The blade twisting moments created by the propeller counterweights are not constant but diminish with a reduction in blade angle, to become zero at flat pitch. In reverse pitch the counterweights provide a blade twisting moment in the opposite direction, i.e. fine/reverse seeking. Forward speed of the aircraft will introduce an additional (aerodynamic) blade twisting moment that drives the blades to fine/reverse pitch. At the normal in-flight blade angles, these aerodynamic blade twisting moments are insignificant.

(c) Loss of propeller pitch control

A rapid power lever movement from beta range into the constant speed range may result in a propeller hang-up due to the fact that coarse pitch oil pressure is lost before the blades had attained a pitch angle where the counterweights provide sufficient blade twisting moment to coarsen the blades. The probability that the propeller blades will not coarsen into the normal flight range will increase with forward speed due to the additional aerodynamic blade twisting moments.

(d) Rate of Power Lever Movement

Both the CVR and DFDR evidence suggest that the power levers were moved back into the flight control range shortly after the event occurred. Whilst it is not known just how far and how fast the levers were positioned, it is considered most likely the First Officer moved them fully forward quickly 2 sec after the initiation of the event under the instruction of the Captain and existing situation. Both the aircraft and propeller manufacturers indicated that the chances for the propeller to regain the flight control range are improved, but not guaranteed, if the power levers are slowly moved forward and the initial power lever position was not below the ground idle position.

(e) Summary

Due to the unpredictable propeller behaviour, movement of the power lever from within the ground control range to the flight control range would have little initial effect on the movement of the propeller pitch towards the flight control range.

1.16.5 Skid Control Unit (SCU)

1.16.5.1 General. The SCU was designed to give optimum brake operation for all runway conditions by using wheel speed sensors in each main landing gear axle. However in addition the SCU consists of components, which energize the flight idle stop solenoids, and when energized, remove the secondary stop protection. (refer to paragraph 1.16.5.2 below for the SCU/solenoid relationship). As it was ascertained that the electrical flight idle solenoids did not prevent the power levers from moving into the ground control range, further research was conducted on the SCU. An analysis of the SCU was carried out by the manufacturer, Aircraft Braking System Corporation (ABSC) of Ohio, USA. It was ascertained from their investigation that this unit was the original unmodified version (part number 6004125) but no analysis of its operating performance could be determined due to the severe fire damage.

1.16.5.2 SCU/Solenoid Relationship. The flight idle stop solenoids are energized by the Ground Control Relay, which in turn is activated by either the;

(a) RH GND/FLT switch; OR

- (b) LH GND/FLT switch; OR
- (c) Wheel speed > 20 mph from RH inboard AND outboard wheel; OR
- (d) Wheel speed > 20 mph from LH inboard AND outboard wheel.

The latter two wheel speed signals are obtained from the Skid Control Unit. The Skid Control Unit is basically designed to provide optimum brake operation for all runway conditions. One of the basic inputs for this is the wheel speed of the different MLG wheels, sensed by the wheel speed sensors in each wheel axle. Hence, by using the wheel speed discretes from the Skid Control Unit, the Skid Control Unit forms a part of the system to control the Flight Idle Stop solenoids. The following Illustration 5 shows the relationship between the SCU and an electrical flight idle solenoid.

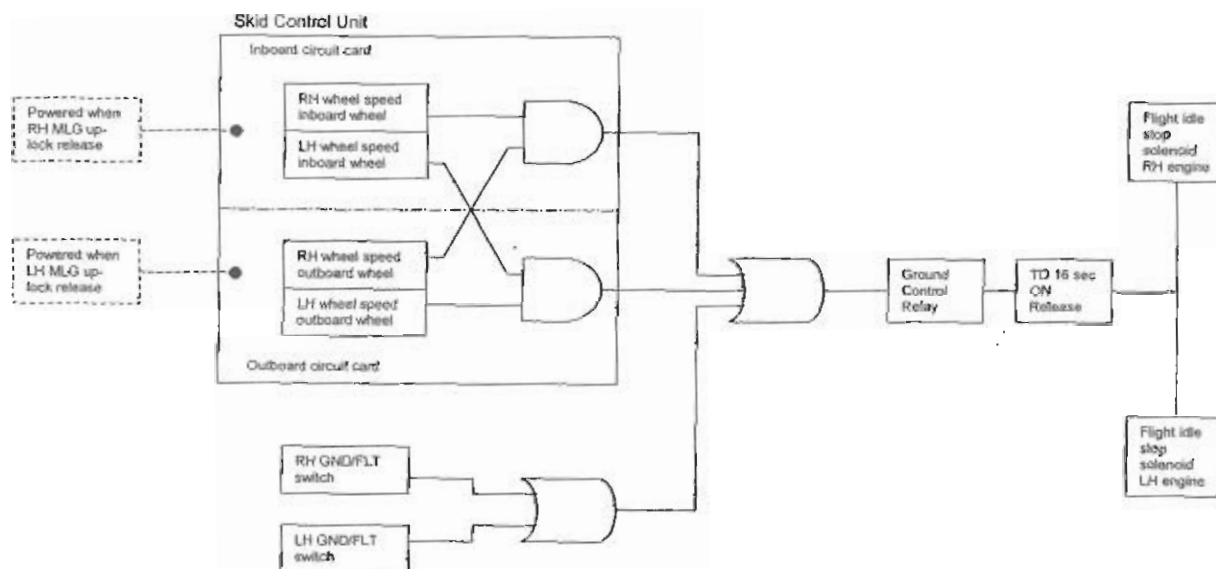


ILLUSTRATION 5

- 1.16.5.3 Undesired System Behaviour. The Skid Control Unit contains two channels which are electrically powered separately. The inboard card is powered when the RH MLG comes out of the up lock position and the outboard card when the LH MLG comes out of the up lock position.

In 1992 it became apparent that during power up the wheel speed discrete >20 MPH was activated for about 20 milliseconds. When the inboard and outboard wheel speed discretes overlap each other for a short duration the Ground Control Relay is activated (ref diagram) and subsequently the Flight Idle Stop solenoids are energized for 16 seconds (the 16 second delay has been introduced to prevent on/off switching in case of bouncing during the landing). In view of the short duration of the power up pulses it can be concluded that this only occurs when both MLG-up lock switches are activated at almost the same moment. To solve this phenomenon ABSC issued ABSC SB Fo50-32-04.

Subsequent to loss of braking reports it also appeared that EMI on the wheel speed wiring or on the Skid Control Unit test switch wiring could cause wheel speed signals as well. Subsequently Fokker Services issued SBF50-32-035 which improves the Skid Control Unit grounding and thus the EMI susceptibility. Furthermore, activating the anti skid test button in the cockpit, recommended by the Aircraft Operating Manual to check the anti-skid system in flight after a lightning strike with landing gear down, would also cause temporary activation of the >20MPH wheel speed discretes. To rectify all known abnormalities, ABSC issued SB 6004125-32-01 (includes ABSC SB Fo50-32-04 modification) which was covered by Fokker Services SBF50-32-038 (which asks also for accomplishment of SBF50-32-035).

Provided there was an inboard and outboard wheel speed discretes overlap, a possibility therefore existed on Fokker F27 Mk.050 aircraft with a Skid Control Unit Part Number 6004125 for the propeller(s) to be placed in a ground control mode should the power levers be deliberately or inadvertently brought over the mechanical primary stop whilst the Flight Idle Stop solenoids are energised.

- 1.16.5.4 Skid Control Unit Modification. To initially resolve this undesired system behaviour, ABSC SB Fo50-32-04 was issued. Once this first modification (Part Number 6004125-1), as notified by ABSC SB Fo50-32-04, was incorporated the aircraft manufacturer stated that there was no possibility of inadvertent energizing of the solenoid (unless EMI or use of the anti-skid test switch). ABSC then issued SB 6004125-32-01, which resolved the EMI and test switch anomalies.

1.16.6 Previous Accidents/Incidents Involving Fokker F27 Mk.050.

A similar accident had occurred to a Luxair Fokker F27 Mk.050, LX-LGB on 06 November, 2002. In that accident the Final Report from the Ministry of Transport of the Grand-Duchy of Luxembourg stated that the pilot brought the power levers over the mechanical stop and that the electrical solenoid stop did not prevent the propellers from entering the ground control range. This resulted in a drag situation from which recovery was not achieved. It was determined during that investigation that the event occurred within 16 sec of the landing gear being lowered and an unmodified SCU (Part Number 6004125) was fitted. From comparison of the engine/propeller plots of the DFDR data, the similarities between the recorded propeller and engine parameters are evident.

1.16.7 Performance.

From the aircraft load sheet, fuel documents and existing meteorological data, it was calculated that the threshold speed (V_{REF}) at a Flap 25 setting should have been 99 knots giving a company recommended final approach speed ($V_{REF} + 10$ kt) of 109 kt.

1.16.8 Standard Operating Procedures (SOPs).

The Kish Airlines AOM, Volume 2, on non precision approach procedures indicated an initial approach speed of 160 kt, reducing to 130 kt before the final approach fix. The aircraft was 190 kt at less than 3 nm from the threshold, and the DFDR had determined that the flap and landing gear limits had been exceeded contrary to the Aircraft Flight Manual and SOPs. The use of incorrect MDA and final approach track figures indicate that the crew briefing may have not been made using the current Jeppesen approach charts and contrary to the SOPs.

1.16.9 Other Technical Tests.

1.16.9.1 Enhanced CVR Testing. During the accident investigation of the Luxair Fokker F27 Mk.050, LX-LGB, noise spectrum analysis testing was conducted by the BEA and a comparison made with another Fokker F27 Mk.050 aircraft. The BEA was requested by the Accident Investigation Committee to conduct a similar enhancement test of the area mike sounds using data already gathered from this previous accident. The testing involved the area mike sounds recorded on the CVR at the time corresponding to when the propellers changed from the flight control mode to the ground control mode on the DFDR. During these tests, it was positively determined that a sound similar to the lifting of the Ground Range Selector was identified confirming that a pilot had brought the power levers over the mechanical stop into a ground control range position. A second test determined that it was unlikely that the ground idle stop knob was used.

1.16.9.2 Simulator Trials.

Trials were conducted in a Fokker F27 Mk.050 simulator, certified to JAR STD 1A level C standards. The use of the simulator was not intended to verify data, but merely to obtain a greater understanding of the aircraft systems and its operation. The simulator session was conducted using the same aircraft weight and meteorological conditions as IRK 7170. The following trials were conducted by a pilot member of the Committee;

- (a) Familiarization of the Fokker F27 Mk.050 instruments and systems. This permitted the team members to relate technical issues and system components with handling characteristics.
- (b) Effect of flap and landing gear extension. There were considerable elevator control forces experienced when lowering flap initially to 10° and then to 25° at a speed slightly above the limiting speeds. In addition it was noted that a triple chime sounded when 25° was selected and finished when the landing gear was down and locked.
- (c) Effects of propeller drag. This exercise was not able to be accomplished as there was no malfunction available to simulate a ground control mode in the air.

- (d) Whilst in flight, the power levers could not be physically moved into the ground control range. In addition, the Ground Range Selector could not be accidentally lifted.
- (e) There were no obvious ergonomic design abnormalities noted regarding power lever movement, detents and indicators.

1.16.9.3 Airflow Disruption

On the CVR the Captain was heard to infer that he couldn't raise the aircraft nose ("can't raise it"). In addition the DFDR indicated a 28° nose down pitch attitude shortly after the event. Whilst no trials had been conducted during the certification process, it was reasonable to assume that if both propellers went into a ground control mode in flight, there would be a decrease of lift of unknown magnitude over the wing directly behind the propellers and a large part of the tail plane and elevator would be in turbulent low speed airflow. In addition there would be aerodynamic moments associated with lift/drag and thrust/weight coupling so that the end result would be that the aircraft pitched down and pitch control could not be regained.

1.16.10 Previous Use of Ground Control Range In Flight.

1.16.10.1 Intentional. The propeller manufacturer stated that a slight movement between the mechanical lock and the electrical lock was provided by design. Provided that the solenoid operated correctly, this movement could result in additional propeller drag and could vary from aircraft to aircraft. The aircraft manufacturer investigated this further and determined that, at a high approach speed, the additional drag would be negligible. From discussions with technical personnel during the investigation, there were hearsay reports that pilots had deliberately raised the Ground Range Selector in flight on non specific turbo-propeller types and moved the power levers from the mechanical flight idle stop to the electrical flight idle stop to take advantage of the additional propeller drag. The use of this prohibited technique was to slow the aircraft down during a high speed approach. The accuracy of these hearsay reports could not be established and remains as hearsay. The reason for the use of the ground control range in the previous Fokker F27 Mk.050 accident involving Luxair was not determined. (refer to paragraph 1.16.6)

1.16.10.2 Unintentional. In a Fokker F27 Mk.050 Service Letter 137 to operators, the manufacturer stated that it had been reported that unintentional movement of the power levers by the handling pilot from the mechanical flight idle stop to the electrical flight idle stop had occurred in flight during turbulent weather conditions.

1.17 Organizational and management information

1.17.1 Operator

1.17.1.1 The Kish Airline organization was adequate in all audited areas and all management personnel were experienced and well qualified. There were adequate management policies and demonstrated financial viability.

1.17.1.2 Crew Resource Management Training (CRM). The operator had a formal and documented CRM course, which was approved by the CAO. Whilst the crew had conducted the operator's CRM course, the comments heard on the CVR from the crew indicated that during the approach phase of this flight, co-ordination and co-operation between crewmembers was not indicative of CRM principles.

1.17.1.3 Training. The Captain was a line Captain and not a Training Captain and there was no evidence that he had any instructional experience or training qualifications. Both pilot's initial training was conducted in accordance with CAO requirements. The initial ground school was conducted by Kish Airlines using an approved syllabus and the flight training was conducted in Stockholm, Sweden using a Fokker 27 Mk.050 simulator, which was certified to JAR STD 1A standards. The instruction given was by a CAO approved instructor and all recurrent checks were given every six months by CAO designated check airmen. The recurrent training included approved Line Operational Flight Training in the simulator and there were no adverse findings in either pilot's training reports. From the documentation it was noticed that both flight crew members had conducted flights from Kish Island to Sharjah on a regular basis. For a pilot to deliberately move the power levers back into the ground control range presupposes that the pilot had used this technique before or had been told about this technique from another pilot who had possibly used it. Kish Airline's management pilots were interviewed on this subject and none knew of any previous instances or general discussion having taken place on this subject. There was no restriction on landings by First Officers.

1.17.1.4 Operational Documentation. A review was conducted of the documentation and communication aspects. All manuals and documentation sighted by the investigation team were in good order and met the CAO requirements. All correspondence relating to the SCU from the State of Manufacture and the manufacturer was received by the operator. In respect to the All Operators Message AOF 50.022 warning from the manufacturer, it was received in the first instance by the Engineering Director of Kish Airlines. It was then copied to the Flight Operations Director, who created a Crew Information File (CIF No. 8), which required all crew members to be aware of primary protection and emphasized the importance of ensuring that the ground range selector levers are never lifted in flight. It was ascertained that the Captain of this aircraft had signed this CIF, having indicated that he had read it. The operator had received the Airworthiness Directive BLA Nr 2003-091 from the State of Manufacture. The operator stated that they fully intended to comply with this Airworthiness Directive before the time limit of 01 May, 2004 but the SCU was unmodified on the Fokker 27 Mk.050 fleet at the time of the accident.

- 1.17.1.5 Maintenance Documents. All maintenance documents indicated that the maintenance had been conducted in accordance with the CAO approved maintenance schedule. There had been no maintenance on the propellers or the SCU since the purchase of the aircraft in 2002. All documents were found to be in order.

1.17.2 Regulatory Authority

In respect to regulatory oversight all documentation was in order and there was a demonstrated and adequate regulatory oversight in continuing airworthiness and flight operations by the CAO.

1.17.3 Skid Control Unit Manufacturer

Aircraft Braking Systems Corporation (ABSC) issued the following relevant publications regarding the SCU.

- 01 August, 1992 - Service Bulletin Fo50-32-4 advising of a possible Skid Control Unit abnormality
- 29 June, 1994 - Service Bulletin Fo50-32-4, Revision 1 advising of modification of the SCU to part number 6004125-1 status to overcome abnormality identified above.
- 07 May, 2003 - Service Bulletin Fo50-6004125-32-01 advising of modification of the SCU to part number 6004125-2 status due to recognized electromagnetic interference.

1.17.4 Aircraft Manufacturer

Fokker Aircraft B.V was the original certificate holder of this aircraft and the aircraft was certificated to JAR 25. When this company went into bankruptcy in 1996, Fokker Services B.V took over the administration of the certificate and administration of airworthiness matters. The reference to "aircraft manufacturer" means Fokker Aircraft B.V before bankruptcy and Fokker Services B.V since that time. Prior to the Luxair accident, the aircraft manufacturer, issued the following publications regarding the solenoid secondary stop issue.

- 20 December, 1994 - Service Letter 137 informing all operators of the SCU abnormalities and the availability of a modification.

As a result of the Luxair accident, the aircraft manufacturer issued the following publications regarding the solenoid secondary stop issue;

- 14 November 2002 - All Operators Message AOF 50.022 for all operators of Fokker 27 Mk.050 aircraft, to recall the characteristics of the security systems of the propellers.

- 08 May 2003 - All Operators Message AOF 50.028 announcing the publication of:
 1. ABSC SB Fo50-6004125-32-01 notifying operators of the availability of the modification 2 to the SCU (part number 6004125-2 status), which was issued on 07 May, 2003.
 2. Fokker SBF50-32-038, which recommended incorporation of modification 2 to the SCU (part number 6004125-2 status).and stipulated that, with these modifications incorporated, abnormal braking, loss of braking at low speeds as well as unintended energizing of the flight idle stop solenoids were considered to be adequately covered.
- 08 May 2003 - Manual Change Notification/Maintenance Documentation MCNM-F50-045) incorporating the modifications to perform on the SCU.

1.17.5 Investigation Commission of Luxair Accident

Prior to the release of the Final Report into the Luxair accident, which occurred on 06 November, 2002, the Luxembourg Investigation Commission issued the following recommendations:

(a) Safety recommendation N°1, dated 15 November 2002:

“In order to avoid the failure of the Flight Idle Stop security, the Investigation Commission recommends that the opportunity should be evaluated to render the modification of the Antiskid Control Box (SCU) stated in the Service Bulletin be mandatory for all Fokker 50 aircraft.

Furthermore and without waiting for this modification, the Investigation Commission recommends that the crewmembers should be informed about the potential functioning of the system as mentioned above and about the content of Fokker message to all operators AOF50.022 dated 14 November 2002.”

(b) Safety recommendation N°2 dated 28 November 2002, recommended the publication of an airworthiness directive stipulating that:

- (i) Service Bulletin N° Fo50-32-4-revision 1 from ABSC; and
- (ii) Service Bulletin N° SBF50-32-035 from Fokker Services B.V.

be made mandatory for all Luxembourg registered Fokker F27 Mk.050 aircraft.

- (c) Safety recommendation N°3, dated 23 January 2003, stipulated that:

“In order to improve the functioning of the secondary safety Flight Idle Stop, the investigation commission recommends, that the announced publication of Service Bulletin Fo50-32-7 be speeded up and that its application be made mandatory for all Fokker F27 Mk.050 type aircraft.”

- (d) Safety recommendation N°4 dated 09 May, 2003 was made, recommending the publication of an airworthiness directive stipulating that:

(i) Service bulletin N° Fo50-6004125-32-01 from ABSC; and

(ii) Service bulletin N° F50-32-038 from Fokker Services B.V.,

be made mandatory for all Luxembourg registered Fokker 27 Mk.050 aircraft.

1.17.6 State of Design/Manufacturer

The Civil Aviation Authority of The Netherlands is the State of Design/Manufacturer and the aircraft was certified to JAR 25. Aircraft certification requirements stipulated that the selection of the ground control range may only be possible by a positive, distinct and separate action by the pilot. The provided mechanical stop to be removed by the pilot using the Ground Range Selector satisfied this requirement. The primary and the secondary stop system of the Fokker 27 Mk.050 was certified against JAR 25.1155 (change 9), which at that time, did not require additional protection such as a secondary stop. However, the aircraft manufacturer included a secondary stop on the Fokker 27 Mk.050 aircraft as an additional safety measure. JAR 25.1155 has since introduced an additional “means to prevent both inadvertent or intentional selection or activation of propeller pitch setting below the flight regime” for new aircraft certification.

On 31 July 2003, the CAA-NL issued an Airworthiness Directive BLA Nr 2003-091, rendering service bulletin N° F50-32-038 from Fokker Services B.V to be mandatory. (refer to Appendix 8) The compliance date for unmodified SCUs (part number 6004125) was 01 May, 2004 and 01 November, 2004 for the modified version (part number 6004125-1). Even though the Airworthiness Directive was issued as a direct result of the findings from the Luxair accident, the Investigation Committee noted that the emphasis of the Airworthiness Directive was directed toward a possibility of a brake failure problem and not to the propeller control problem as found to have caused the Luxair accident.

1.18 Additional information

Kish Airline’s personnel, who had met the pilots involved in this accident after their first flight on the day of the accident, had indicated that they were in good spirits. There were no known or noticeable problems with either crew member and they had flown together on numerous occasions including flights to Sharjah.

The CAO Medical Examiner interviewed family and friends and there were no known social or medical problems affecting either crew member.

1.19 Useful or effective investigation techniques

1.19.1 BEA

The use of the BEA facilities for the extraction of the data from the Flight Recorders was most effective. In addition, the use of the noise spectrum analysis equipment and comparison with another Fokker F27 Mk.050 aircraft positively determined that the ground range selectors were lifted and the power levers were moved from the flight idle position into the ground control range.

1.19.2 Dowty Propellers

The use of the Dowty Propeller laboratory facilities and metallurgic expertise was most effective in determining the blade angles on impact and an understanding of the propeller behaviour during the event.

1.19.3 ABSC

The laboratory analysis of the SCU was considered most useful as it confirmed the unmodified status of the component.

1.19.4 Pratt & Whitney Canada

The analysis confirmed the engines were functioning normally before the event and assisted the Committee in understanding the engine/propeller relationship once the power levers had entered the ground control range.

1.19.5 Simulator.

CAE Flight Training of Maastricht provided the investigation team with a full flight Fokker F27 Mk.050 simulator. The simulator provided effective techniques for determining indicative control forces, warning sounds and instrument indications as well as an understanding of the normal propeller behaviour.

1.19.6 Evidence and information regarding this flight would have been enhanced had a crash-protected image recorder been installed

2. ANALYSIS

2.1 General

2.1.1 Methodology

The following analysis was compiled from the factual information of Part 1. For the purposes of this analysis, the GCAA Aircraft Accident Investigation Committee used the methodology researched and developed by Professor James Reason of the University of Manchester. The Reason accident causation model is an industry standard, and has been recommended by ICAO for use in investigating the role of management policies and procedures in aircraft accidents and incidents. The methodology is amplified by italics.

2.1.2 Non Cause-related Factors

2.1.2.1 There were no weather, Air Traffic Control, communication or navigation aid considerations, which contributed to this accident.

2.1.2.2 The aircraft was correctly certified and maintained in accordance with the manufacturer's requirements. From the aircraft documentation and interviews with maintenance personnel the aircraft was considered fully serviceable for the second flight of that day.

2.2 Flight Operations

2.2.1 Departure

The crew were experienced and qualified to conduct the flight. The aircraft was observed to taxi, take-off and depart Kish Island normally.

2.2.2 Enroute

During the cruise and just prior to descent, the Captain was heard on the CVR to unexpectedly hand over control of the aircraft to the First Officer prior to the approach to Sharjah. The First Officer did not accept this willingly and stated that he was not confident of his ability to conduct a VOR/DME approach into Sharjah. This statement was not consistent with his previous experience and could indicate either a cultural or professional issue. The Captain insisted the First Officer fly the aircraft and was heard to encourage and instruct him during the approach.

This was identified as a local factor, which can affect the occurrence of active failures. Local factors are task, situational or environmental factors which affect task performance and the occurrence of errors or violations. This local factor was considered to have had a direct influence on the performance of both of the flight crew during the conduct of the flight.

2.2.3 Approach

The First Officer positioned the aircraft to be established on the final approach with the auto-pilot on and descended whilst remaining slightly above the approach profile. The visibility was good, there was no known turbulence, and the crew should have had the runway in sight throughout the approach. The initial speed for the approach was at least 50 kt high at approximately 190 kt with no flap and no landing gear. From the SOPs, the aircraft should have been configured with landing gear down and flap 10° during the approach and stabilized at 130 kt prior to the MDA. Approaching the MDA at flight idle setting, the auto-pilot was disengaged and the First Officer called for Flap 10 at 186 kt (limiting speed of 180 kt) and Flap 25 was selected by the Captain (uncalled for) at 183 kt (limiting speed of 160 kt), and the landing gear was called for and selected at approximately 185 kt (limiting speed of 170 kt). The Captain then took control of the aircraft and shortly afterwards the ground range selectors were heard by CVR spectrum analysis to be lifted and the power levers moved from the flight idle stop into the ground control range.

These were identified as active failures, which are errors and violations and have an immediate adverse effect. Active failures are or may result in unsafe acts, which most generally involve the actions of operational personnel. Such failures can be divided into two distinct groups; errors and violations. Errors involve attentional slips or memory lapses, and mistakes. Violations involve deliberate deviations from a regulated practice or prescribed procedure.

2.3 Event

2.3.1 Commencement of Event (07 h 38 min 11 sec)

During the course of the investigation, it was determined that the possibility of a system failure, or a combination of system failures, which could occur in flight simultaneously and place both propellers into the ground control range was extremely improbable. From the analysis of the technical factual information, it was determined that propeller pitch was linked mechanically to the position of the beta tubes in the PCU and had a fail safe mechanism within the PCU. Therefore, the propellers can only move into the ground control range if the power levers are physically moved rearward beyond the flight idle detent. This movement was also confirmed at the time of the event by;

- (a) the high pressure rotor speed (Nh) momentarily reducing below the flight idle setting of 74.01%; and
- (b) a corresponding decrease in fuel flow below that already indicated for flight idle. This decrease could only have been commanded by the rearward movement of the power levers; and
- (c) the CVR spectrum analysis

2.3.2 Aircraft Pitch Down.

On selection of the power levers into the ground control range, the propeller pitch changes resulted in decrease of lift over the wing and turbulent low speed airflow over the tail plane and elevator. Coupled with other aerodynamic moments associated with lift/drag and thrust/weight coupling, the aircraft pitched down and remained in a nose low attitude. The aircraft then commenced a roll to the left most likely due to the asymmetric drag effects of the different propeller pitch angles.

2.3.3 Propeller Behaviour.

The left propeller then went to full reverse whilst the right propeller remained in positive pitch within the ground control range. The propeller behaviour could not be accurately ascertained and the relevant manufacturers agreed that propeller behaviour would be unpredictable once the ground control range was entered in flight.

2.3.4 Initial Power Lever Position. At time 07 h 38 min 11-12 sec both power levers moved into the ground control range for less than 2 sec. The propeller system was designed to move very quickly to the corresponding position of the power levers on the ground and this is most likely what happened on this occasion in-flight. It could not be accurately determined where the power levers were initially placed but it can be concluded that the corresponding initial propeller pitch of the left propeller was at or below the self pitch change neutral point which is estimated to be approximately +3 degrees and that the right propeller was at or above the neutral point of +3 degrees. The corresponding power lever position is much closer to the ground idle stop than the flight idle stop.

2.3.5 Effect of Moving Power Levers Forward. At 07 h 38 min 13 sec, both the CVR and analysis estimations verified that the power levers were moved to the take-off position. Whilst in flight, should a power lever be quickly positioned fully forward from the ground control range, the movement of the propeller pitch angle back into the flight control range would depend upon the oil pressure available to the propeller pitch control, the aerodynamic blade twisting moment, counterweight forces as well as inherent seal and system frictions. It can only be assumed that differences in these factors allowed the right propeller to gradually move towards the flight control range and for the left propeller to move to full reverse.

2.4 Technical

2.4.1 Maintenance Status

The aircraft documentation indicated that all required maintenance had been conducted in accordance with the CAO approved maintenance schedule. There were no deferred defects and there had been no maintenance on the propellers or the Skid Control Unit since the operator purchased the aircraft in 2002.

2.4.2 Serviceability

From the DFDR, all engine parameters indicated that they were continuing to operate at normal power without unusual vibrations or power fluctuations. The parameters of the DFDR were sufficient to determine from the data that all recorded aircraft systems were working normally without any technical fault or malfunction being evident during the approach. There were no warnings associated with instruments or systems and the CVR made no reference to any problem.

2.4.3 Lack of Propeller Secondary Stop Protection

Lack of propeller secondary stop protection was found to be caused by inadvertent energizing of the flight idle stop solenoids. Whilst no evidence of electromagnetic interference was researched, the flight idle stop solenoid protection was not available for both propellers at the time of the event and it was determined that the energizing of the flight idle stop solenoids occurred 14 sec into the known 16 sec window after lowering the landing gear. The likelihood of EMI affecting both solenoid stops simultaneously was considered remote by the aircraft manufacturer. It was therefore concluded that the source of the inadvertent energizing of the flight idle stop solenoids was a known anomaly within the SCU which was initiated by the lowering of the landing gear.

2.4.4 Skid Control Unit

The original unmodified version of the SCU was known as early as 1992 of there being a remote possibility that the solenoid secondary stop may be unavailable for a period of 16 sec after the landing gear was lowered. A modified version became available in 1994. After receiving subsequent reports about loss of braking, investigation by the aircraft manufacturer determined that the SCU was susceptible to EMI therefore a second modification was made available in 2003. The EMI related problem only resulted in temporary loss of braking and there were no known reports about EMI affecting the flight idle solenoids. Therefore the rectification of this problem had a lower priority. The investigation team inquired about the perceived lack of priority given by the aircraft manufacturer and certifying authorities to the rectification of the solenoid secondary stop problem prior to the Luxair accident. The response was that the risk potential was considered extremely remote as it firstly required a pilot to conduct a prohibited action and for the main landing gear up-lock switches to be activated at almost the same moment. There were also additional adequate and satisfactory modifications, safeguards and warnings in place. In addition, the aircraft certification basis did not require this additional protection.

This was identified as a latent failure, the implications of which were not immediately apparent and lay dormant for a considerable time.

2.5 Human factors

2.5.1 Movement of Power Levers into Ground Control Range. The propellers can only move into the ground control range if the power levers are physically moved past the primary stop by a pilot. The reason for the movement of the power levers into the ground control range could not be determined but there was nothing in the CVR comments or other evidence to suggest that this action was deliberate. The following factors were considered;

(a) Previous Occurrences. One reported occurrence involving an action by a pilot was the previously discussed Luxair accident. Another reported occurrence involved turbulent weather conditions. From the CVR and actual weather conditions observed at the time of the accident, turbulence was determined not to be a factor.

(b) Inadvertent Movement. There were two hypotheses considered.

(1) It was possible that a pilot was aware of the possibility to move the power levers over the mechanical stop to the electrical stop on the Fokker F27 Mk.050 aircraft. The pilot, in an attempt to slow the aircraft quickly, may have reverted to a conditioned response from previous experience(s) on this aircraft or another previously flown turbo-propeller aircraft type. This hypothesis was not supported by the evidence but in the opinion of the Accident Investigation Committee could not be discounted.

(2) From the comments on the CVR at 07 h 38 min 03 sec, it could be assumed that the Captain took over control of the aircraft and was the pilot flying at the time of the event. However, as the First Officer was questioning the Captain's take over, a possibility existed for the First Officer to still have his left hand on the power levers. Should the Captain attempt to place his hand on the power levers whilst the First Officer still had his hand on them, it could be a possibility for the Captain's fingers to actually grasp the ground control selectors in the mistaken belief that he held the power levers. Any attempt by the Captain to move the power levers rearwards to a perceived flight idle position may have resulted in the inadvertent lifting of the ground control selectors and rearward movement. This hypothesis was also not supported by the evidence as the CVR indicated the First Officer appeared to relinquish control at 07 h 38 min 08 sec, which was approximately 3 sec before the event. However, in the opinion of the Accident Investigation Committee, it could not be discounted.

2.5.2 The defences against this risk included notification by the aircraft manufacturer to all operators and regulatory authorities of the problem, and the introduction of an Airworthiness Directive. In addition, Kish Airlines notified all pilots in writing of the danger associated with the use of the ground control range in flight and each pilot, including the crew of EP-LCA, signed as having read the content.

The certification of the Fokker F27 Mk.050 aircraft provided adequate and appropriate defences under normal operating procedures. However, once Standard Operating Procedures were not complied with, the level of defences in place proved to be inadequate and did not protect against human failures arising from the combination of active, latent and local factors.

3. CONCLUSIONS

3.1 Findings

- (a) The operator was correctly authorised by the Iranian CAO to operate Fokker F27 Mk.050 aircraft on scheduled international commercial operations.
- (b) The aircraft was correctly registered, insured, and held a valid Certificate of Airworthiness.
- (c) The aircraft was serviceable on departure from Kish Island with no known mechanical defects for the flight to Sharjah.
- (d) The aircraft was within the centre of gravity limitations and carried sufficient flight fuel, plus reserves. The load-sheet was determined to be correct for the manifested passengers, cabin baggage and fuel.
- (e) The crew were correctly licensed, rated, and met the recent experience and proficiency requirements for the Fokker F27 Mk.050.
- (f) Each crewmember held a valid and appropriate medical certificate and neither suffered from a known medical condition or injury.
- (g) All required information for the safe conduct of flights and the maintenance of Fokker F27 Mk.050 aircraft was current and available.
- (h) The crew approach briefing for a non precision approach to Sharjah Runway 12 VOR/DME stated non-published approach chart figures for final approach track and minima.
- (i) Just prior to intercepting the final approach in day VFR conditions the Captain advised the First Officer to fly the approach. The First Officer either for cultural or professional reasons, stated that he did not consider himself capable or prepared for this approach.
- (j) The First Officer flew the approach adequately in azimuth but high on the descent profile; at least 60 kt fast initially and not configured correctly in accordance with the SOPs.
- (k) The flap 10, flap 25 and landing gear were lowered above their respective limiting speeds, as described in the AOM and SOPs to decelerate the aircraft.
- (l) The selection of the landing gear down deactivated the second safety device (solenoid secondary stops) for a period of 16 sec. This was a known abnormality associated with an unmodified Skid Control Unit as fitted to this aircraft.

- (m) There was no legal requirement for the Skid Control Unit to be modified however an Airworthiness Directive was in effect for modification of the Skid Control Unit with a future compliance date of 31 May, 2004
- (n) The Captain took over during the final approach and shortly afterwards, the ground range selectors were lifted and the power levers momentarily moved from the flight idle position through the mechanical stop to the ground control range at a time the secondary (automatic) stop was not available. This action was not in compliance with the Standard Operating Procedures and Aircraft Flight Manual warning.
- (o) The pitch on both propellers moved rapidly into a ground control range to an undetermined blade angle but considered to be approximately +3 degrees.
- (p) The aircraft pitched down most likely due to a combination of disrupted airflow created by the propellers over the wing and tailplane and altered aerodynamic moment effects. The asymmetric propeller drag effects induced and maintained a roll to the left.
- (q) Within 2 sec of the commencement of the event, the power levers were moved back into the flight control range to the take off setting. Due to the unpredictable propeller behaviour within the ground control range in flight, movement of the power lever to the flight control range would have little initial effect on the movement of the propeller pitch towards the flight control range.
- (r) The left propeller pitch continued to move to a full reverse position due to resultant negative blade twisting moments, localized forces and a lack of oil pressure hydraulic effect. It remained in a full reverse position until impact. The right hand propeller pitch gradually moved from the ground control range towards the flight control range as permitted by the resultant positive blade twisting moments, localized forces and hydraulic effect.
- (s) The aircraft descended in an extreme nose low left bank attitude until impact.
- (t) The aircraft crashed 2.6 nm from the runway onto an unprepared sandy area adjacent to a road and residential buildings. The aircraft broke apart on impact and a fire started immediately.
- (u) The Crew Resource Management training provided by the operator did not promote good flight deck communication and actions on this occasion.
- (v) The training and awareness programmes and other defences provided by the operator did not protect against human failures.
- (w) The Civil Aviation Organization's safety oversight of the operator's procedures and operations was adequate.

- (x) Evidence and information regarding this flight would have been enhanced had a crash-protected image recorder been installed

3.2 Cause

During the final approach, the power levers were moved by a pilot from the flight idle position into the ground control range, which led to an irreversible loss of flight control.

3.3 Contributory Causes

- 3.3.1 By suddenly insisting the First Officer fly the final approach, the pilot in command created an environment, which led to a breakdown of crew resource management processes, the non observance of the operator's standard operating procedures and a resultant excessive high approach speed.
- 3.3.2 An attempt to rectify this excessive high approach speed most likely resulted in the non compliance with the Standard Operating Procedures and the movement of the power levers below flight idle into a prohibited regime.
- 3.3.3 The unmodified version of the Skid Control Unit failed to provide adequate protection at the time of the event.


- 4.1 The Dutch Transport Safety Board and Civil Aviation Authority is recommended to note the circumstances of the accident.
- 4.2 The Civil Aviation Authority of The Netherlands is recommended to ascertain the modification status of the Skid Control Unit of all Fokker F27 Mk.050 aircraft and to strongly urge non-compliant operators to modify the Skid Control Units.
- 4.3 The Iranian CAO is recommended to ensure Kish Airline pilots are made aware of the pertinent contents of this report and to ensure initial and recurrent training stresses the prohibition on the use, or attempted use, of the ground control range in flight.
- 4.4 ICAO is recommended to consider the installation of crash-protected image recorders on aircraft used in commercial air transport operations.

5.


APPENDICES

- 1 - SHARJAH APPROACH PLOTS
- 2 - ATC TRANSCRIPT
- 3 - CVR TRANSCRIPT
- 4 - REPORT ON CVR SPECTRUM ANALYSIS
- 5 - DFDR GRAPHS
- 6 - DOWTY PROPELLER REPORTS AND ANALYSIS
- 7 - ACCIDENT PHOTOGRAPHS
- 8 - DOCUMENTATION (Not included - GCAA use only)

APPENDIX I

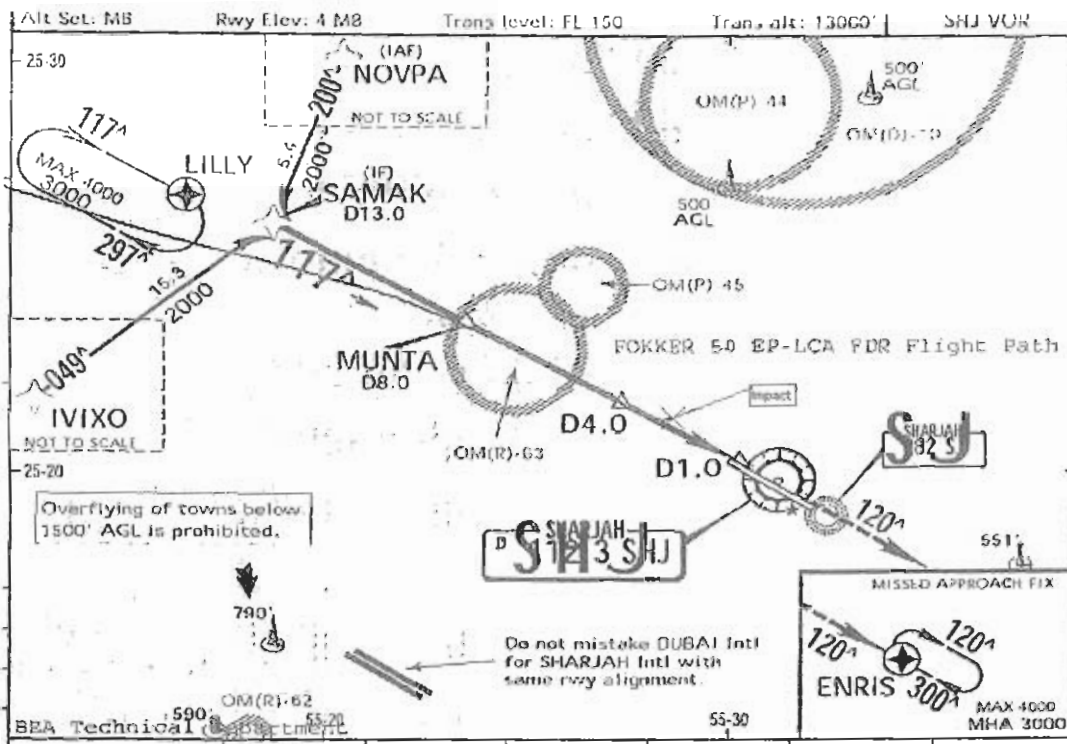

AIRCRAFT HORIZONTAL PLOT (DFDR)

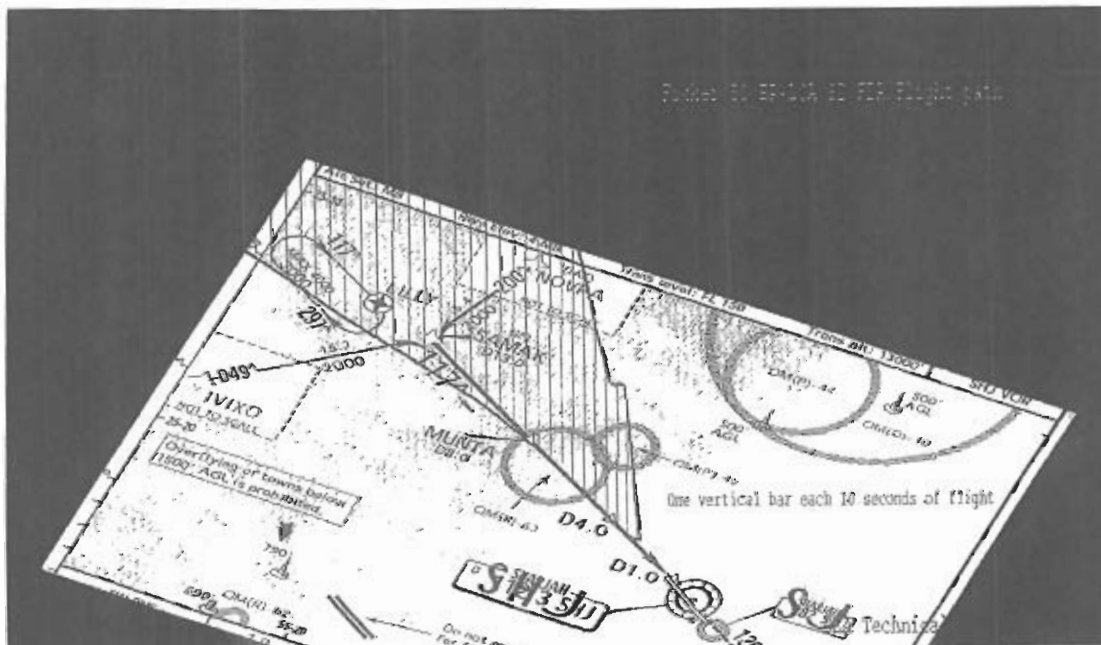

AIRCRAFT VERTICAL PLOT (DFDR)

ATC TRANSCRIPT

APPENDIX 2

The following transcript was made from the ATC tapes at Sharjah International Airport for Sharjah Tower (TWR) on 118.6 MHz. The only aircraft are IRK 7170 (Kish Air) and MPH 555 (Martinair).

7:35:59	TWR	118.6	...and Martinair Five Five Five, your squawk is...ah...Zero Five Two One and there's traffic landing One Two. You can expect departure behind him.
7:36:07	MPH 555	118.6	Roger, Zero Five Two One on the squawk.
7:36:13	IRK 7170	118.6	Sharjah Tower, Kishair Seven One Seven Zero good morning , established VOR One Two.
7:36:20	TWR	118.6	Kishair Seven One Seven Zero Sharjah good morning. QNH One Zero Two Two, surface wind is calm. You are cleared to land Runway One Two.
7:36:27	IRK 7170	118.6	One Zero Two Two, cleared to land Runway One Two, Kishair Seven One Seven Zero.
7:38:16	TWR	118.6	And Martinair Five Five Five, the landing traffic in sight, F Fifty, line up and wait behind.
7:38:24	MPH 555	118.6	After traffic, line up and wait behind, Martinair Five Five Five.
7:38:30	MPH 555	118.6	Martinair Five Five Five, the aircraft is going down...ah...a few miles before the runway. There's some big flames .
7:38:38	MPH 555	118.6	Martinair Triple Five, he's...ah...he's crashed Sir...two or three miles short of the runway...the Falcon Fifty.
7:38:44	TWR	118.6	OK, I've got it.
7:39:09	MPH 555	118.6	Martinair Five Five Five is holding short.
7:39:16	TWR	118.6	Martinair Five Five Five, you can line up and wait...ah...Runway One Two.

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 06 min 35 s					Start of recording
07 h 32 min 00 s					Start of transcript
07 h 32 min 03 s		<i>We are commencing approach.... we do not need to increase power</i>			Translated from Farsi
07 h 32 min 09 s		<i>This power setting is enough</i>			Translated from Farsi
07 h 32 min 12 s	<i>You're flying</i>				Translated from Farsi
07 h 32 min 16 s			Dubai Arrivals good morning Emirates eight six three Airbus A three three two passing one nine four for ten thousand feet BUBIN two victor arrival		
07 h 32 min 25 s			Emirates eight six three Dubai arrivals good day descend to altitude eight thousand feet no ATC speed restrictions.. information Yankee QNH one zero two two confirmed		
07 h 32 min 33 s			Descend to altitude eight thousand feet QNH one zero two two Emirates eight six three		

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 06 min 35 s					Start of recording
07 h 32 min 00 s					Start of transcript
07 h 32 min 03 s		<i>We are commencing approach.... we do not need to increase power</i>			Translated from Far
07 h 32 min 09 s		<i>This power setting is enough</i>			Translated from Far
07 h 32 min 12 s	<i>You're flying</i>				Translated from Far
07 h 32 min 16 s			Dubai Arrivals good morning Emirates eight six three Airbus A three three two passing one nine four for ten thousand feet BUBIN two victor arrival		
07 h 32 min 25 s			Emirates eight six three Dubai arrivals good day descend to altitude eight thousand feet no ATC speed restrictions.. information Yankee QNH one zero two two confirmed		
07 h 32 min 33 s			Descend to altitude eight thousand feet QNH one zero two two Emirates eight six three		

APPENDIX 3

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 33 min 43 s	You've had enough training. you'll learn how to do it.. don't worry		Dubai Arrivals good morning Gulf Air six zero two overhead MIADA nine thousand feet		
07 h 33 min 47 s			Gulf Air six zero two Dubai Arrivals good day descend to altitude two thousand five hundred feet speed two fifty knots or greater on the MIADA one victor arrival information Yankee QNH one zero two two		
07 h 33 min 50 s					Translated from Farsi
07 h 34 min 01 s		Because I haven't done this type of approach a lot			Translated from Farsi
07 h 34 min 03 s			We have Yankee two thousand five hundred feet QNH one zero two two speed two fifty Gulf Air six zero two		
07 h 34 min 09 s		(*)			Sounded friendly
07 h 34 min 18 s			Gulf Air six zero two just confirm MIADA one victor arrival		

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 33 min 43 s			Dubai Arrivals good morning Gulf Air six zero two overhead MIADA nine thousand feet		
07 h 33 min 47 s			Gulf Air six zero two Dubai Arrivals good day descend to altitude two thousand five hundred feet speed two fifty knots or greater on the MIADA one victor arrival information Yankee QNH one zero two two		
07 h 33 min 50 s		<i>Because I haven't done this type of approach a lot</i>			Translated from Far
07 h 34 min 01 s	<i>You've had enough training. you'll learn how to do it.. don't worry</i>				Translated from Far
07 h 34 min 03 s			We have Yankee two thousand five hundred feet QNH one zero two two speed two fifty Gulf Air six zero two		
07 h 34 min 09 s		(*)			Sounded friendly
07 h 34 min 18 s			Gulf Air six zero two just confirm MIADA one victor arrival		

APPENDIX 3

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 34 min 18 s		We have been cleared for approach so we could descend to two thousand feet	OK MIADA one victor arrival Gulf Air six zero two		Translated from Farsi
07 h 34 min 20 s					
07 h 34 min 27 s	Tell him established				Translated from Farsi
07 h 34 min 30 s	Anyhow we are not yet established				Translated from Farsi
07 h 34 min 40 s	Why did you select NAV?				Translated from Farsi
07 h 34 min 41 s		Doesn't follow if you use heading			Translated from Farsi
07 h 34 min 43 s		Why does it go out of selected position?			Translated from Farsi
07 h 34 min 55 s	Come to the left				Translated from Farsi
07 h 34 min 59 s	Turn left during approach...we have to select MAP				Translated from Farsi
07 h 35 min 07 s					Translated from Farsi
07 h 35 min 09 s	Yes we are	We are closing final			Translated from Farsi

UTC time	Captain	First Officer	ATC	Sounds	Obser
07 h 35 min 35 s	<i>going to intercept.. stay there to intercept...lets intercept and finish</i>		Kish Air seven one seven zero, contact Sharjah Tower one one eight six, good day		
07 h 35 min 38 s		=>One one eight six Kish Air seven one seven zero good day			
07 h 35 min 49 s		<i>Should I contact Sharjah Tower myself?</i>			Translated fi
07 h 35 min 52 s	<i>OK I will contact</i>				Translated fi
07 h 35 min 59 s	<i>Don't go further left... wait until further capture</i>				Translated fr
07 h 35 min 59 s			Martinair five five five your squawk is ...ah Zero five two one and there's landing traffic one two...you can expect departure behind him		
07 h 36 min 07 s			Roger zero five two one on the squawk		

UTC time	Captain	First Officer	ATC	Sounds	Observations
07 h 36 min 13 s	=>Sharjah Tower, Kish Air seven one seven zero good morning, established VOR one two				
07 h 36 min 20 s			Kish Air seven one seven zero Sharjah good morning QNH one zero two two surface wind is calm.. you are cleared to land runway one two		
07 h 36 min 27 s	=>One zero two two cleared to land runway one two, Kish Air seven one seven zero				
07 h 36 min 35 s	Cleared to land one two				
07 h 36 min 36 s				(@)	Sound similar to alti alert
07 h 36 min 36 s	<i>After eight DME according to the chart we have to maintain two thousand feet...</i>				Translated from Far

UTC time	Captain	First Officer	ATC	Sounds	Observations
	<i>then descend to nine hundred feet up to four DME</i>				
07 h 36 min 40 s		<i>Four DME</i>			Translated from Far
07 h 36 min 42 s	<i>Four DME cleared to nine hundred feet</i>				Translated from Far
07 h 36 min 45 s	<i>Set nine hundred</i>				Translated from Far
07 h 36 min 46 s		<i>I set nine hundred...OK</i>			Translated from Far
07 h 36 min 54 s		<i>Nine hundred</i>			
07 h 37 min 29 s				(@)	Sound similar to alti alert
07 h 37 min 30 s		<i>One thousand</i>			Translated from Far
07 h 37 min 31 s				(@)	Chime sound of auto pilot disconnect
07 h 37 min 44 s	<i>Four DME</i>				Translated from Far
07 h 37 min 54 s		OK, flap 10			
07 h 37 min 57 s				(@)	Sound similar to flap lever
07 h 37 min 58 s		Landing gear down		(@)	Sound similar to initi landing gear lever

APPENDIX 3

UTC time	Captain	First Officer	ATC	Sounds	Observations
					movement
				(@)	Sound similar to wind noise when landing gear doors open
07 h 38 min 01 s				(@)	Sound similar to flap lever
07 h 38 min 03 s	<i>With me</i>				Translated from Farsi
07 h 38 min 05 s		<i>I will make it</i>			Translated from Farsi
07 h 38 min 06 s				(@)	Triple chime sound
07 h 38 min 07 s	<i>I will give it back to you</i>				Translated from Farsi
07 h 38 min 08 s		okay			Translated from Farsi
07 h 38 min 10 s				(@)	Triple chime sound ceases
07 h 38 min 12 s					Sound of increasing propeller noise
07 h 38 min 12 s	<i>Why! (or woe betide us)</i>				Translated from Farsi
07 h 38 min 14 s					Unidentified click
07 h 38 min 15 s	<i>Push it forward!</i>				Translated from Farsi
07 h 38 min 16 s				(@)	Unidentified click
07 h 38 min 16 s	<i>Can't raise it</i>				

UTC time	Captain	First Officer	ATC	Sounds	Observations	
07 h 38 min 16 s	Religious exclamation	Mayday, mayday, mayday	(*)	(@)	Translated from Far	
07 h 38 min 17 s					Unidentified click	
07 h 38 min 18 s					Not transmitted	
07 h 38 min 18 s	Religious exclamation			Translated from Far		
07 h 38 min 19 s						
07 h 38 min 21 s				(@)	Continuous sound s to GPWS	
07 h 38 min 21 s	Religious exclamation				Translated from Far	
07 h 38 min 24 s	Religious exclamation				Translated from Far	
07 h 37 min 26 s		Mayday, mayday, mayday				Not transmitted
07 h 38 min 28 s	Religious exclamation					Translated from Far
07 h 38 min 29 s	Religious exclamation				Translated from Far	
07 h 38 min 33 s					End of recording	



CVR Analysis Final Report

*Accident
on February 10th, 2004
near Sharjah Airport
to the Fokker 27 Mk 50
registered EP-LCA
operated by Kish Airlines*

CONTENTS

CONTENTS	2
1 INTRODUCTION	3
2 COCKPIT VOICE RECORDER	3
2.1 A-100 CVR description	3
2.2 CVR read-out and copy	5
3 BACKGROUND	6
3.1 Introduction.....	6
3.2 Protocol	7
3.3 Background noise.....	7
3.4 Quality of recording	9
3.5 CVR/FDR synchronization.....	11
3.6 Estimation of the propellers' RPM	14
4 ANALYSIS OF THE RECORDING	15
4.1 Target Noise at 07 h 37 min 56 s	15
4.2 Target Noise at 07 h 37 min 57 s	15
4.3 Target Noise at 07 h 38 min 01 s	15
4.4 Target Noises at 07 h 38 min 06 s.....	17
4.5 Target Noise at 07 h 38 min 11 s	18
4.6 Target Noise at 07 h 38 min 12 s	18
4.7 Target Noise at 07 h 38 min 14 s	19
4.8 Spectral visualization of GPWS warning at 07 h 38 min 21 s.....	19
4.9 Target Noise at 07 h 38 min 23 s	20
5 CONCLUSIONS	21

1 INTRODUCTION

On February 10th, a Fokker 27 Mk 50 registered EP-LCA operated by Kish Airlines crashed during approach to Sharjah airport, UAE. Both flight recorders were brought to the BEA for read-out and analysis of their contents.

Given the circumstances of the accident, a CVR analysis was performed in order to identify the noises recorded on the CVR during the last minute.

A first set of reports was published. Nevertheless, in the light of new filtering that set is replaced by the present document.

2 COCKPIT VOICE RECORDER

The Fokker 50 was equipped with an A100-A type Cockpit Voice Recorder, manufactured by Fairchild. It contains 4 recording tracks that record the last thirty minutes of flight.



Figure 1: Read-out of P/N (93-A100-80) & S/N (62252)

2.1 A-100 CVR description

In order to offer a better understanding of the analyses presented in this report, the following provides a description of the architecture of the CVR as well as the way it works.

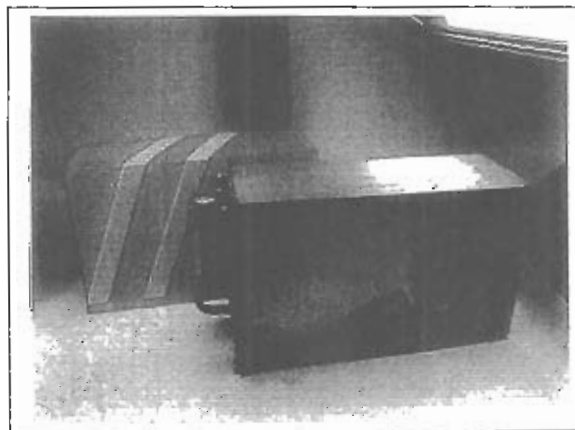
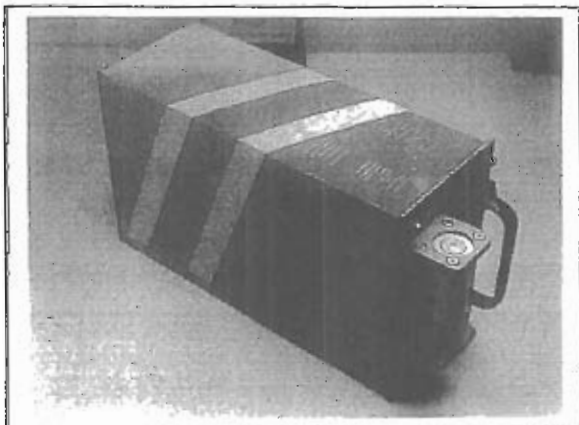


Figure 2(a) (b): CVR A100-A with magnetic tape. On the right, an open recorder

Note: The CVR shown in the pictures in this section is not the one that was involved in the accident at Sharjah airport on February 10th, 2004.

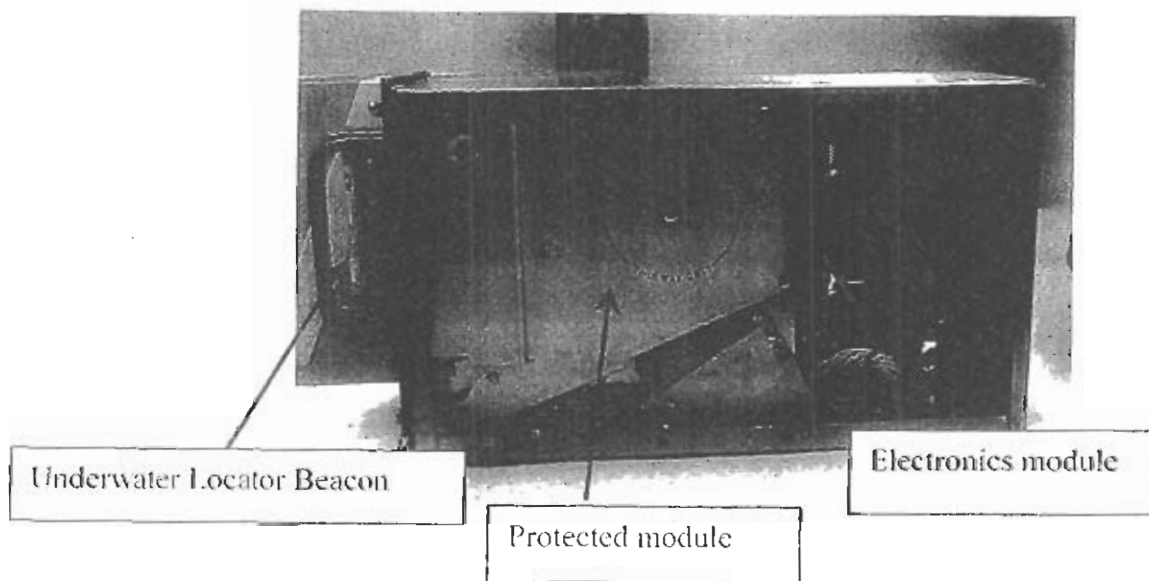


Figure 3: Internal architecture of the recorder

The protected module:

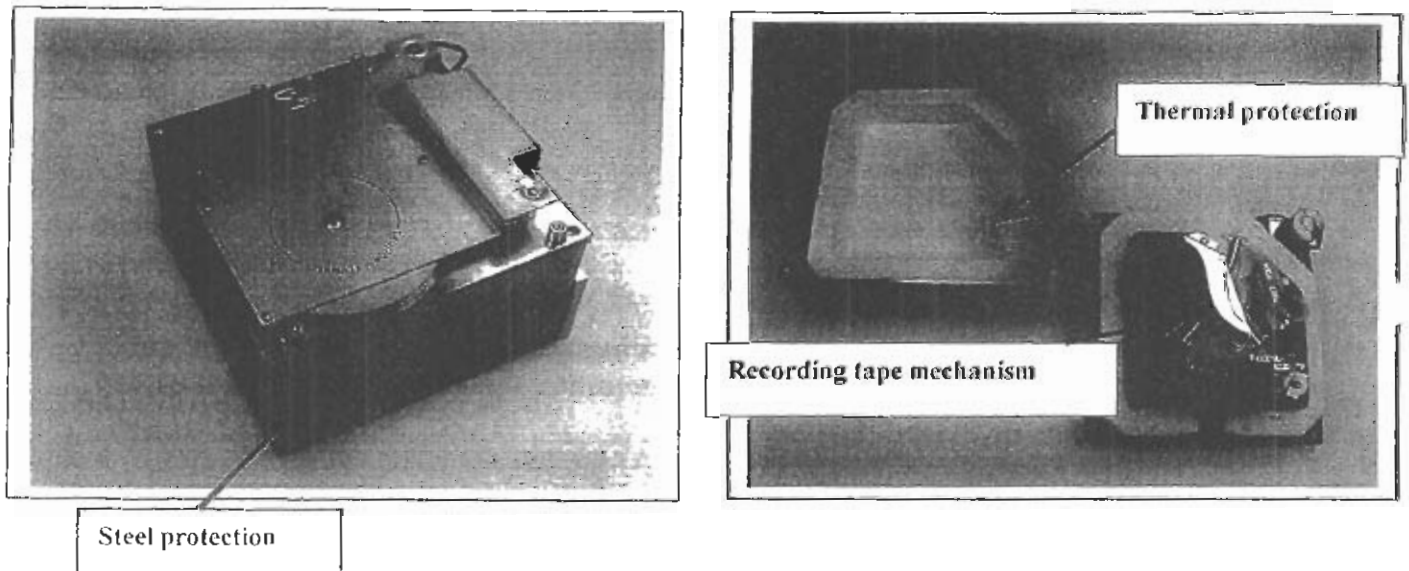


Figure 4(a) (b): Overview of the protected module with the tape inside

The next picture represents and explains the recording process and the path the tape is driven through.

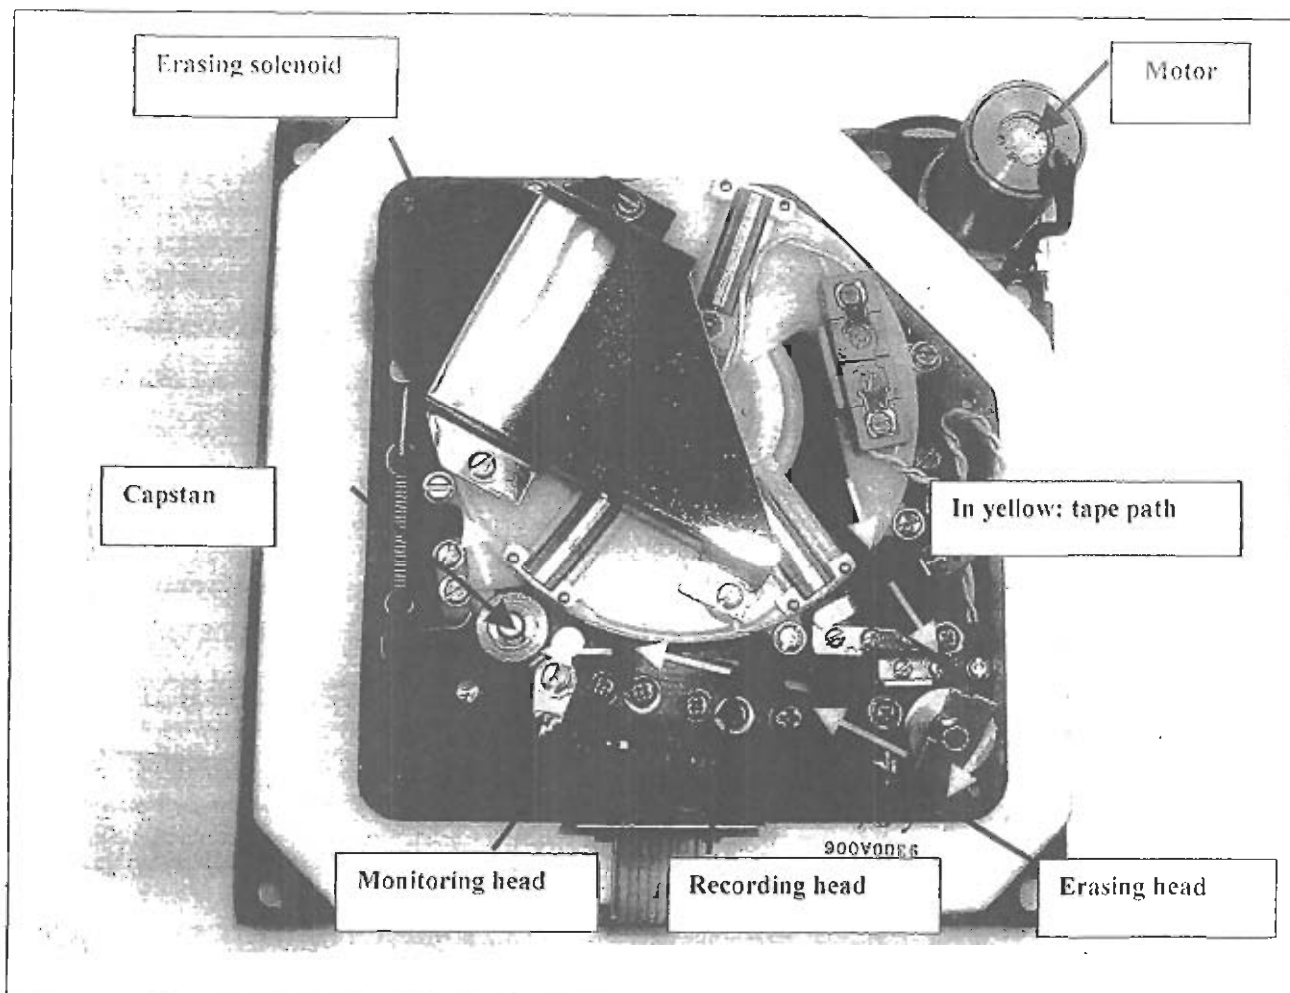


Figure 5: View of the Recording tape mechanism

As shown on the above picture, the tape first goes through an erasing head, then a recording head. The reading head is used to monitor the quality of the previously recorded signal.

The continuous recording system uses a loop tape. The latter is passes through the reel hub of where the oldest information is stored, goes through the three previously described heads, and is then re-wound on the reel rim of.

On this model of CVR, the tape speed is about 4.25 cm/s. The erasing head and the recording head are about 1.5 cm from each other. (i.e. about 1/3 sec). The recording head and the erasing head are about 2 cm from each other.

CVR read-out and copy

This magnetic tape recorder has a 30-minute recording ability on four simultaneous tracks. The tape was extracted, cleaned and transferred onto a new reel before read out. During the read out, the reading speed was adjusted using the 400 Hz electrical noise interference produced by the 115V/400 Hz power of the aircraft. The speed was then improved using the FSK signal used to code UTC time on one of the tracks of the CVR. It was not possible to read this UTC time correctly but it was possible to display the time between two beeps, which should be equal to 4 s.

A digital copy was made during the first read out. A display of the four tracks of the recording in the last minute using the Samplitude software is shown in Figure 6.

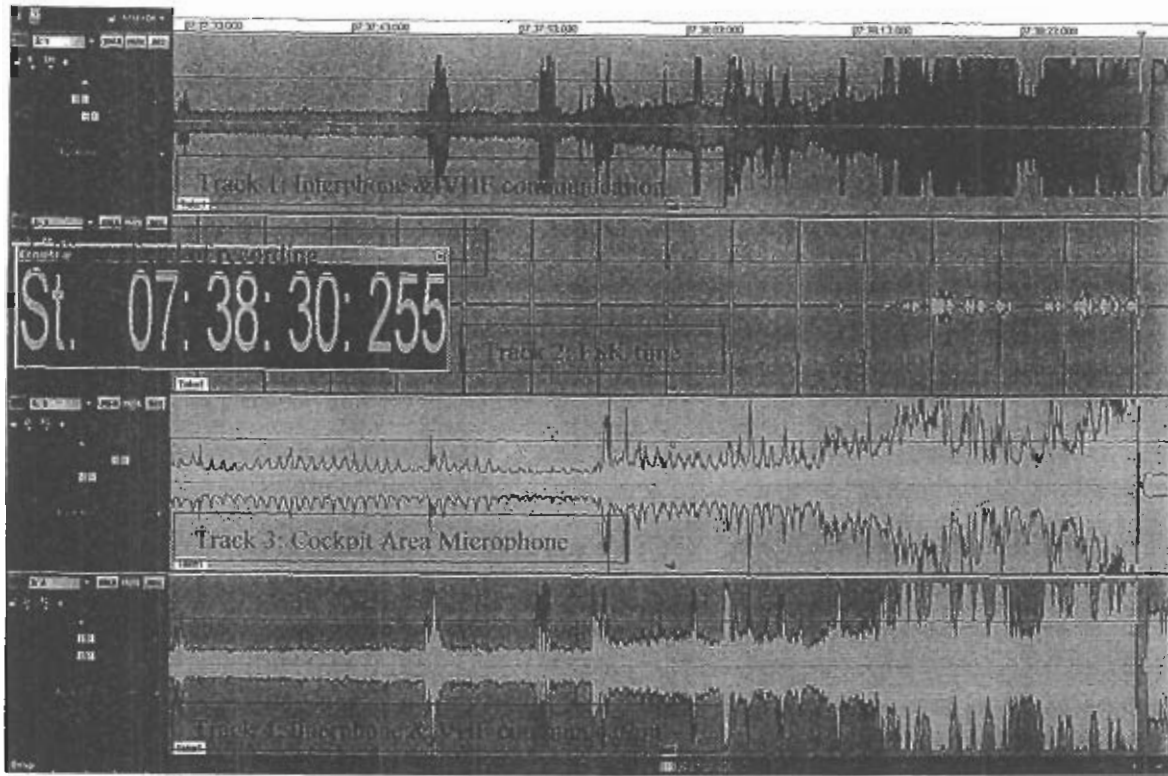


Figure 6: Display of the four tracks of the CVR

3. BACKGROUND

Introduction

The aim of the requested analysis was to determine the origin of different sounds recorded on the CVR in the last minute including whether or not a sound could be identified as the throttle levers being set to the *Ground Idle* position.

In order to perform this analysis, the recorded sounds and noises were compared to an archive database of sounds recorded by BEA. This database was constituted during a previous Fokker 27 Mk 50 accident investigation in which tests were made and two Fokker 27 Mk 50's were used to record sound samples in the cockpit. During these tests, a similar CVR was used: an A100 manufactured by L3-Communications. Tests were carried out on the ground.

For further details on this database, please refer to BEA document CVR-2002-BVD-03¹.

¹ This document can be found as an appendix to the final report concerning the accident to the Fokker 50 registered LX-LGB in Luxembourg on November 6th 2002. This report is available for download at www.etal.lu/IR/news.

3.2 Protocol

The analysis was carried out in three separate steps. First of all, since two recorders were compared on two separate aircraft in different conditions, a comparison was made in order to characterize background noises on each recording.

Second, the target sound is compared to a reference sound recorded in the BEA's database.

Finally, factual results were analysed with FDR data and compared with the circumstances of the accident.

3.3 Background noise

Whereas the target sounds were recorded in flight, the database is based on ground tests. As a result, a first comparison is made with background noises.

The next figures represent the background noises in both aircrafts in the time-frequency domain.

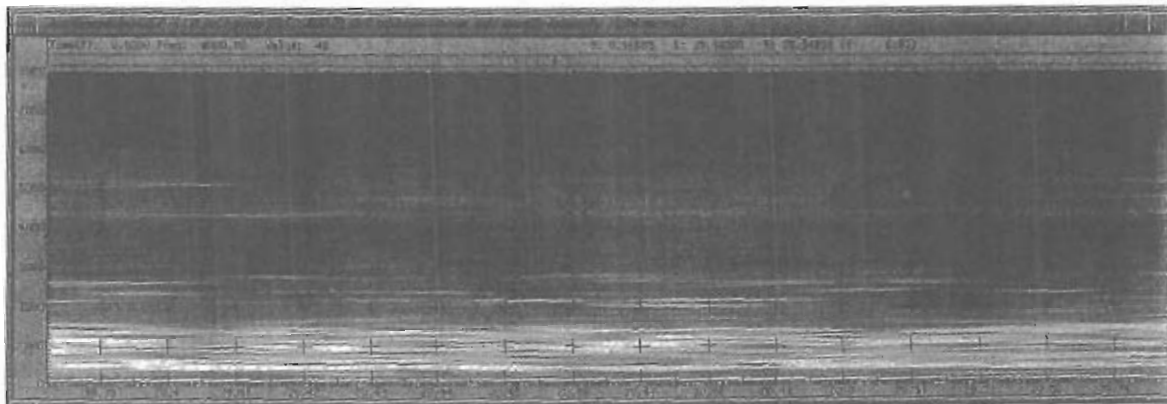


Figure 7(a): Time-Frequency representation of the background noise on EP-LCA aircraft, CAM channel

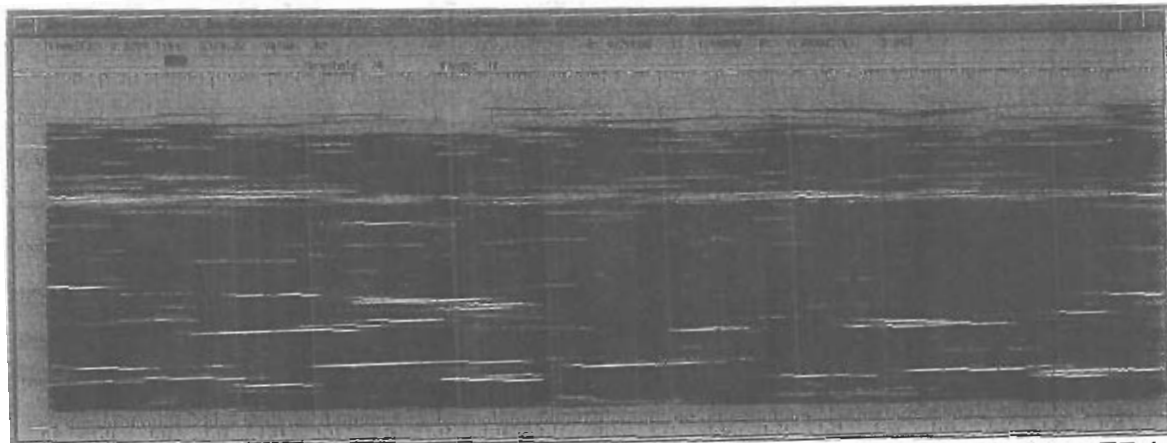


Figure 7(b): Time-Frequency representation of the background noise on EP-LCA aircraft, hot-mike channel



Figure 7(c): Time-Frequency representation of the background noise on the reference aircraft

Figures 7(a), 7(b) and 7(c) illustrate the significant background noises between EP-LCA and the reference aircraft. Because of differences in the environments existing during the two recordings, we can see that the EP-LCA recording is much noisier than for the reference aircraft. This is due to the fact that reference recording was made on the ground. Moreover, on each aircraft, the interference produced by the 115 V / 400 Hz power supply can be more or less present on the CVR, depending on how good the electrical cable insulation is. As a result, on some aircraft, interferences are produced at 400, 800 and 1200 Hz. The amplitude of those spikes is much higher in the case of EP-LCA as shown in the frequency domain with figures 8(a) and 8(b).

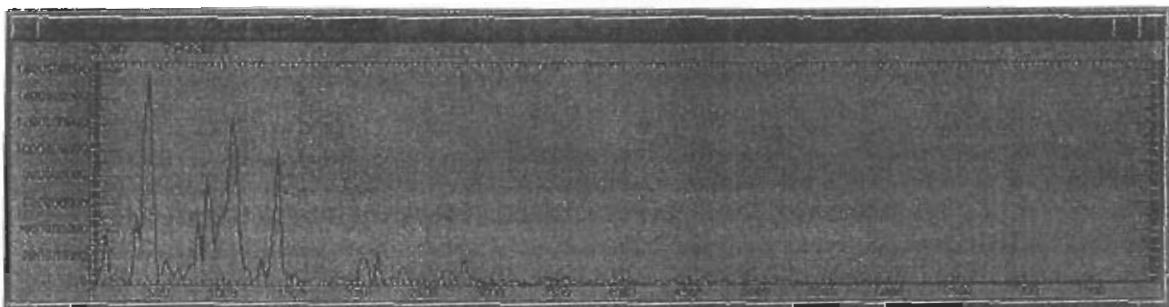


Figure 8(a): Frequency representation of the background noise for EP-LCA aircraft, CAM channel

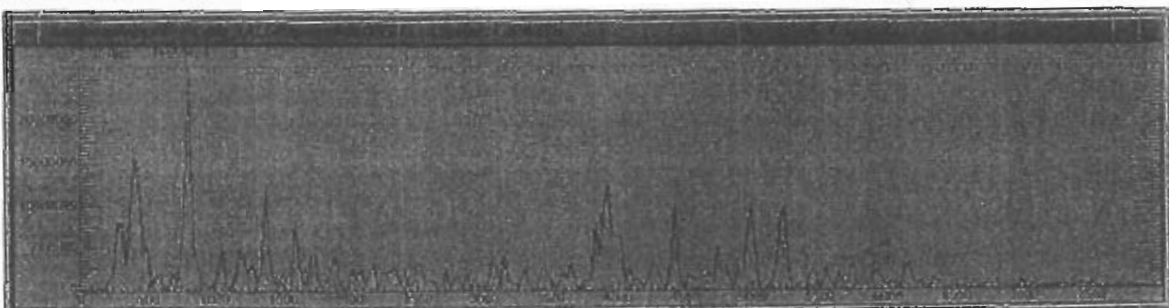


Figure 8(b): Frequency representation of the background noise for reference aircraft

As explained previously, amplitudes are significantly different between the two recordings as EP-LCA was flying.

3.4 Quality of recording

On an aircraft equipped with interphone and hot-mike functions, the mouth microphone acts as a cockpit area microphone and records the surrounding noises allowing spectrum analysis. On tracks one and four, with this mouth microphone recording, it is possible to hear the sounds of selectors.

The quality of this track is better than on the Cockpit Area Microphone track, polluted by the 400 Hz and harmonics. This pollution prevents the use of the CAM for spectrum analysis. Nevertheless, all the BEA's database was created through CAM recordings well protected from 400 Hz interferences.

This cockpit area microphone records sounds from the air and through the structure. In the case of the hot-mike recording, only sounds from the air are present. The difference is shown on the analysis of a sound recorded on both cam and hot-mike channels.

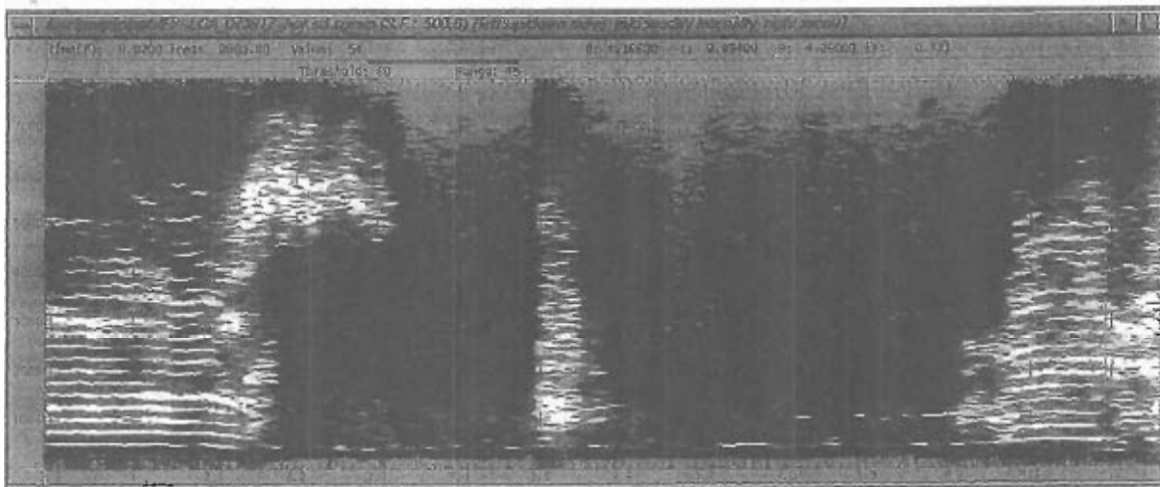


Figure 9(a): Time-Frequency representation of a noise: Hot-mike channel

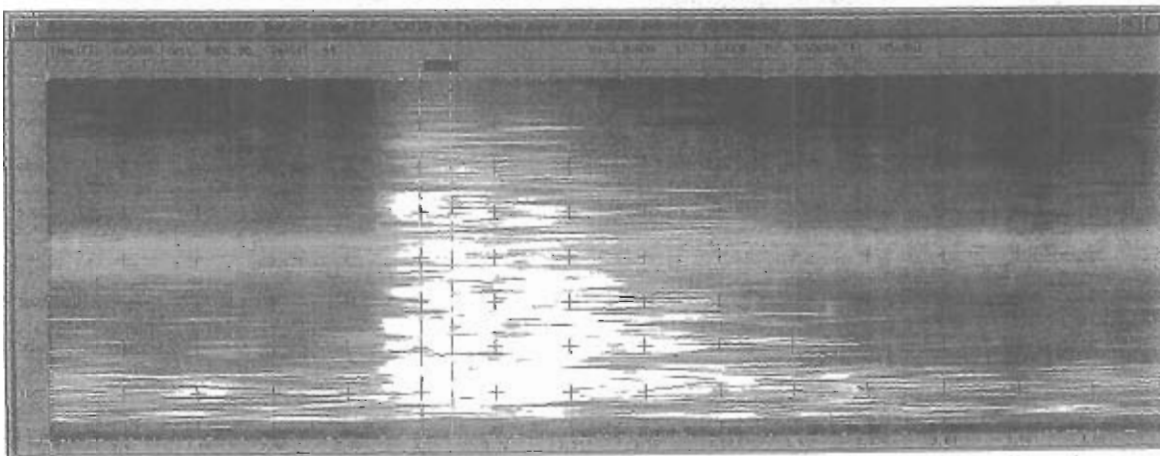


Figure 9(b): Zoomed time-Frequency representation of a noise: Hot-mike channel

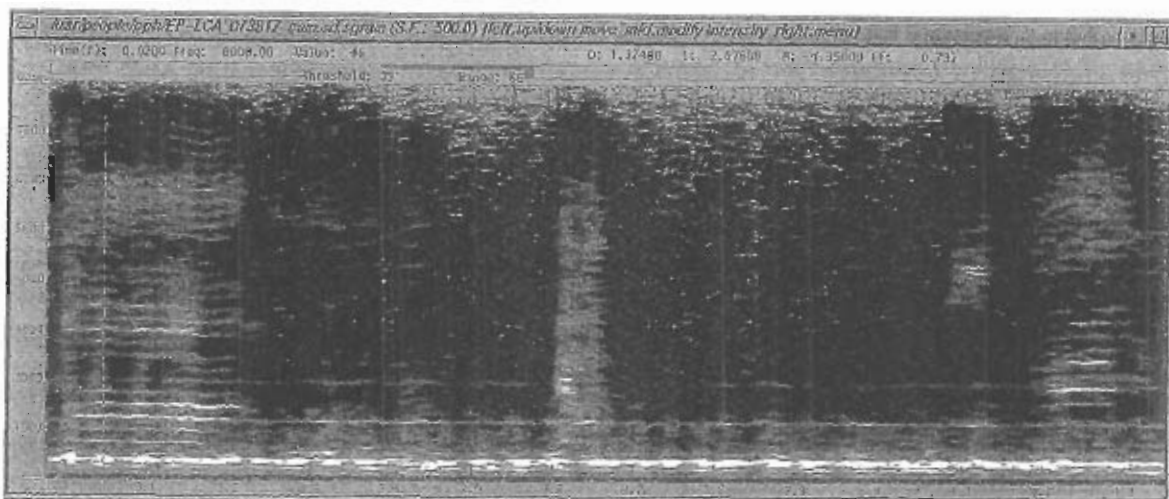


Figure 9(c): Time-Frequency representation of same noise: CAM channel

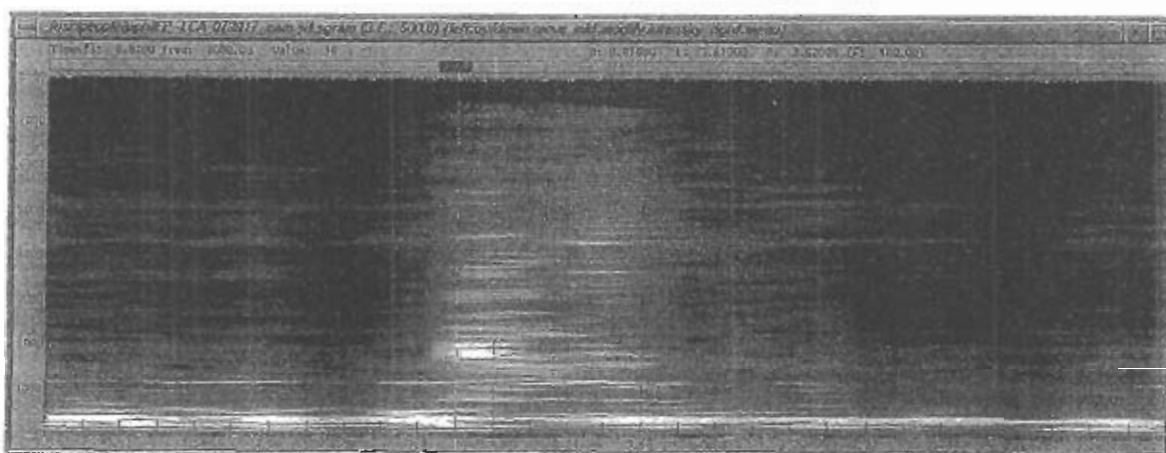


Figure 9(d): Zoomed time-Frequency representation of same noise: CAM channel

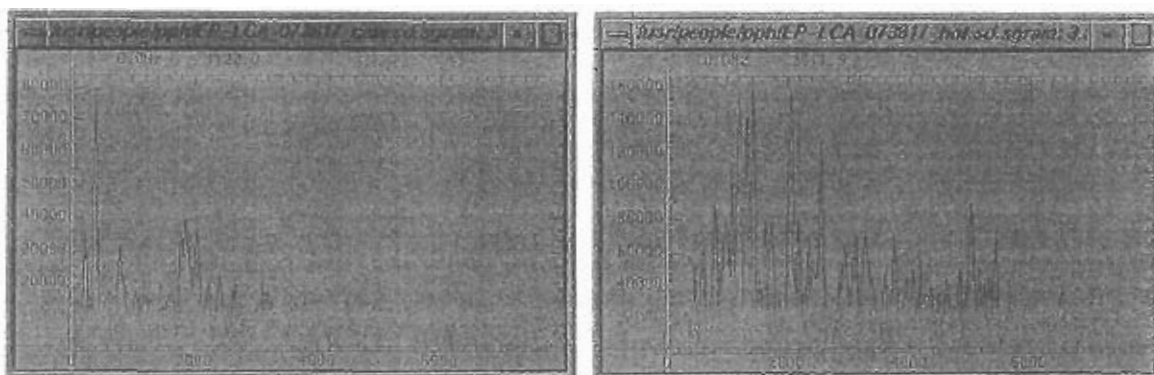


Figure 9(e)(f): Frequency representations of the same noise: CAM channel (left) and hot-mike channel (right)

The above two figures show the limits of the analysis due to the recording differences between the hot-mike channel and the CAM channel. The same noise recorded on both tracks gave different spectra.

Track 1 will then mainly be used for the analysis of sounds, even if the recording source is different from the data base recording source. Thus, analyses were carried

out on the target noises, though one must remember to take into account those recording differences.

Though the target noises have been compared with several possible noises from the database, only the most relevant and consistent one is reported here. Consequently, all the comparisons (such as flaps noise, taxi light noise, etc.) carried out to identify the target noises do not appear in this report.

3.5 CVR/FDR synchronization

The table below lists all the events (VHF communications and Auto Pilot disconnect) used to perform the CVR/FDR synchronization. Moreover, lengths of VHF communication have been used to improve this synchronization. We can consider that synchronization is accurate when the CVR time of an event is within the second before the time of the equivalent activated parameter. Synchronization with ATC communications and the FDR was performed based on ATC time. The last communication from the aircraft to Sharjah tower was used as a reference time for both recorders.

Some events, such as sounds of selectors, to analyse and some parameters like propeller low pitch, are added to the list. The synchronization is displayed as a graph on figure 10 where some engine parameters and selector sound are indicated.

Event	FDR time	CVR Time
VHF communication	07 h 23 min 31.5 s	07 h 23 min 31.0 s
VHF communication	07 h 24 min 14.5 s	07 h 24 min 13.9 s
VHF communication	07 h 24 min 27.5 s	07 h 24 min 27.3 s
VHF communication	07 h 29 min 22.5 s	07 h 29 min 22.1 s
VHF communication	07 h 35 min 38.5 s	07 h 35 min 38.0 s
VHF communication	07 h 36 min 13.5 s	07 h 36 min 12.8 s
VHF communication	07 h 36 min 28.5 s	07 h 36 min 28.2 s
Auto Pilot disconnect	07 h 37 min 49.4 s	07 h 37 min 48.6 s
Sound of selector		07 h 37 min 56.4 s
Flaps Position	07 h 37 min 57.6 s	
Sound of selector		07 h 37 min 57.7 s
Sound of selector		07 h 38 min 01.4 s
Series of three single chime		07 h 38 min 06.7 s
Thump sound		07 h 38 min 06.9 s
Series of three single chime		07 h 38 min 08.6 s
Sound of selector		07 h 38 min 11.3 s
Low pitch left on FDR	07 h 38 min 11.6 s	
Low pitch right on FDR	07 h 38 min 12.6 s	

APPENDIX 4

Sound of selector		07 h 38 min 12.6 s
Sound of selector		07 h 38 min 14.1 s
View of GPWS warning until the end		07 h 38 min 21.0 s
Sound of selector		07 h 38 min 23.6 s
End of recording	07 h 38 min 29.0 s	07 h 38 min 30.2 s

3.6 Estimation of the propellers' RPM

This analysis was also a way of checking the consistency of the values extracted from FDR data.

To determine the aircraft's engine parameters, it is necessary to know the characteristics of those engines (i.e. rotation speed of the propeller at 100% and the number of blades).

In this case, we had: RPM propeller = 1200 RPM = 20 RPS = 20 Hz
Number of blades = 6

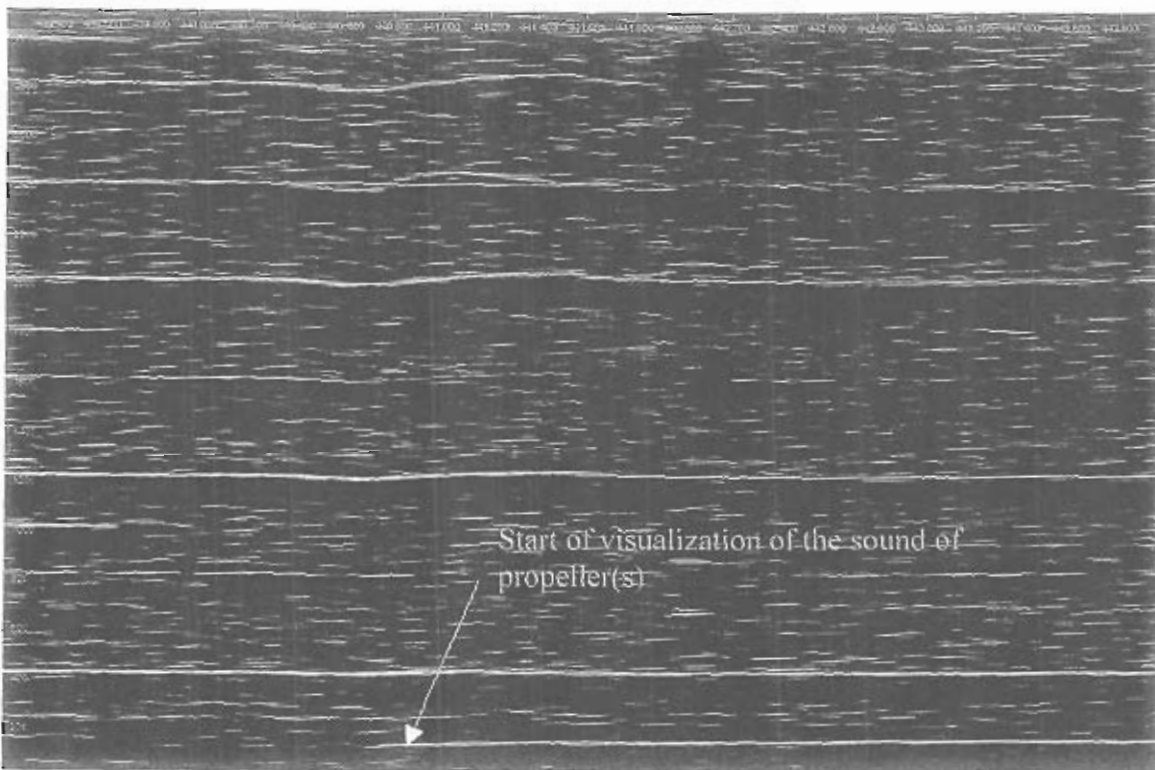


Figure 11: Evolution of the aircraft propeller noise

Thus, the noise of the propeller should appear on the spectrum analysis at $f_{propeller} = 20\text{Hz} \times 6\text{ blades} = 120\text{Hz}$ for a nominal rpm (100%).

From this result we can then determine the engine over-speed.

The comparison with FDR data is shown on the following graph with the extraction of the rotation speed of the propeller made from the Teuchos software for spectrum analysis (blue line), and data supplied by the FDR (plot x for right engine and plot + for left engine):

3.6 Estimation of the propellers' RPM

This analysis was also a way of checking the consistency of the values extracted from FDR data.

To determine the aircraft's engine parameters, it is necessary to know the characteristics of those engines (i.e. rotation speed of the propeller at 100% and the number of blades).

In this case, we had: RPM propeller = 1200 RPM = 20 RPS = 20 Hz
Number of blades = 6

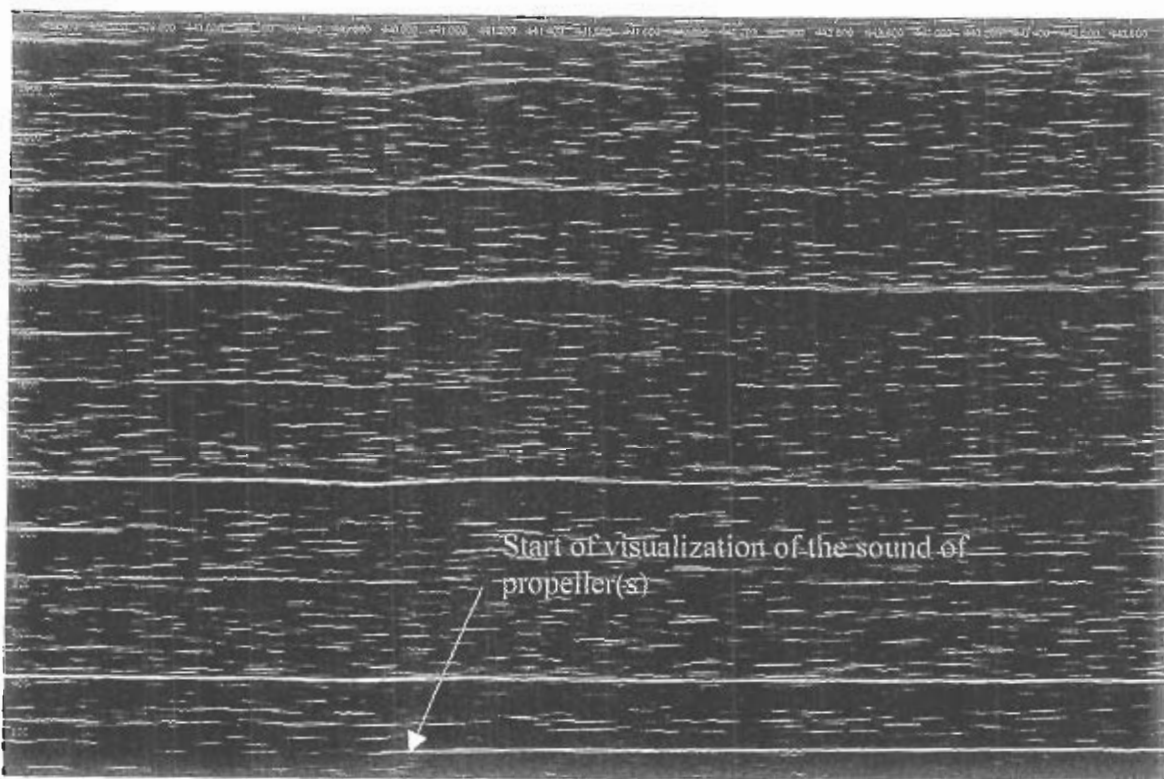


Figure11: Evolution of the aircraft propeller noise

Thus, the noise of the propeller should appear on the spectrum analysis at $f_{propeller} = 20\text{Hz} \times 6\text{blades} = 120\text{Hz}$ for a nominal rpm (100%).

From this result we can then determine the engine over-speed.

The comparison with FDR data is shown on the following graph with the extraction of the rotation speed of the propeller made from the Teuchos software for spectrum analysis (blue line), and data supplied by the FDR (plot x for right engine and plot + for left engine):

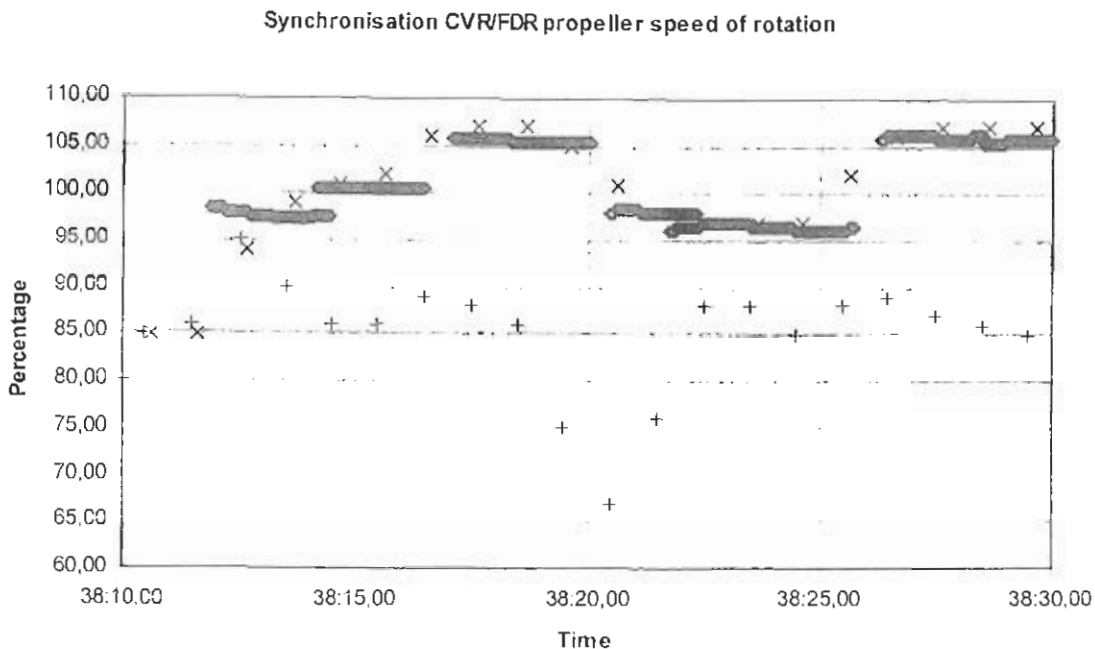


Figure 12: CVR/FDR synchronization of the propeller speed of rotation

From audio recording alone, it is not possible to differentiate between the left and right propellers. This can be achieved by comparison with the information coming from FDR data. Such comparisons allowed us to determine that only the sounds from the right propeller are visualized by the spectrum analyser in figure 12. This is consistent with a noisy engine in over-speed.

4 ANALYSIS OF THE RECORDING

4.1 Target Noise at 07 h 37 min 56 s

This sound of a selector appears just after the request for "Flaps ten". Comparison with the flaps activation on the BEA data base allows us to conclude that this sound is similar to the movement of the flaps selector lever.

4.2 Target Noise at 07 h 37 min 57 s

This sound of a selector appears at the same time as the request for "Gear down". Comparison with gear activation on the BEA data base allows us to conclude that this sound is similar to the movement of the landing gear lever.

4.3 Target Noise at 07 h 38 min 01 s

The following figure 13(a) shows a spectrum analysis of the target noise.

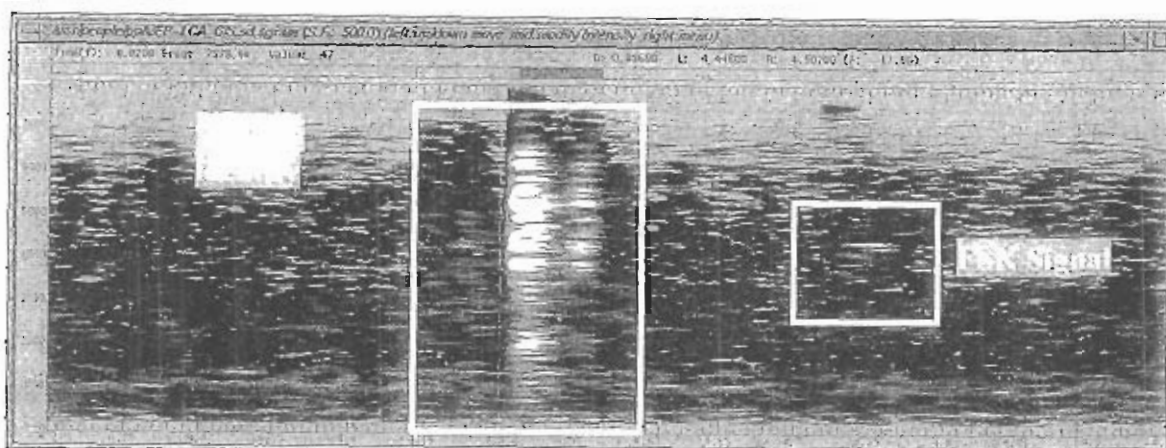


Figure 13(a): Time-Frequency representation of the target noise recorded at 07 h 38 min 01 s

As is seen in this figure, the noise to be identified is made up of 4 separate sounds. The last sound on the right of the figure is actually an FSK signal used to code UTC time recorded by diaphonic.

The spectral analysis in figure 13(b) was obtained with the noise of the ground idle stop being switched to "off", from BEA's database.

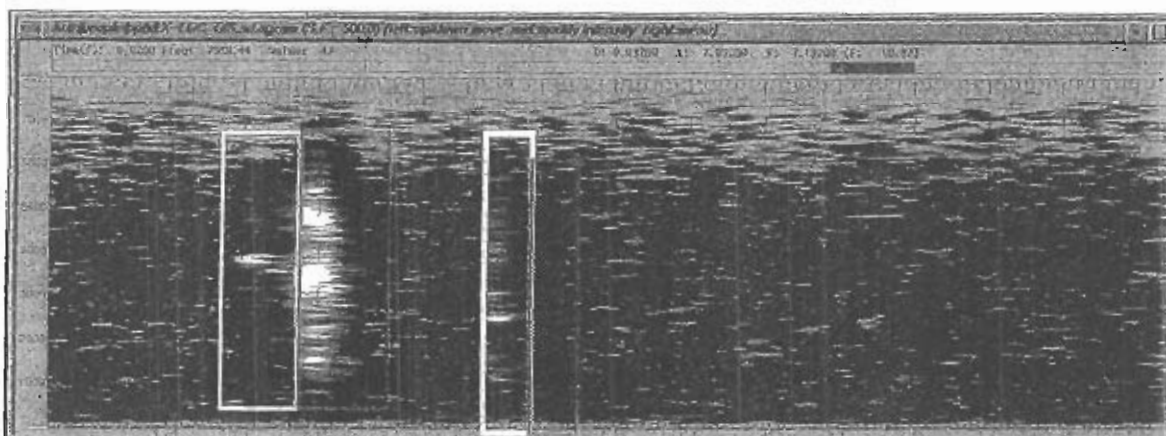


Figure 13(b): Time-Frequency representation of the ground idle stop switched OFF

This test noise presents a similar pattern with the noise to be identified, with four separate sounds. Moreover, when heard by a human ear, they sound similar.

However, several differences can be noticed between those two noises:

- ✓ Duration of each sound
- ✓

Target noise on EP-LCA

Length of 1st half = 0.058 sec
Length of 2nd half = 0.090 sec

Reference noise from database

Length of 1st half = 0.092 sec
Length of 2nd half = 0.062 sec

The total length of the noise is not relevant here since the kinematics of this ground idle stop switch includes a translation between the two positions. This motion can be fast or slow, depending on the way the switch is being moved by the operator.

✓ Frequency characteristics:

The figures 14(a) and 14(b) are frequency representations of the two previous noises:

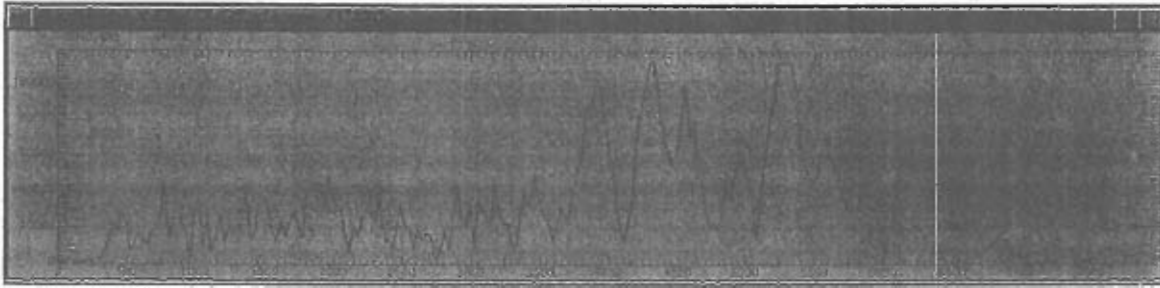


Figure 14(a): Frequency representation of the target noise for EP-LCA aircraft (the yellow line is a cursor and does not have any function or meaning here)

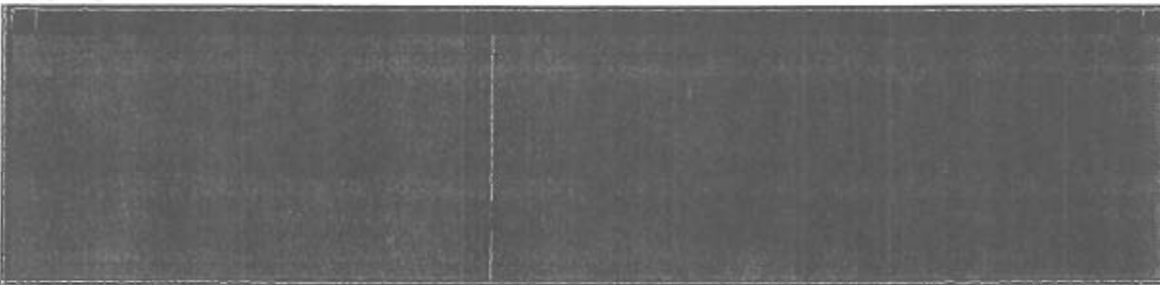


Figure 14(b): Frequency representation of the ground idle stop being switched OFF (the yellow line is a cursor and does not have any function or meaning here)

Thus, even if the two noises can sound and appear similar, differences in frequency and timing do not make it possible for us to reach a positive identification of the target noise as the activation of the ground idle stop switch.

Nevertheless, after several listens to this noise the acoustic perception sounds similar to the sound identified at 07 h 37 min 56 s, the latter being the noise produced by the flaps lever movement.

There is no call for flaps twenty-five selection, however the flaps position parameter reaches the value of twenty-five after an inflexion around ten degrees at 07 h 38 min 01 s. The acoustic perception and parameter analysis may suggest that this sound is similar to flaps lever movement.

4.4 Target Noises at 07 h 38 min 06 s

The sound is similar to a thump on the fuselage when the doors of the landing gear are closed after gear extension. A similar sound was extracted from a standard flight. The duration between the command of the gear extension and this sound in both cases was around 10 seconds.

4.5 Target Noise at 07 h 38 min 11 s

The following figure 15 shows a spectrum analysis of the target noise.

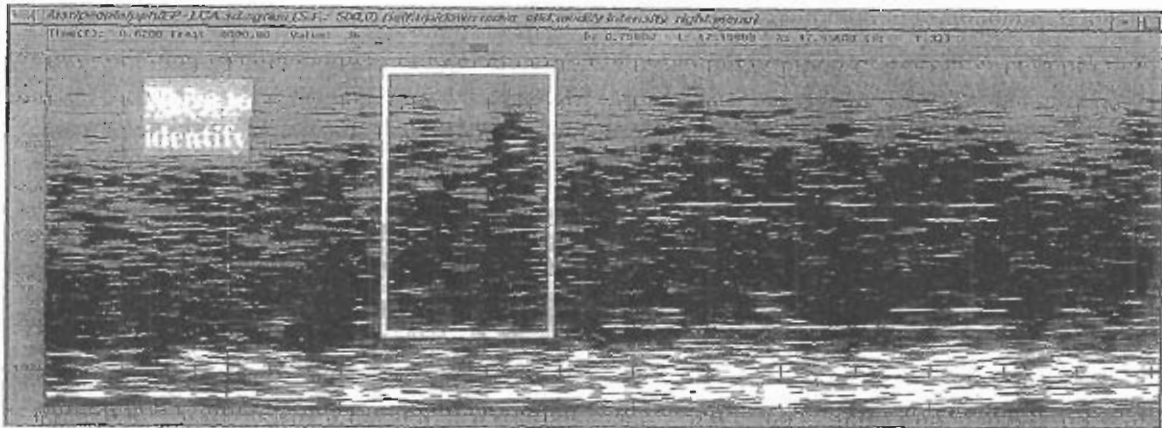



Figure 15: Time-Frequency representation of the target noise to be identified on EP-LCA aircraft

The analysis revealed a noise recorded at 07 h 38 min 11.3 s. This noise is very faint on the CVR recording and is barely visible on a spectral analysis that had to be manually programmed and computed with separate software in order to reveal it. Due to this very low acoustic signature, no detailed spectral analysis could be computed and compared with our database of previously analysed noises.

Nevertheless, a trial was performed in October 2004 on a similar Fokker 50 with a hand microphone recording. The new sounds recorded on the database led to the hypothesis that the faint noise at 07 h 38 min 11.3 s is consistent with the ground range selectors being lifted. The throttles don't seem to be moved to a locked position with noise like "take-off", "flight idle" or "ground idle" positions.

A change was simultaneously heard in the engine noise recorded on the CVR: the propeller rotation speed was increasing. FDR data show that at the same time the propeller RPM speed increased, as both propellers reached the *Low Pitch* configuration.

4.6 Target Noise at 07 h 38 min 12 s

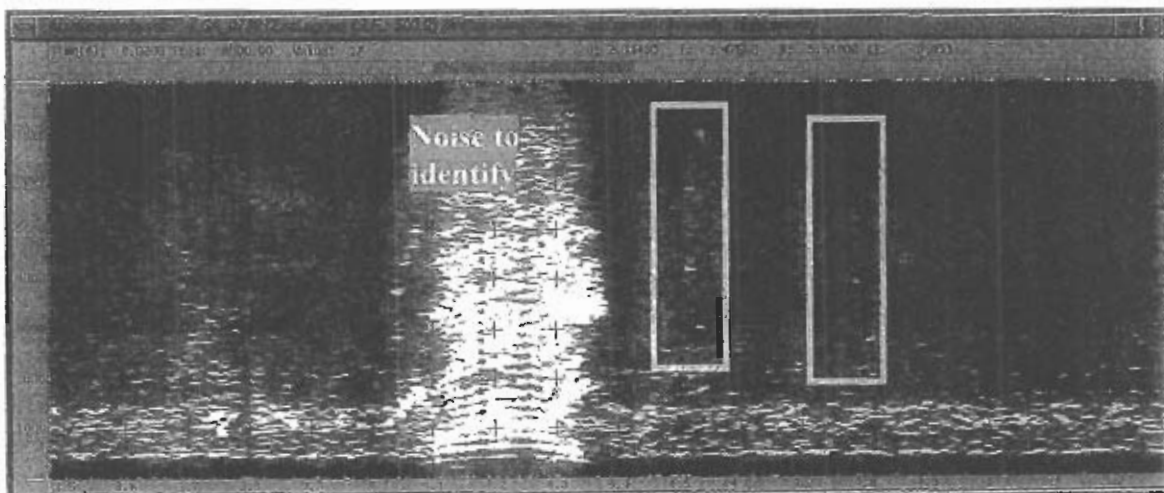

The analysis revealed a noise recorded at 07 h 38 min 12.6 s. This noise, made of two separate sounds, is very faint on the CVR recording and is barely visible on a spectral analysis that had to be manually programmed and computed with separate software in order to reveal it. Due to this very low acoustic signature, no detailed spectral analysis could be computed and compared with our database of previously analysed noises.

From the same test performed in October 2004 on a similar Fokker 50 with a hand microphone recording, the faint noise at 07 h 38 min 12.6 s also appears to be a movement of the ground range selectors, which are perhaps being released.

4.7 Target Noise at 07 h 38 min 14 s

The following figure 17(a) shows a spectrum analysis of the target noise.

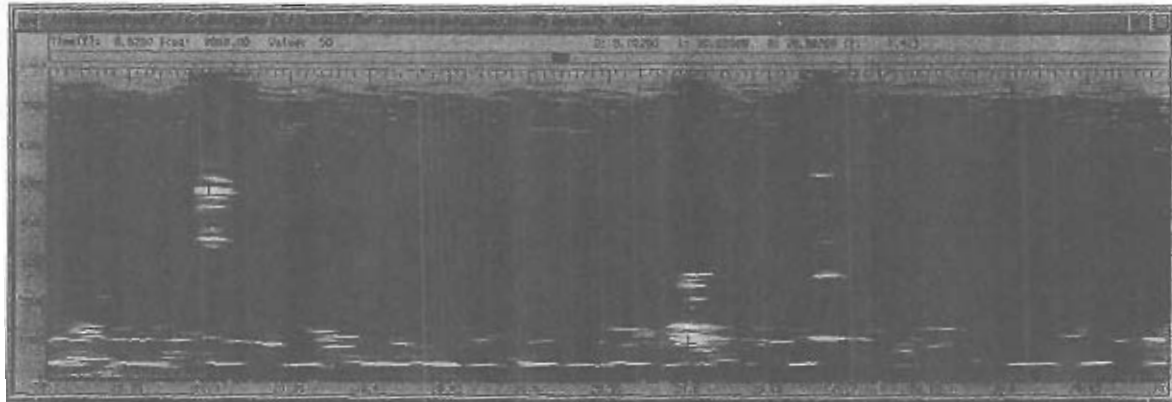


Figure 16(a): Time-Frequency representation of the target noise to be identified on EP-LCA aircraft

The noise recorded at 07 h 38 min 14.1 s is similar to a throttle lever movement to the stop. It was not possible to determine the final position of the throttle from spectral analysis alone. The "take-off", "flight idle" and "ground idle" positions are three possibilities. Synchronization with the evolution of the high pressure turbine parameters from the FDR seems to indicate that only the "take off" position being reached by the throttles.

4.8 Spectral visualization of GPWS warning at 07 h 38 min 21 s

It was possible to hear, when the pilots were not talking, a GPWS warning "whoop whoop pull up" from 07 h 38 min 21 s until the end of the recording. This message was played back by the synthetic voice of the aircraft. The issue was to determine when the GPWS warning started. The spectral analysis of this signal is typical and it was decided to check if it was possible to see the acoustic signature before listening.

The representation below shows the acoustic signature where the first signal seems to appear at the same time as the listening. Due to the automatic control of gain the synthetic voice may appear before but could be hidden by the pilot's voice.

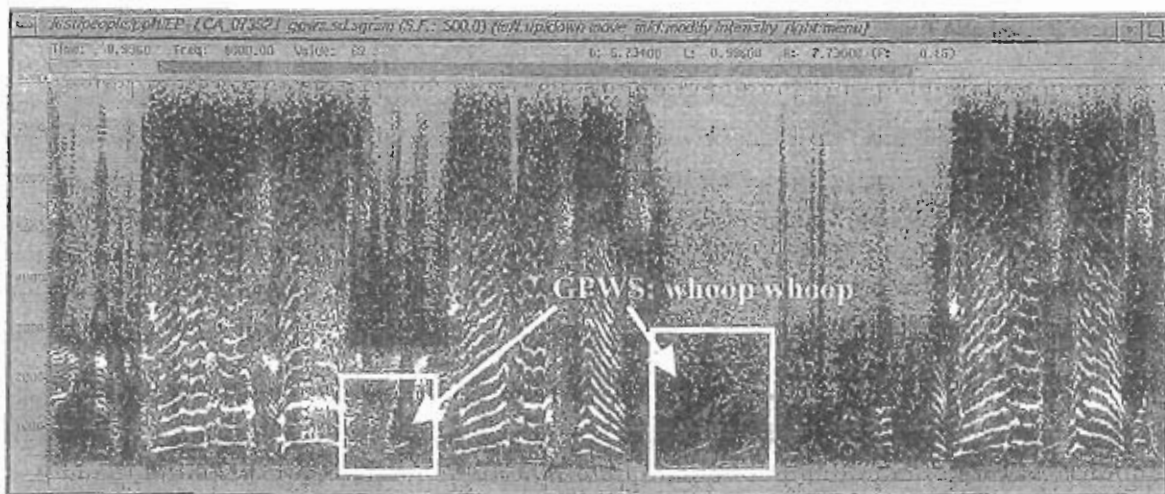


Figure 21: Time-Frequency analysis of the GPWS warning

Target Noise at 07 h 38 min 23 s

The figure 22(a) represents a spectrum analysis of this noise.

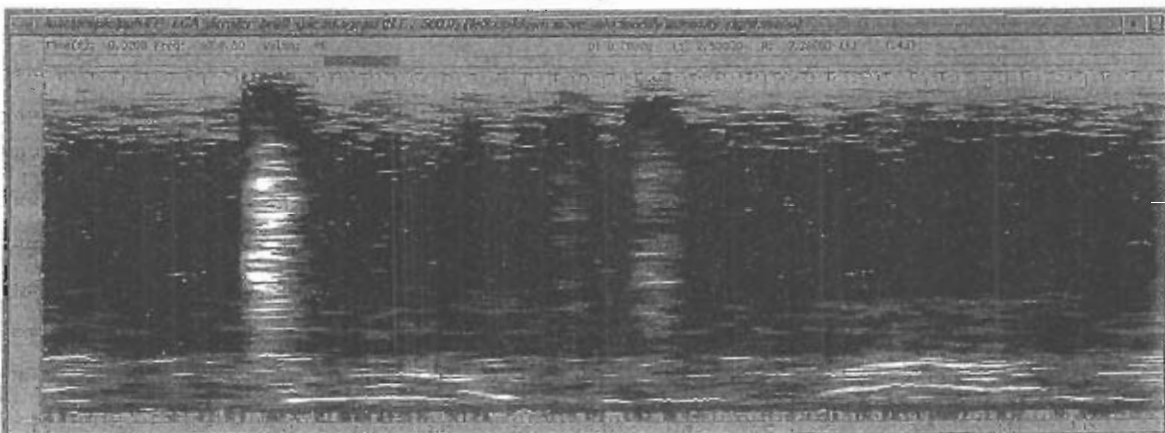


Figure 22(a): Time-Frequency analysis of the noise recorded at 07 h 38 min 23 s

As a comparison, the next figure represents a previous noise analysed at 07 h 38 min 14 s.

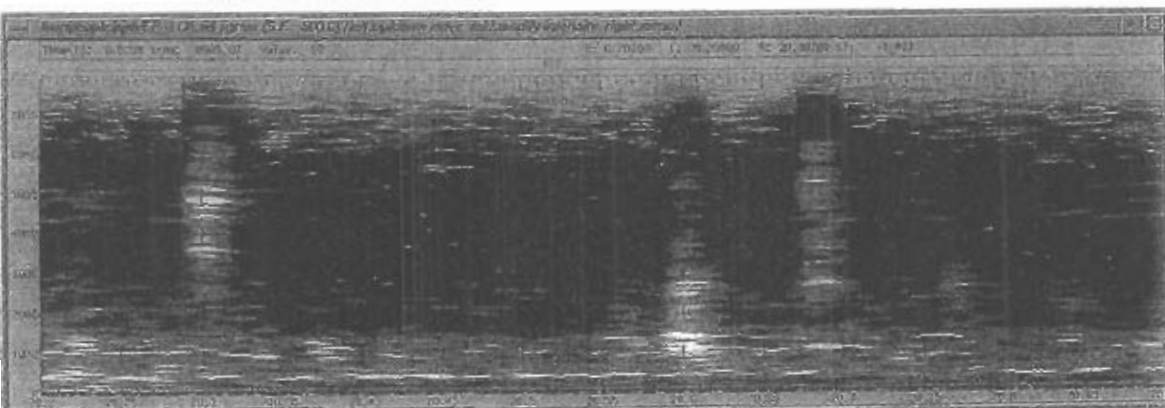


Figure 22(b): Time-Frequency analysis of the noise recorded at 07 h 38 min 14 s

As seen in the above two pictures, both noises at 07 h 38 min 23 s and 07 h 38 min 14 s present the same shape: they are made up of three separate sounds. In both cases, the first sound has more energy than the next two ones. Similarly to the noise recorded at 07 h 38 min 14 s, this noise is similar to the throttle levers movement.

5 CONCLUSIONS

It is important to keep in mind that the selectors, during the tests carried out by the BEA, could be moved without producing any noise (e.g. the case of the ground idle stop). Moreover, the selectors could be moved in many different ways, producing different signatures. One must also remember that human perception of the noise is an important aspect of its analysis.

It has been pointed out in this report that the hot-mike channel was used for the spectrum analysis. It has been shown that there are differences in spectrum analysis when sounds are captured by the cam or the hot-mike. The BEA's database was improved with a hand microphone recording. The acquisition system was not identical but similar in principle without the part of waves travelling through material.

Some of the noises compared present similarities in their shape and sound with the BEA database. Based on pure acoustic considerations, due to timing and frequency similarities between signatures, it was possible to reach a positive conclusion on identification of the target noises. Moreover synchronization with FDR data led us to confirm hypotheses, especially regarding throttle movements.


The conclusions reached were as follows:

Event	CVR Time
Auto Pilot disconnect	07 h 37 min 48.6 s
Sound similar to Flaps handle operation	07 h 37 min 56.4 s
Sound similar to L/G handle operation	07 h 37 min 57.7 s
Sound similar to Flaps handle operation	07 h 38 min 01.4 s
Series of three single chime	07 h 38 min 06.7 s
Sound similar to L/G doors locking	07 h 38 min 06.9 s
Series of three single chime	07 h 38 min 08.6 s
Sound similar to ground range selectors being lifted	07 h 38 min 11.3 s
Sound similar to ground range selectors being released	07 h 38 min 12.6 s
Sound similar to throttle lever movement	07 h 38 min 14.1 s
Visualization of GPWS warning	07 h 38 min 21.0 s
Sound similar to throttle lever movement	07 h 38 min 23.6 s
End of recording	07 h 38 min 30,2 s

EP-LCA

Fokker 50 Kish Airlines

Sharjah UAE, 10/02/04

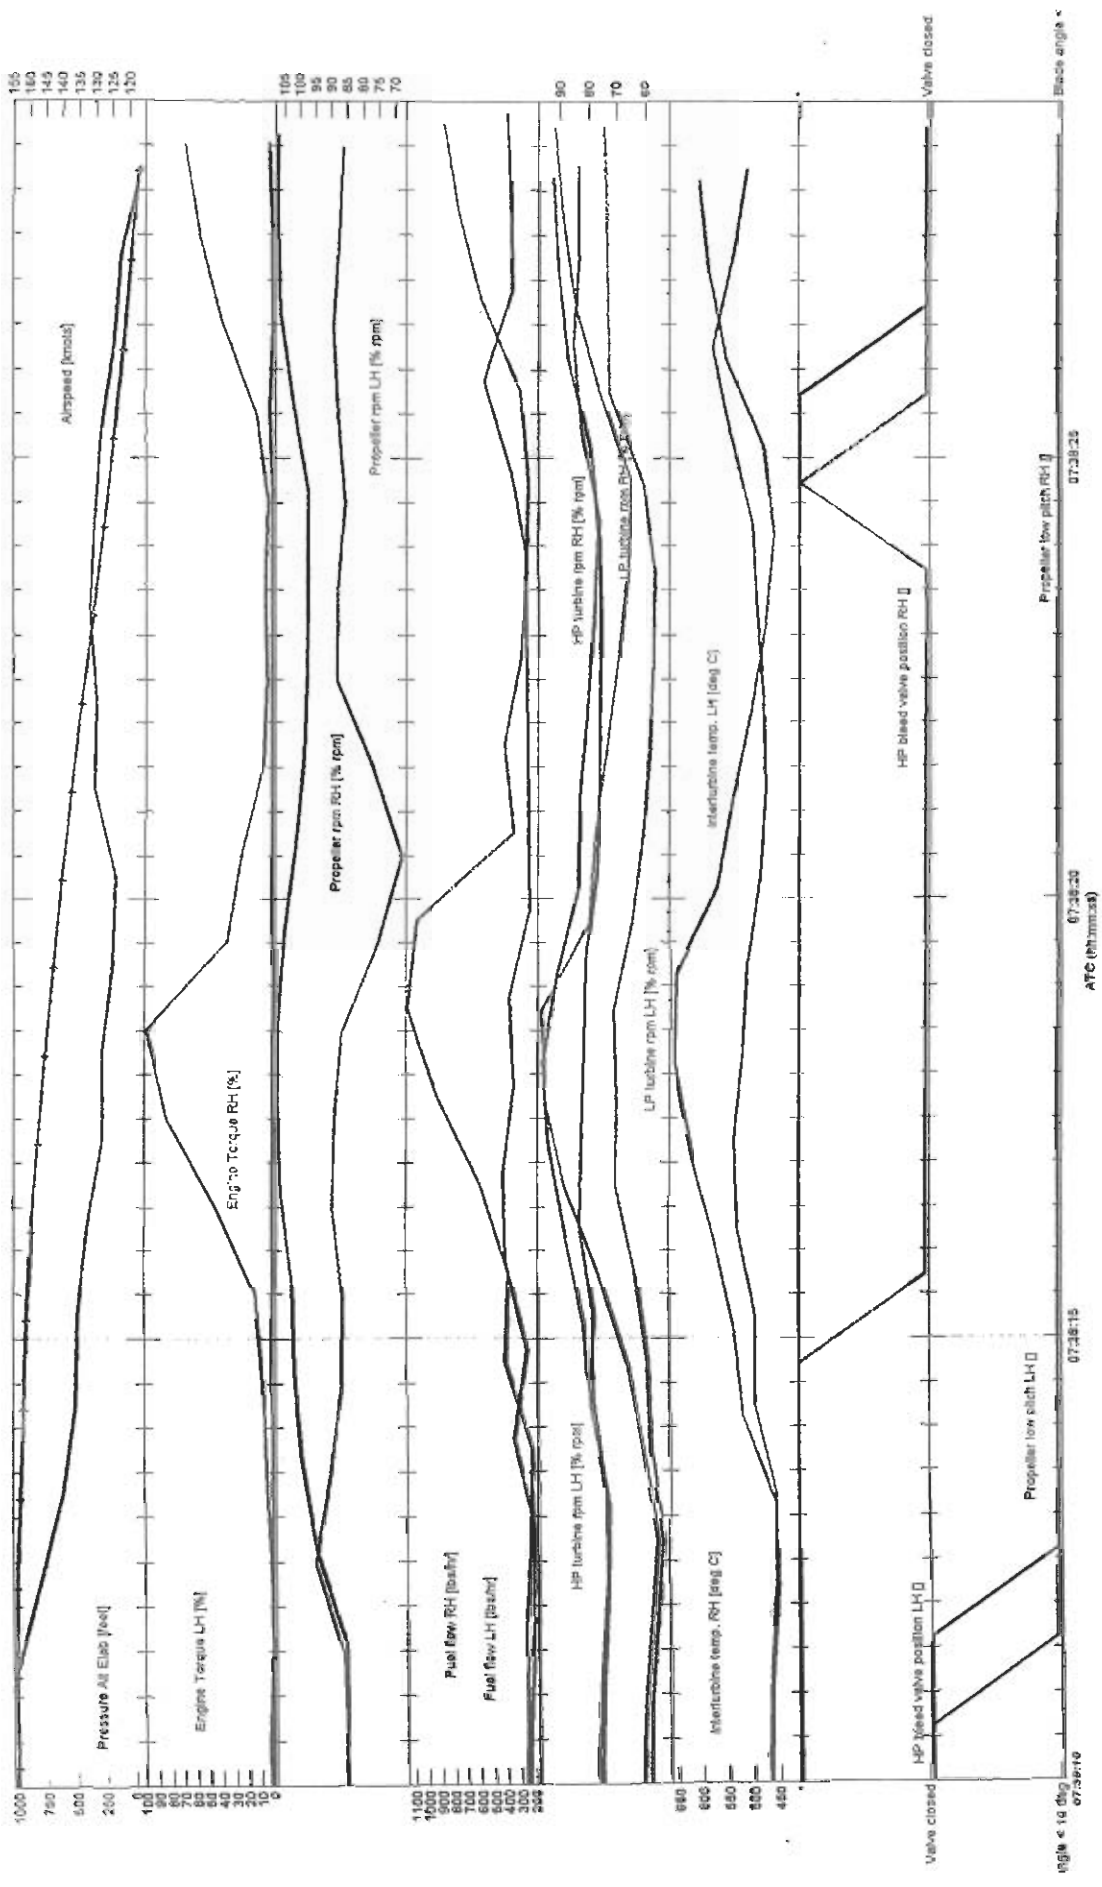

Plot 0 : Engines 20 seconds


A5-1

DEA - 18/02/2004

EP-LCA

Fokker 50 - Kish Airlines

Sharjah (UAE) - February 10, 2004

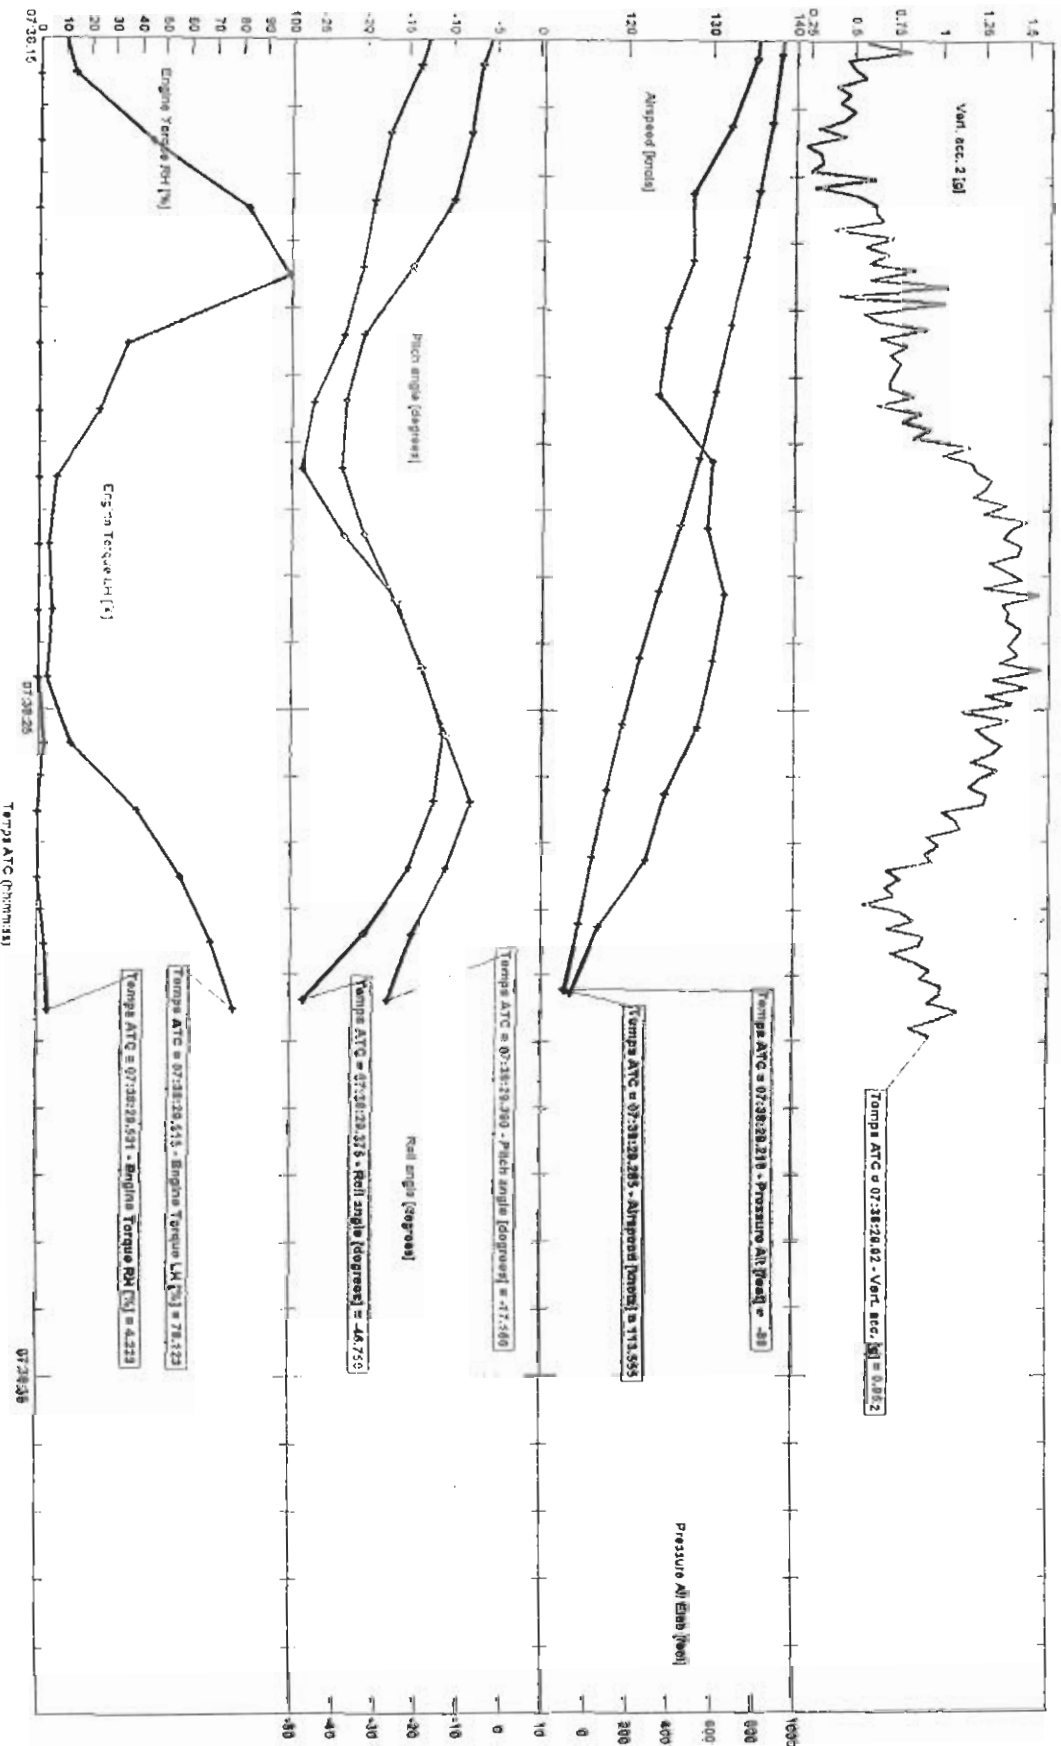

End of recording

A5-2

Fokker F27 Mk 050 EP-LCA Approach Accident 10 th February 2004	5-22-03	
	ISSUE 2	PAGE 1 OF 18
Propeller Tear Down Report		

SUMMARY

It was reported that a Fokker 50 aircraft operated by Kish Air crashed on the approach to Sharjah airport, United Arab Emirates on 10th February 2004. There was a severe and intense post impact fire.

Propeller, type number R352/6-123-F/1 serial number DRG/9401/87 was reported to have been removed from the left hand powerplant and propeller, type number R352/6-123-F/2 serial number DAP 0044 was reported to have been removed from the right hand powerplant.

The tear down was conducted at Dowty Propellers Repair and Overhaul facilities at Gloucester on 31st March 2004 under the direct supervision of Mr Philip Smith, Investigator-in-charge, General Civil Aviation Authority United Arab Emirates. Although both propellers had sustained significant impact damage, it is considered that both propellers had been built correctly using the specified components and that both propellers were capable of correct operation up to the moment of first impact.

The left hand propeller was found to have impacted the ground in a reverse position, -18° and the right hand propeller was found to have impacted the ground at a blade angle of approximately +15°.

Visual examination of the returned control equipment and limited testing of the right hand PCU suggests that the equipment was capable of correct operation up to the impact.

DISTRIBUTION

United Arab Emirates GCAA
M. H. Burden – Technical & New Projects Director
J. D. Kemp – Chief Engineer
File
AAIB

DEPARTMENT: Technical Support

The original signed master of this document is held at Dowty Propellers, Anson Business Park, Cheltenham Road, Gloucester GL2 9QN.

Copyright © Smiths Aerospace Gloucester Limited 2005

This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.

smiths

A part of Smiths Aerospace

DAPS111 REV5

TABLE OF CONTENTS

1. BACKGROUND	4
2. INVESTIGATORS FEEDBACK	4
3. PROPELLER EXAMINATION	5
3.1 Left hand propeller examination	5
3.2 Right hand propeller examination	7
3.3 Blade angle measurement accuracy	8
4. CONTROL UNIT EXAMINATION	9
4.1 LH Pitch Control Unit (PCU)	9
4.2 RH Pitch Control Unit (PCU)	12
4.3 LH Overspeed Governor Unit (OSG)	15
4.4 RH Overspeed Governor Unit (OSG)	16
4.5 Feather Pump	17
4.6 Other Units	18
5. SYSTEM RESPONSE	18
6. AWN 97 CONSIDERATION	18
7. CONCLUSION	18
8. REFERENCES	18

1. BACKGROUND

A Fokker 50 aircraft operated by Kish Air was reported to have crashed on the approach to Sharjah airport, United Arab Emirates on 10th February 2004. There was a severe and intense post impact fire.

Propeller, type number R352/6-123-F/1 serial number DRG/9401/87 was reported to have been removed from the left hand powerplant and propeller, type number R352/6-123-F/2 serial number DAP 0044 was reported to have been removed from the right hand powerplant.

The tear down was conducted at Dowty Propellers Repair and Overhaul facilities at Gloucester on 31st March 2004 under the direct supervision of Mr Philip Smith, Investigator-in-charge, General Civil Aviation Authority United Arab Emirates.

2. INVESTIGATORS FEEDBACK

Analysis of the Flight Data Recorder and use of a simulator indicated that the aircraft was flying at 200 knots at a range of 3 miles from touchdown compared with the usual approach speed of 135 knots.

Spectrum analysis of the cockpit voice recorder had indicated that the pilot had pulled the power levers back through the gate during approach and the beta light illuminated after the landing gear was lowered. The aircraft entered a nose down attitude of 25 degrees and a bank angle of 35 degrees, which resulted in the ground impact.

Approximately 17 seconds later, the left wing tip hit the ground, followed by the left powerplant and the nose, prior to the breaking up of the fuselage. The aircraft was almost totally destroyed by fire after the impact.




The left-hand propeller was burnt and was removed with part of the gearbox still attached. The right hand propeller detached during the impact and was found approximately 50 metres from the main wreckage in a direct line down the starboard wing. There was no fire in the area of the right hand propeller.

3. PROPELLER EXAMINATION

3.1 Left hand propeller examination

The left-hand propeller had suffered from fire damage and so was identified from the logbook as DRG/9401/87. The propeller was returned still attached to part of the gearbox assembly.

Propeller condition upon receipt & after removal from the gearbox

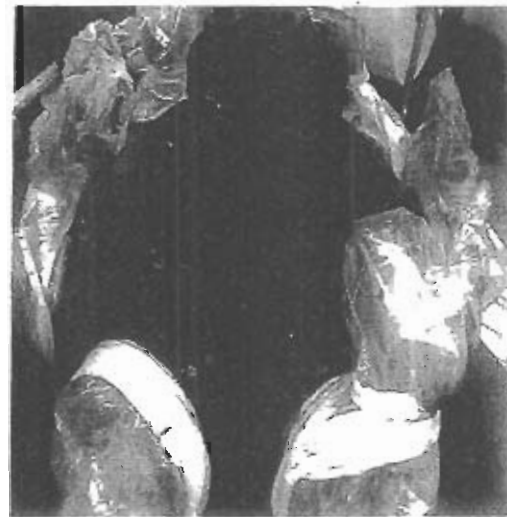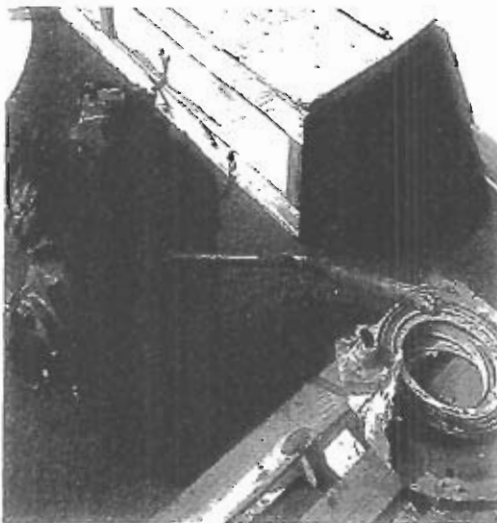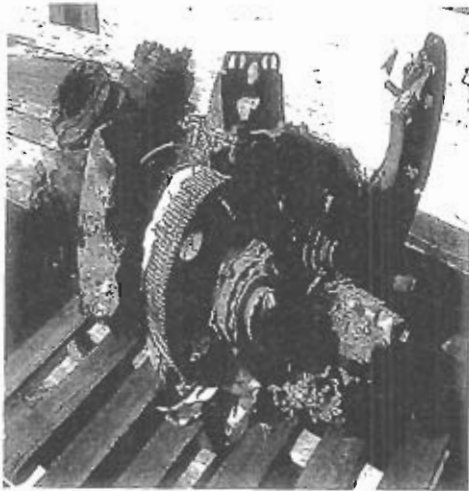


External examination of the counterweight position, using prepared acetates of the various counterweight centreline angles relative to the plane of propeller rotation, indicated that the left-hand propeller was approximately in a reverse position, -18° . Using a depth micrometer to establish the as-found position of the piston indicated a blade angle of approximately -15° . The result of the inspection reflect the as found condition for the blade angle and it should be noted take into account any post impact movement and potential movement during subsequent recovery and transportation.

Copyright © Smiths Aerospace Gloucester Limited 2005

This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.





Examination of impact marks on the crosshead and the blade op-pins butts are considered to be a reflection of the blade angle at the point of initial impact of the propeller blade. The marks indicated a blade angle of approximately -18° .

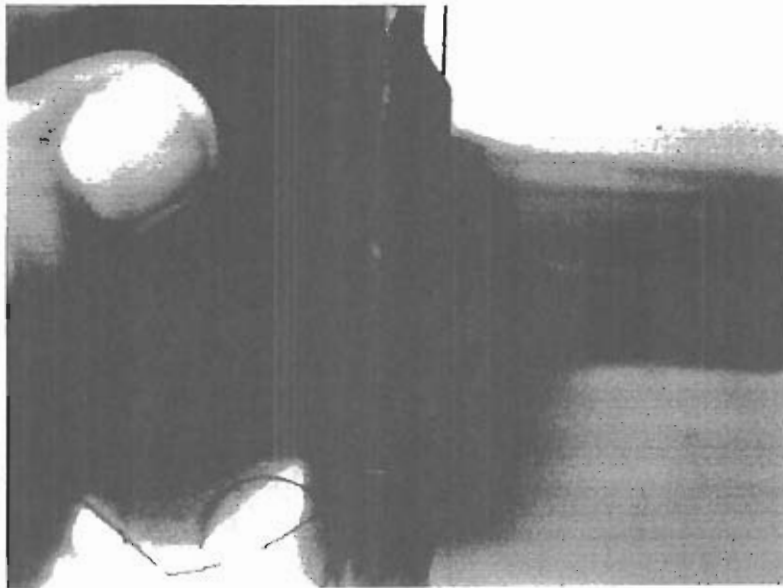

3.2 Right hand propeller examination


The right-hand propeller had broken off at its rear hub wall leaving the attachment spigot and bolts still fixed to the engine flange. It was identified as DAP 0044.

Propeller condition upon receipt

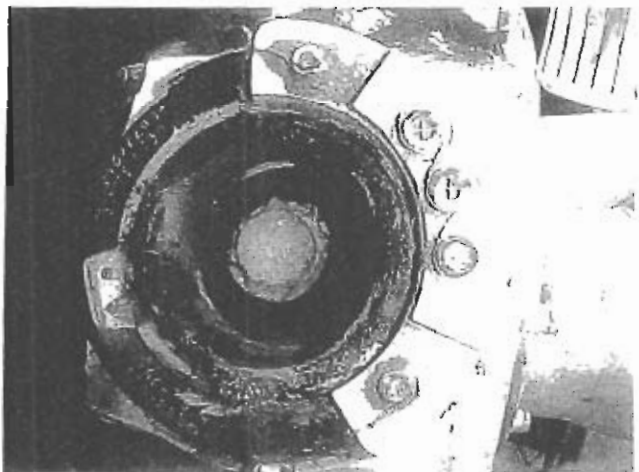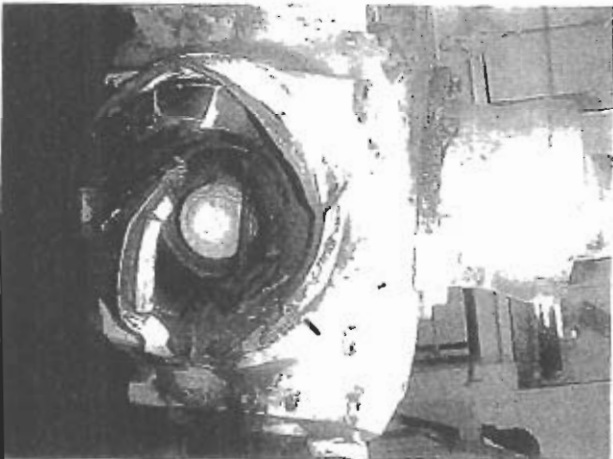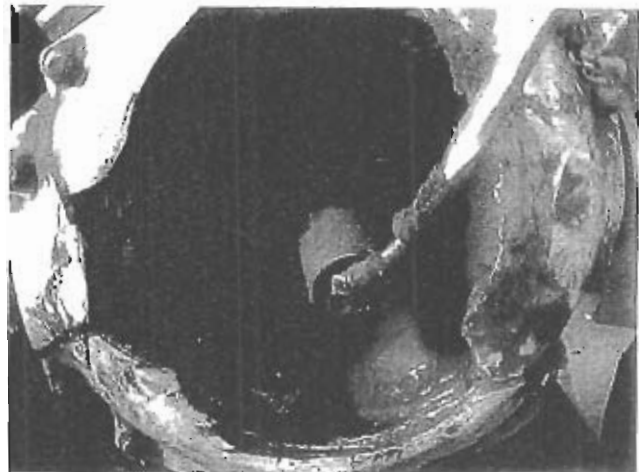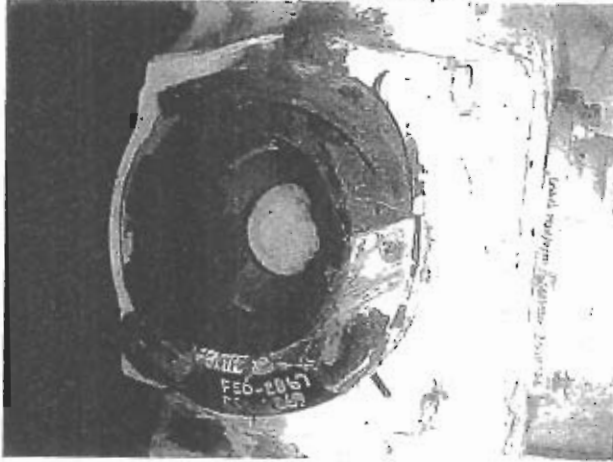

External examination of the hub and six blade/counterweight positions showed three had become detached and the remaining blade angles ranged from $+15^{\circ}$ to $+27^{\circ}$. Measurement of the as-found piston position indicated a blade angle of approximately $+17^{\circ}$. These examinations reflect the as found condition for the blade angle which takes into account post impact movement and potential movement during subsequent recovery and transportation.

Examination of impact marks on the crosshead and the blade op-pins butts are considered to be a reflection of the blade angle at the point of initial impact of the propeller blade. The marks indicated a blade angle of approximately $+15^{\circ}$ for the right hand propeller.

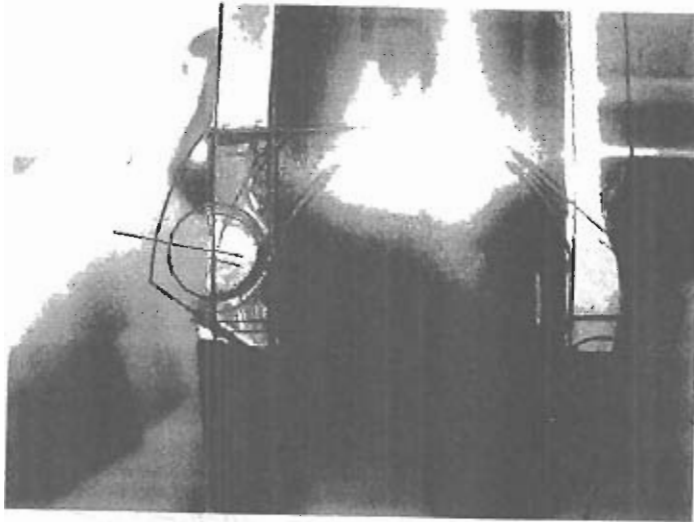

3.3 Blade angle measurement accuracy



Based upon observation and previous experiences, Dowty would expect the impact blade angles as measured at the various stages would give an accuracy of approximately ± 2 degrees from the nominal value of $+15$ degrees for the right hand propeller and -18 degrees for the left hand propeller.

4. control unit examination

4.1 LH Pitch Control Unit (PCU)


This PCU, labelled as being removed from the LH powerplant, was badly damaged in the fire such that its identification could not be verified. It was received still attached to part of the gearbox with some linkage still attached.

LH PCU Condition Upon Receipt

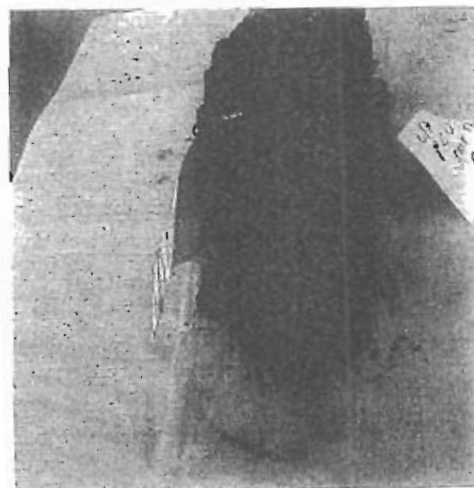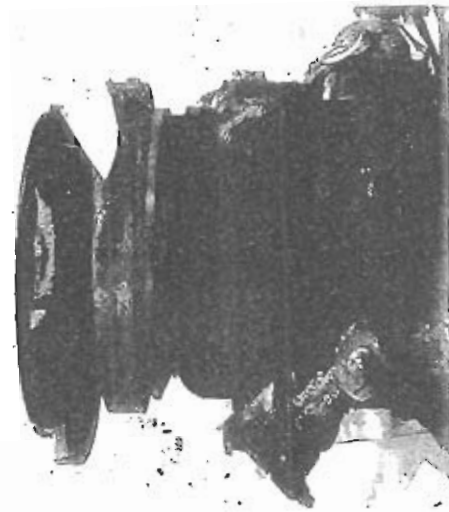



The following figure depicts the configuration around the rear of the PCU where the beta plunger that activates the ground beta light locates on the beta tube.

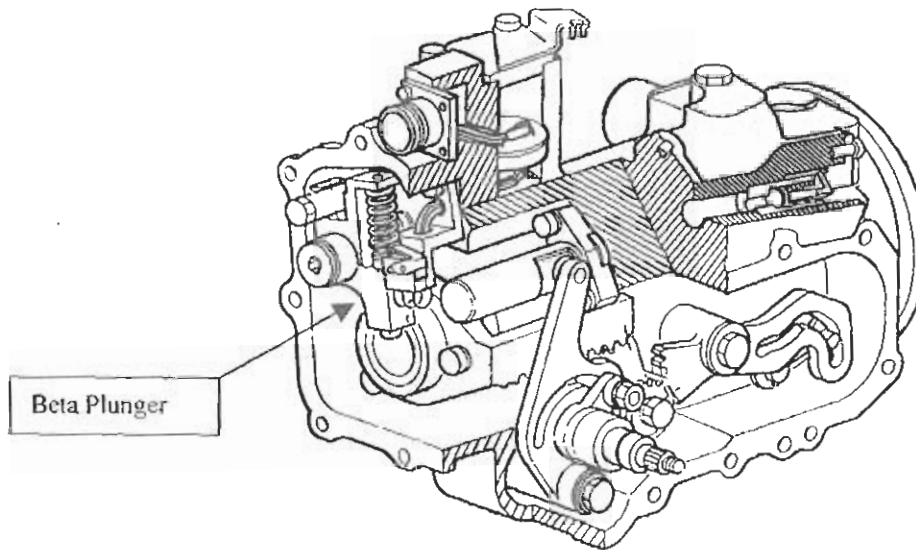

Rear View Illustration

It was not possible to install a dummy beta tube on the rig to check the operation of the beta light switch due to distortion of the main body resulting from the fire. The rear cover had burnt through during fire, see figure below. It was noted that the spring used to hold the beta cam had moved from its seat although it is considered that this most likely occurred during the cleaning process prior to handling at DPRO-G, see figure below.



Burnt Rear Cover



Displaced spring

It was therefore not possible to discern any meaningful conclusion about the PCU operation status.

Copyright © Smiths Aerospace Gloucester Limited 2005


This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.



4.2 RH Pitch Control Unit (PCU)

The unit, labelled as being removed from the RH powerplant, was identified as part number 663007005; serial number DRG/3452/88 up to and including mod strike 24. This unit was also still attached to part of the gearbox and had DAPRO 7 June 2001 stamped on the data plate. The unit was heavily contaminated with sand.

RH PCU Condition Upon Receipt

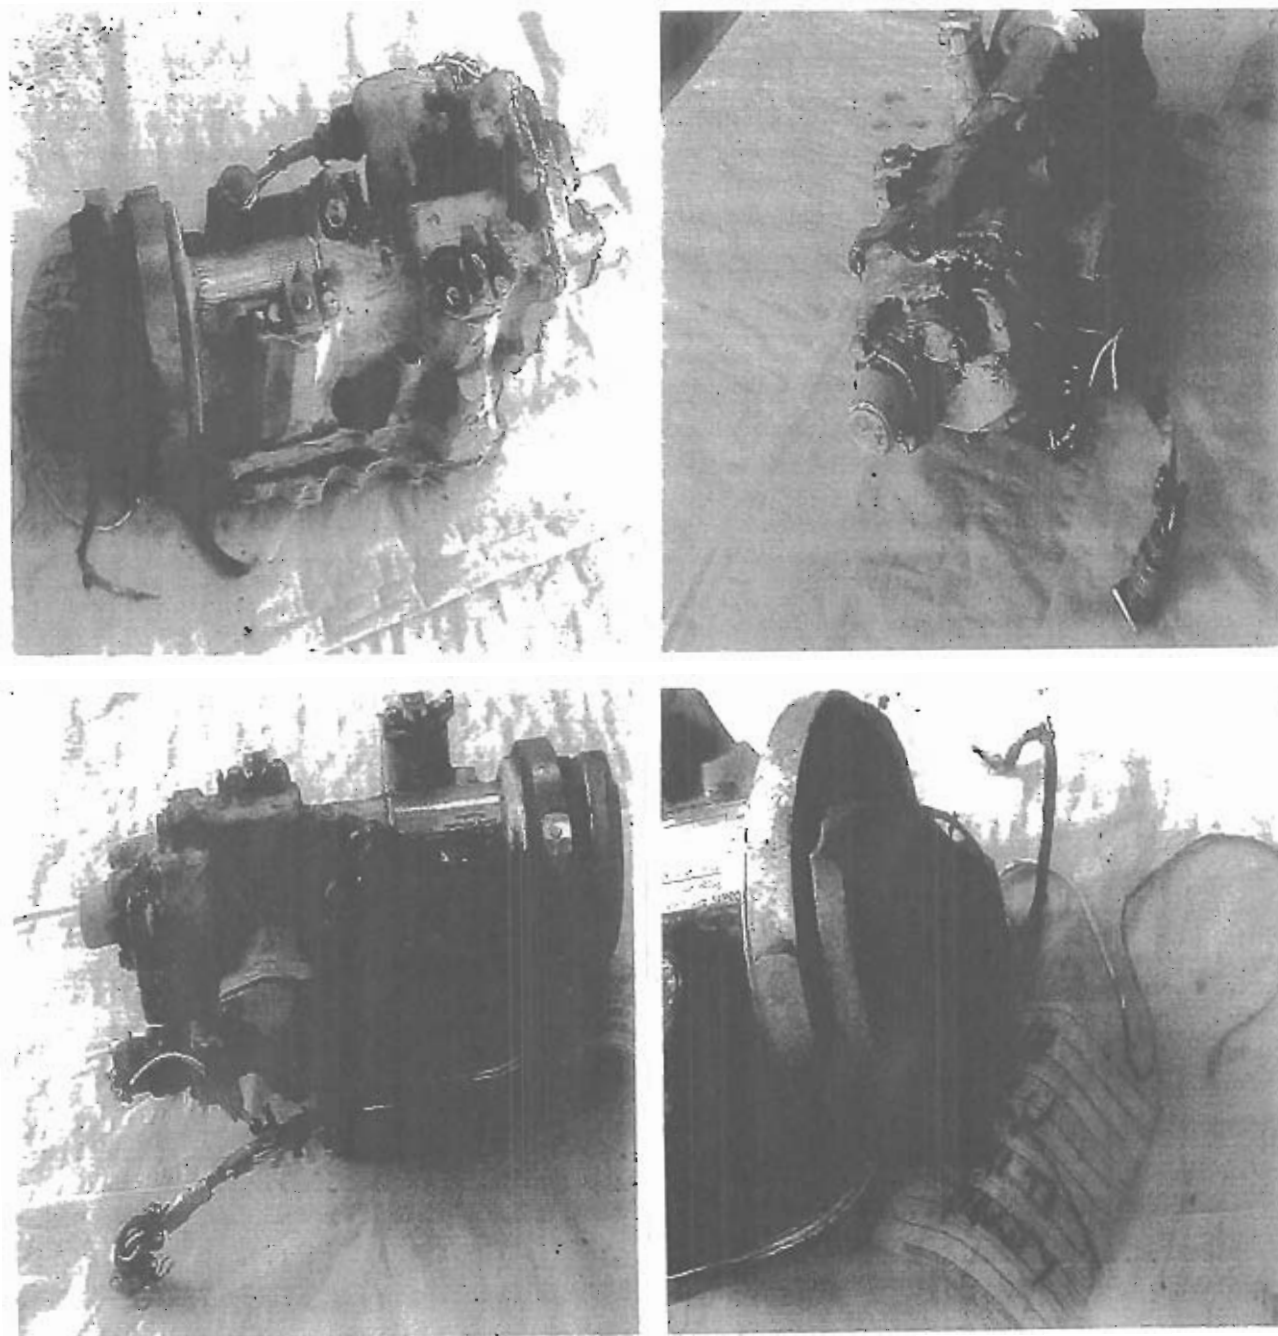



Copyright © Smiths Aerospace Gloucester Limited 2005

This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.


smiths

A part of Smiths Aerospace


After washing down, detailed examination showed that the rear housing had fractured and one of the lugs on the end cap had fractured. It was not possible to install the rigging pin due to the movement of the end cap.

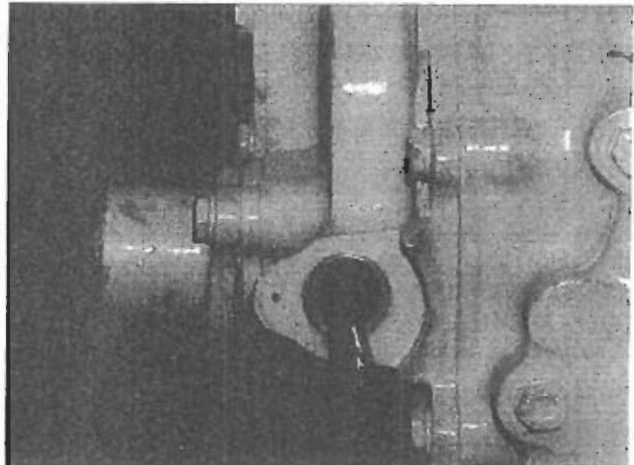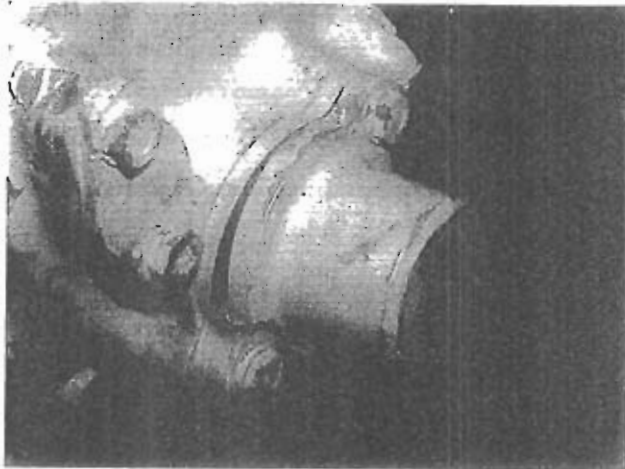

In addition the spring used to hold the beta plunger in place was missing. It was found around the side of the unit and was considered to have been displaced either during the impact or during the process of cleaning the PCU prior to handling in the workshop.

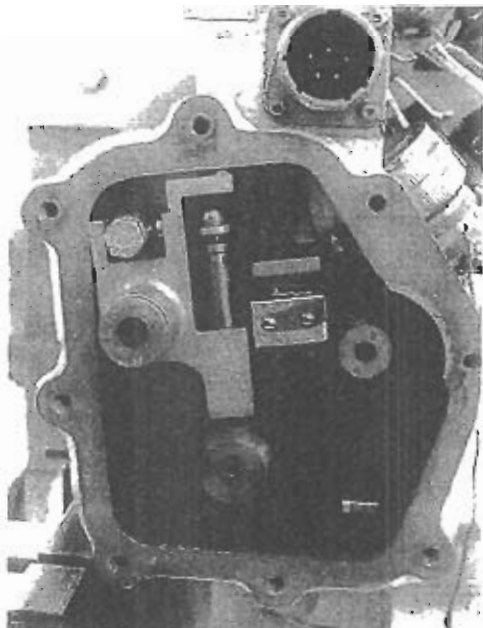

View on beta plunger

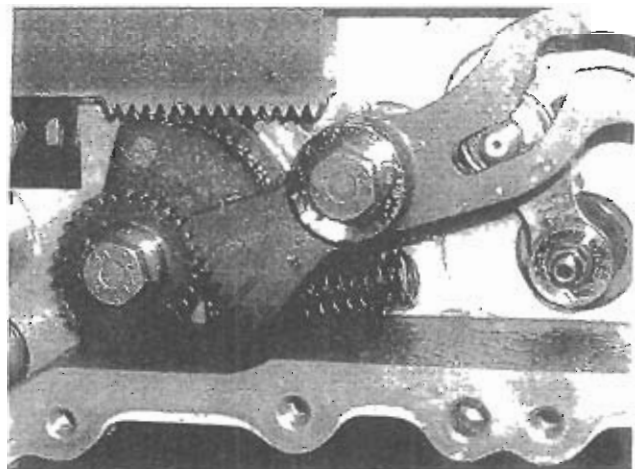

Location of displaced spring


The PCU was installed on the rig in order to check the beta light operation. The operation was found to conform with schedule requirements during transition from flight to ground range. In addition the movement required to transition back to flight range was also checked. It was found that a movement of 0.024 inches was required which relates to a blade angle change of 0.75 degrees.

Discussion

The right-hand propeller was found to have impacted the ground at a blade angle of approximately 15 degrees. Although the Flight Data Recorder (FDR) recorded the beta light as being on (i.e. propeller in the ground range) up to the point of impact, Dowty consider that, once the tolerance of the beta light position (approximately 10-13 degrees), the rate of change of blade angle as the propeller started to respond to the PLA demand, the sample rate of the FDR and the tolerance on the measured propeller blade angle at impact are taken into account, these findings are considered to be consistent with expected response under such conditions.

4.3 LH Overspeed Governor Unit (OSG)


The OSG had melted in the fire with the counterweights visible in the remainder of the unit. It was not possible to positively identify the unit but the remains were still attached to the reported LH powerplant.

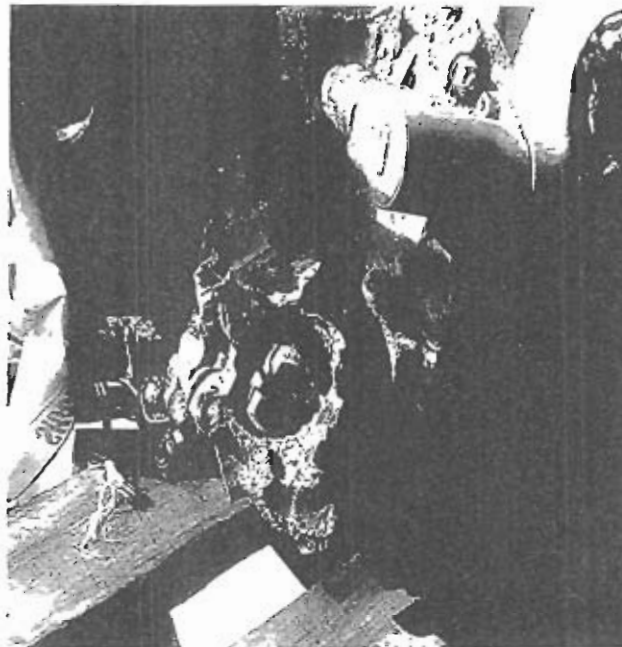

Remains of LH OSG on gearbox

4.4 RH Overspeed Governor Unit (OSG)





This unit labelled as being removed from the RH powerplant was identified as part number 661002011, serial number DRG/2024/91 with no mod strikes. This unit was also heavily contamination with sand.

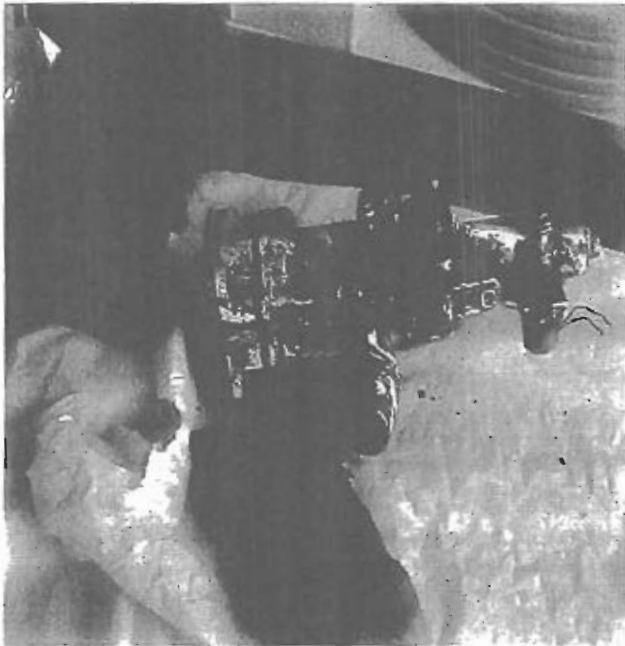

No specific inspection, test or teardown was undertaken on the OSG.

4.5 Feather Pump

This unit was identified as type number RFP 35, and serial number DRG 63/86. The electrical connector was missing and the mounting face had fractured. As this unit had not suffered any fire damage, it is considered that this probably had been fitted to the RH powerplant. A label stating RH feather pump was found in the PCU package. No specific inspection, test or teardown was undertaken on the OSG.

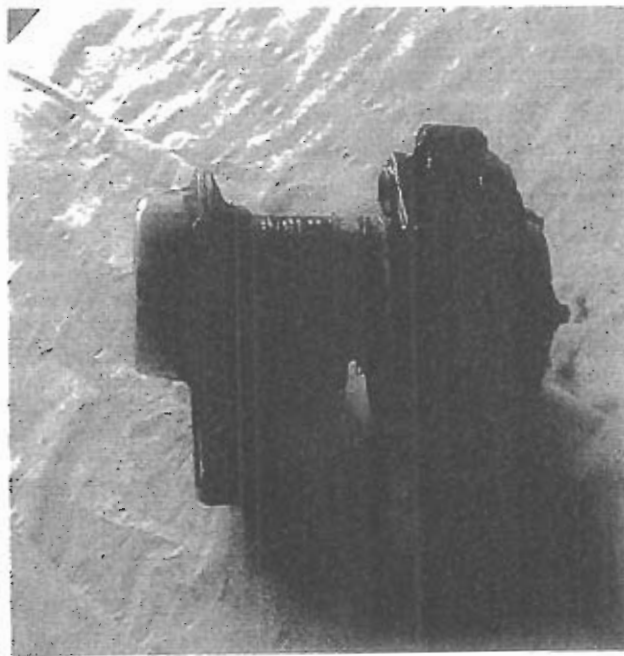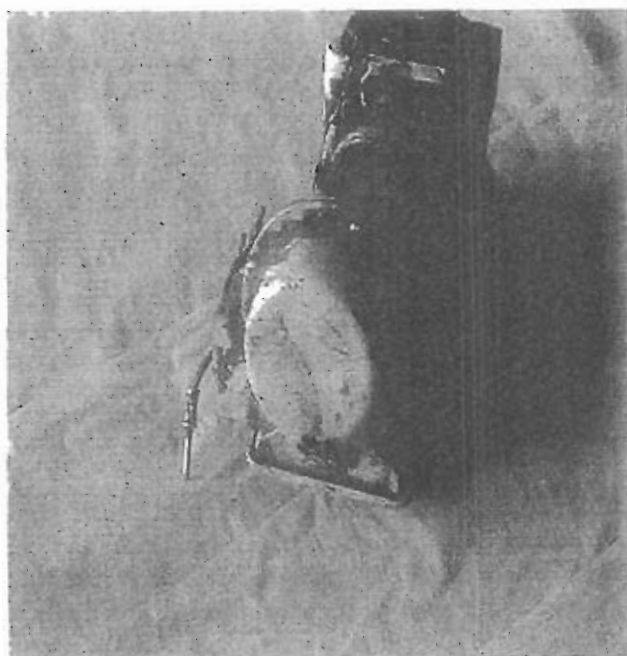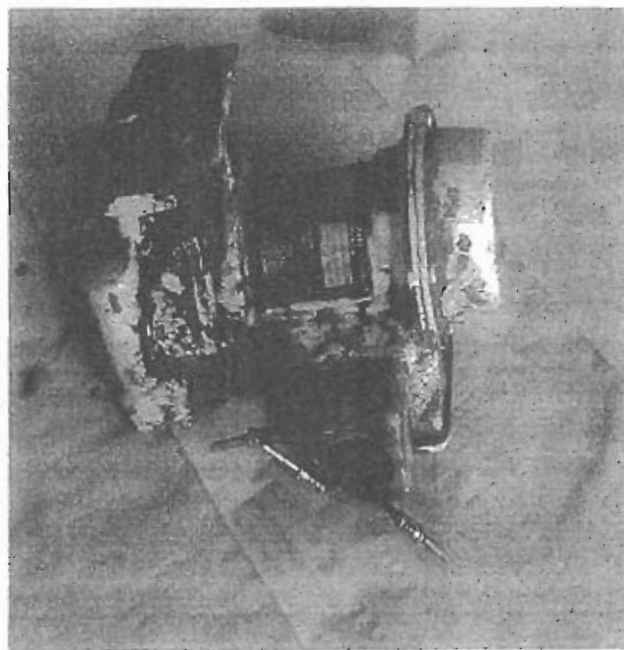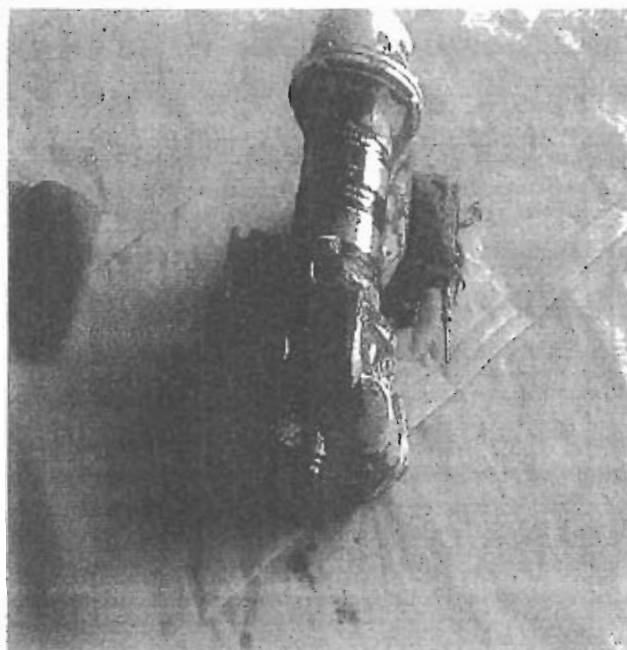

4.6 Other Units

The beta tubes had been cut to facilitate transportation as both were still installed in the respective propellers. No additional consideration was given to their condition.

Neither of the Propeller Electronic Control Units or the second feather pump were returned.

Any fault codes that affect the operation of the PEC are annunciated to the flight crew and the lack of any reports of any such annunciation suggests that PEC operation is not a contributing factor in this accident.

5. SYSTEM RESPONSE

The response and behaviour of the propeller system to the PLA inputs is discussed in report F50-00658, reference 1. It is concluded that the system responded as expected to the pilot demands.

6. AWN 97 CONSIDERATION

The following equipment is deemed to be scrap with reference to the requirements of airworthiness notice 97.

LH serial number	Equipment	RH serial number
DRG 9401/87	Propeller	DAP 0044
Not identified	Beta Tubes	Not identified
Not identified	PCU	DRG/3452/88
Not identified	OSG	DRG/2024/91
Not returned	Feather Pump	DRG/63/86

7. CONCLUSION

The condition of the propeller equipment is commensurate with having been involved in a major accident and resulting fire. No anomalies with any of the returned equipment were identified.

It is therefore considered that the propeller system was capable of correct operation up to the point of impact. The left hand propeller impacted the ground at a blade angle of approximately -18 degrees, which equates to the full reverse position and the right hand propeller impacted the ground at a blade angle of approximately +15 degrees, just in the flight range.

8. REFERENCES

1. Technical Report F50-00658 issue 1 - Propeller control analysis of accident to Fokker 50 aircraft EP-LCA (Kish Airlines), Sharjah, UAE, 10 Feb 2004.

Dowty Propellers

ENGINEERING TECHNICAL REPORT	F50-00658	
	ISSUE 1	PAGE 1 OF 127
PROPELLER CONTROL ANALYSIS OF ACCIDENT TO FOKKER 50 AIRCRAFT EP-LCA (KISH AIRLINES), SHARJAH, UAE, 10 FEB 2004		

SUMMARY

Both propellers on Fokker 50 EP-LCA behaved correctly and as expected, according to deduced pilot inputs during the final second of flight. At 07:38:12 the propellers entered ground beta pitch; this is considered to be the result of movement of the Power Levers below the Flight Idle gate and inability of the Fokker-supplied flight idle locks to prevent the movement. This action would have brought about significant windmilling drag. Disparity between the position of the Power Levers, indicated by difference fuel flow traces on the FDR, could have caused significant asymmetric forces. There is evidence that the Power Levers were restored to the flight range, but it is clear that this action alone could not be relied on to remove the asymmetric condition.

DAP311

DISTRIBUTION

D Cuttell

UAE General Civil Aviation Authority (Capt Philip Smith)

DEPARTMENT:

Engineering

Copyright © Smiths Aerospace Gloucester Limited 2005

This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.

smiths

A part of Smiths Aerospace DAP311.REV4

REVISION SHEET

Textual changes or additions since the last issue/revision are shown underlined.

ISSUE	DATE	COMPILED/ REVISED	APPROVED (Project Engineer)
A	25 May 2004	M W Trott Principal Reliability Engineer & Acting Controls Engineer	D Cuttell Project Engineer
NA	Preliminary issue.		

Dowty Propellers

F50-00658

ISSUE 1

PAGE 21

Contents

1. PURPOSE OF REPORT	22
2. ABBREVIATIONS	22
3. BASIC ACCIDENT DETAILS	22
4. DESCRIPTION OF PROPELLER SYSTEM	23
5. DESCRIPTION OF NORMAL PROPELLER OPERATION	24
6. ANALYSIS OF FLIGHT DATA RECORDER INFORMATION	26
7. CONCLUSIONS	28
APPENDIX 1 - SUMMARY OF FDR PROPELLER PARAMETERS	29
APPENDIX 2 - FIGURES 1- 6	31

1. PURPOSE OF REPORT

This report is intended to help the United Arab Emirates General Civil Aviation Authority inquiry into the likely cause(s) of the accident to Kish Airlines Fokker 50, EP-LCA. This aircraft crashed on approach to Sharjah Airport, UAE, on 10 February 2004. Assistance is offered with analysis of the likely behaviour of the Dowty R352 propellers. The basic pitch control system and operation is described, followed by interpretation of the propeller and relevant engine parameters from the Flight Data Recorder, and conclusions are drawn on the probable sequence of events with respect to propeller control during the final seconds of the flight.

2. ABBREVIATIONS

CVR	Cockpit Voice Recorder
FDR	Flight Data Recorder
OSG	Overspeed Governor
PCU	Pitch Control Unit
PEC	Propeller Electronic Controller

3. BASIC ACCIDENT DETAILS

3.1 According to the FDR, the aircraft, Kish Airlines Fokker 50 EP-LCA, was approaching the airport at approximately 1,000 ft and 130 kts, and both propellers were constant speeding normally at 85% rpm. Propeller pitch at this point is estimated to have been 15 deg, corresponding to the Power Levers held at Flight Idle.

3.2 Suddenly both propellers increased in speed and both low pitch switches were closed, indicating pitch excursion into the ground pitch range (switches close between 10 and 13 deg). The pilot was then unable to maintain control of the aircraft, which subsequently crashed. The FDR apparently ran till impact and never showed either propeller to increase in pitch above the low pitch switch setting. However, upon teardown initial impact marks showed the LH propeller to be approximately at maximum reverse pitch (- 17 deg) and the RH propeller to be approximately at the Flight Idle position (+ 15 deg).

3.3 The initial teardown report showed both propellers to have been assembled correctly and capable of correct operation up to the moment of impact.

4. DESCRIPTION OF PROPELLER SYSTEM

4.1 The R352 propeller system is hydraulically controlled in pitch. There are two basic pitch ranges, one appropriate to ground operation (-17 deg to + 7 deg, where the propeller is in beta control mode) and one appropriate to flight operation (+15 deg to feather where the propeller is in constant speeding control mode). After touchdown a stable pitch between 7 and 15 deg can in theory be achieved by slight reduction of Power Lever Angle below Flight Idle ('ground beta transition mode'), although it is customary to pull the lever back to Ground Idle or into the reverse thrust range for propeller braking effect.

4.2 The propeller blades are connected in pitch to a crosshead or yoke that is connected to an hydraulic pitch change cylinder on the front of the propeller hub. Oil is supplied to and conveyed away from the fine and coarse pitch chambers of this cylinder by concentric oil tubes, called Beta Tubes; these pass through the Propeller Reduction Gearbox (Pratt & Whitney Canada supply) and fit in the oil transfer muff of the propeller Pitch Control Unit, that is mounted on the back of the gearbox. The Beta Tubes therefore rotate with the propeller and move fore and aft as it changes pitch. An interfacing sleeve fits around the Beta Tubes in the PCU housing and is connected to the Power Lever via a profiled cam that defines the beta schedule; this is called the beta sleeve.

4.3 The propeller moves in pitch under the combined influence of the following forces.

- blade aerodynamic forces, tending to move the propeller to fine pitch
- combined blade and counterweight mass forces, tending to move the propeller to coarse pitch in the in-flight range, but diminishing at low pitch and actually reversing sign in negative pitch due to the changing geometry
- hydraulic forces supplied by the pitch control system
- frictional forces, resisting any pitch change input (and tending to dominate when the sum of the other forces is very small)

4.4 For selection of high drag and reverse thrust for braking after landing and for ground manoeuvring, pitch is controlled directly by movements of the Power Lever through ports in the beta sleeve, allowing unmodulated high pressure oil from the system HP pump into the propeller fine and coarse oilways. During flight the Power Lever positions the beta sleeve so that the unmodulated oil supply is isolated and modulated oil is supplied via a servo valve in the PCU and an Overspeed Governor. The servo valve is controlled by a Propeller Electronic Controller (PEC), which receives a once-per-

revolution pulse from the propeller to determine speed; it receives a speed demand signal from the flight deck (85% or 100%) and commands the servo valve to drive the propeller fine when it is underspeeding and coarse during overspeeding. Should the servo valve fail selecting fine pitch, the hydromechanical OSG will govern propeller speed at 105%.

4.5 It is prohibited for the pilot to bring the Power Lever below the Flight Idle detent during flight until the aircraft has landed. A Fokker-supplied, electrically-operated flight idle lock, fitted to the Power Lever-PCU linkage, prevents such erroneous pilot action until a weight-on-wheels signal is received from the landing gear on touchdown. It is possible to lift the Power Lever from the Flight Idle detent and obtain a small amount of travel before encountering the lock; such an action, although not permitted, lowers the minimum in-flight pitch and gives additional drag during approach for landing.

5. DESCRIPTION OF NORMAL PROPELLER OPERATION

5.1 Constant speeding mode See Fig.1.

During take-off, 100% propeller speed is selected on the Engine Rating Panel and the Power Lever is at Normal or Maximum Take-off, giving a minimum pitch on the beta schedule of 19.4 deg. The beta sleeve is held in the flight position. (If the servo valve drove inadvertently fine AND the Overspeed Governor did not function as required, 19.4 deg is the pitch the propeller would reach. See Fig.2. Actual pitch is normally much higher than this, since the propeller enters constant speeding mode soon after high power selection.)

During cruise, 85% propeller speed is selected on the Engine Rating Panel and the Power Lever is between Flight Idle and Normal Take-off, giving a minimum pitch on the beta schedule of 17 deg. The beta sleeve is in the flight position. Actual pitch is much higher than 17 deg, since the propeller is constant speeding during flight when significant power is demanded from the engine. Fig.1 shows the propeller at 30 deg.

5.2 In-flight beta mode (NB, not ground beta) See Fig.3.

During approach for landing, 85% propeller speed is selected on the Engine Rating Panel and the Power Lever is at Flight Idle. The beta sleeve is still in the flight position. Pitch is 'sitting on' the beta schedule, which gives 15 deg at Flight Idle. The coarse-seeking counterweight effort, fine-seeking blade mass forces and fine-seeking blade aerodynamic forces are matched by the fine-seeking hydraulic effort. Because of the low power and reducing forward

speed, the propeller tends to underspeed so that it 'hugs' the beta schedule. Thrust is minimal and there is possibly a small amount of windmilling drag.

5.3 Ground beta transition See Fig.4.

Should the Power Lever be erroneously brought a small amount below the Flight Fine detent, the beta sleeve will be positioned for ground beta transition. (The Fokker-supplied flight idle lock allows a small amount of travel below Flight Idle.) Access to the modulated oil supply from the servo valve (and Overspeed Governor) is closed off, but the beta sleeve porting hasn't quite opened up the unmodulated hp supply. Pitch can vary from 7 deg to 15 deg (but there is a tolerance on these values) and follows the linear beta schedule, according to Power Lever position. The low pitch switch will close and illuminate a blue lamp on the flight deck when pitch is below approximately 11 deg. Windmilling drag increases and positive counterweight effort decreases in this regime.

5.4 Ground beta control See Fig.5.

Should the Power Lever be erroneously brought a greater amount below the Flight Fine detent, the beta sleeve will be positioned for on-ground beta control and pitch will follow the linear beta schedule, according to Power Lever position, from 7 deg down to maximum reverse pitch (-17 deg). (This action would normally be prevented by the Fokker-supplied flight idle lock until the aircraft landed.) The motive force to reduce pitch is provided by hp oil direct from the hp pump. Windmilling drag increases rapidly as does positive counterweight effort decrease in this regime. Possible variation between propellers in the amount of windmilling drag will be experienced as yawing forces on the aircraft at a time when lateral controllability is diminishing due to the falling airspeed; height margins are also being fast used up.

5.5 Ground beta transition or ground beta control with Power Lever suddenly moved above Flight Idle See Fig.6.

The instinctive corrective response of a pilot when he realises that he should not have brought the Power Lever below Flight Idle would be to push the lever rapidly forward into the flight range. When this happens, the beta sleeve is very quickly repositioned for in-flight constant speeding. Unmodulated hp oil is therefore isolated and modulated pressure oil is able to enter coarse pitch (not fine pitch as usual in flight). However, if propeller speed exceeds the selected value (85% on approach), modulated pressure will decay since the speed governor assumes counterweight effort will coarsen the propeller to reduce speed. The blade counterweights are only designed to be effective in the in-flight pitch range, i.e., pitch at least 15 deg. Because of their changing position as the propeller changes pitch, it is not possible for counterweights to

give coarse-seeking effort throughout the complete pitch range. If pitch has reduced too far, sufficient coarsening effort will not be achieved and pitch will remain low or even negative. On the other hand, the engine will respond normally to the increased Power Lever setting and deliver more power to the propeller. If the propeller is 'stuck' at low positive pitch, it will be unable to absorb the engine power, engine torque will stay low and the propeller will tend to overspeed, windmill and generate drag. If the propeller is at negative pitch, it will absorb some power, engine torque will increase, but the propeller will generate negative thrust.

(It is invidious to prescribe the best action following in-flight selection of ground beta, since movement of the Power Lever below Flight Idle in flight is universally known to be forbidden. However, movement of the Fuel Shut-off Lever to Feather or Fuel Off will direct hp oil, assisted by oil from the auxiliary Feathering Pump, into propeller coarse pitch and drive the blades into the flight range where normal positive counterweight effort will be re-established and pitch will steadily increase towards feather. This will minimise aircraft drag and improve the chances of a successful emergency landing.)

5.6 Synopsis

The only safe in-flight propeller regimes are in-flight beta (pitch between 15 and 19.3 deg) and constant speeding (pitch above the beta schedule); these correspond to the Power Lever being at or above Flight Idle. Moving the Power Lever below Flight Idle in flight risks the propeller entering either ground beta transition (pitch between 7 and 15 deg) or true ground beta (-17 to 7 deg); in either of these states the propeller can windmill and generate excessive drag. In negative pitch it is possible for the propeller to absorb engine power and generate negative thrust. Moving the Power Lever rapidly above Flight Idle cannot be relied on to increase pitch, since there will be no hydraulic coarsening effort if the propeller happens to be at or above the selected speed. Moreover, there may be overwhelming external blade forces driving the propeller towards maximum reverse pitch.

6. ANALYSIS OF FLIGHT DATA RECORDER INFORMATION

6.1 FDR Information

See Appendix to this report.

6.2 LH Propeller (found at max reverse)

The LH propeller entered ground beta at 07:38:11, according to the change of low pitch switch status on the FDR; it is postulated that this was the result of

movement of the Power Lever below the Flight Idle gate shortly before. It is considered that for the remaining 17 seconds of FDR recording pitch was significantly below 10-13 deg low pitch switch setting, probably in reverse. This would explain why engine torque increased with increase in fuel flow, but the propeller would have produced not positive but negative thrust.

The beta sleeve was restored to the flight position at 07:38:13, as indicated by a sudden increase in fuel flow, presumed brought about by forward movement of the Power Lever. Modulated oil now had access to coarse pitch (explained in Fig.6), but modulated oil was only at high pressure and able to drive the propeller coarse back to the flight range while the propeller was underspeeding (below 85%). Underspeeding occurred for only four seconds from 07:38:18 to 07:38:22, since windmilling forces were generally keeping propeller speed high. Propeller pitch was dictated by the counterweight effort. It is believed that the LH propeller went sufficiently fine that it came under the influence of fine-seeking counterweight forces that took it eventually to maximum reverse pitch.

It is conjectured that the pilot's reduction of thrust to Flight Idle at 07:38:19 (to be followed by high thrust again just before impact) is explained by the fact that, in spite of selecting high thrust seconds after entering ground beta (07:38:13), high negative thrust on the LH propeller, felt as asymmetric forces on the aircraft, would have caused him to doubt that he had taken the correct action.

6.3 RH Propeller (found at Flight Idle)

The RH propeller entered ground beta at 07:38:12, according to the change of low pitch switch status on the FDR; it is postulated that this was the result of movement of the Power Lever below the Flight Idle gate shortly before. It is considered that for the remaining 16 seconds of FDR recording, pitch was probably just below 10-13 deg low pitch switch. This would explain why engine torque remained zero in spite of two increases in fuel flow and why the propeller oversped to 106%; a pitch of about 10 deg at low airspeed (130 kts) would not be able to absorb engine power.

The beta sleeve was restored to the flight position at 07:38:13, indicated by a sudden increase in fuel flow brought about by forward movement of the Power Lever. Modulated oil now had access to coarse pitch (explained in Fig.6), but modulated oil was only at high pressure and able to drive the propeller coarse back to the flight range while the propeller was underspeeding (below 85%). Underspeeding never occurred, since windmilling forces and engine power kept speed between 95% and 105% for the rest of the flight. Propeller pitch was dictated by the counterweight effort. It is considered that the LH propeller did not go sufficiently fine that it came

under the influence of fine-seeking counterweight forces, but drifted slowly coarse. It had not quite reached the 10-13 deg low pitch switch position at the last point on the FDR, but was almost there and in fact was found at 15 deg (Flight Idle) at the crash site.

It is conjectured that the pilot's reduction of thrust to Flight Idle at 07:38:19 (to be followed by high thrust again just before impact) is explained by the same reason as for the LH propeller. (He would not necessarily have known which propeller was behaving contrary to expectations.)

7. CONCLUSIONS

Both propellers on Fokker 50 EP-LCA behaved correctly and as expected, according to deduced pilot inputs during the final second of flight. At 07:38:12 the propellers entered ground beta pitch; this is considered to be the result of movement of the Power Levers below the Flight Idle gate and inability of the Fokker-supplied flight idle locks to prevent the movement. This action would have brought about significant windmilling drag. Disparity between the position of the Power Levers, indicated by difference fuel flow traces on the FDR, could have caused significant asymmetric forces. There is evidence that the Power Levers were restored to the flight range, but it is clear that this action alone could not be relied on to remove the asymmetric condition.

APPENDIX 1 - SUMMARY OF FDR PROPELLER PARAMETERS

Kish Airlines Fokker 50 EP-LCA, Sharjah, UAE, 10 Feb 2004 - FDR Analysis

Time mm:ss	LH Prop	RH Prop
38:10	All indications normal. Estimated pitch 15 deg/small drag.	All indications normal. Estimated pitch 15 deg/small drag.
38:11	Low pitch indicator shows pitch has fallen to 10-13 deg (slightly before RH prop). Fuel flow starts to drop from Flight Idle setting. Power Lever has been brought below Flight Idle detent. Prop speed starts to increase in consequence. Estimated increasing drag.	Low pitch indicator shows pitch has fallen to 10-13 deg. and prop speed starts to increase in consequence. Fuel flow starts to drop from Flight Idle setting. Power Lever has been brought below Flight Idle detent. Prop speed starts to increase in consequence. Estimated increasing drag.
38:12	Prop speed peaks at 95% then starts to fall.	Prop speed reaches 94% and continues to increase.
38:13	Fuel flow and engine torque start to increase. These facts indicate Power Lever has been moved above Flight Idle, but pitch is still at or below 10-13 deg (low pitch indication). (CVR suggests that Power Lever was moved to full forward a few seconds after prop goes into ground beta range.)	
38:16		PLA reaches max value, then falls to Flight Idle. Torque shows hardly any power is absorbed by prop.
38:18	Prop speed back to 86%. Fuel flow and torque high. PLA reaches max value, then falls to Flight Idle. Torque shows some power is absorbed by prop.	Prop speed peaks at 107%. Fluctuating fuel flow showing negligible increase in PLA (but presumably Power Lever has been moved back to Flight Idle at least - CVR suggests that Power Lever was moved to full forward a few seconds after prop goes into ground beta range). Torque remains negligible. Pitch is still at or below 10-13 deg (low pitch indication). Presumed high drag.
38:19	Sudden reduction in fuel flow and torque, implying Power Lever moved back to Flight Idle. Prop speed 75%.	
38:20	Prop speed dips to 67%.	

Copyright © Smiths Aerospace Gloucester Limited 2004

This document and any accompanying material including drawings or computer software and the information contained therein and associated copyright is proprietary to Smiths Aerospace Gloucester Limited trading as Dowty Propellers and is supplied in confidence. No rights or licences are granted to the recipient to use, disclose, copy, reproduce, publish or communicate by any means part or all of this document or accompanying material and information contained therein without the express written authority of Smiths Aerospace Gloucester Limited except as follows. The recipient may use and duplicate part or all of this document solely for the purposes of private examination and evaluation of the information contained therein.

38:23		PLA now starts to move back to high thrust setting. Torque shows hardly any power is absorbed by prop.
38:24	PLA now back at Flight Idle.	
38:25	PLA now starts to move back to high thrust setting. Torque shows some power is absorbed by prop.	Increase in fuel flow. Torque starts to rise but remains low. Prop speed fallen below 100%.
38:26	Increase in fuel flow and torque, implying Power Lever moved above Flight Idle. Prop speed seems to stabilise around 85-89%.	Prop speed increases again to 106%.
38:28	Last recorded time on FDR. Low pitch switch shows pitch is still below 10-13 deg. Teardown subsequently showed propeller pitch at initial impact to be approximately -17 deg (full reverse). I believe pitch was significantly below 10-13 deg, probably in reverse, during final 18 seconds since in-flight beta was first selected. This would explain why engine torque increased with increase in fuel flow, but prop would have produced not positive but negative thrust! I believe the pilot's reduction of thrust to Flight Idle at 07:38:19 (to be followed by high thrust again just before impact) is explained by the fact that, in spite of selecting high thrust seconds after entering ground beta, high negative thrust on the LH prop (felt as general asymmetric forces on the aircraft) would have caused him to doubt that he had taken the correct action.	Last recorded time on FDR. Low pitch switch shows pitch is 10-13 deg. Teardown subsequently showed propeller pitch at initial impact to be approximately 15 deg (Flight Idle). I believe pitch was probably just below 10-13 deg during final 18 seconds since in-flight beta was first selected. This would explain why engine torque remained zero in spite of two increases in fuel flow and propeller oversped to 106%; a pitch of about 10 deg at low airspeed (130-140 kts) would not be able to absorb engine power. I believe the pilot's reduction of thrust to Flight Idle at 07:38:19 (to be followed by high thrust again just before impact) is explained by the fact that, in spite of selecting high thrust seconds after entering ground beta, high negative thrust on the LH prop would have caused him to doubt that he had taken the correct action. (He would not necessarily have known which prop was behaving contrary to expectations.)

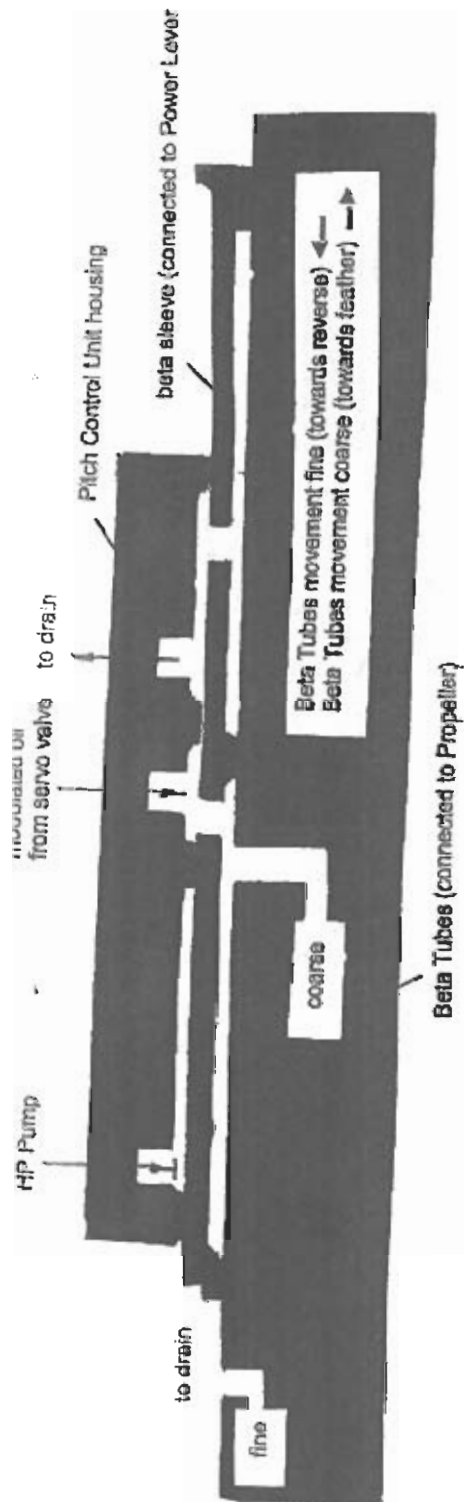


Fig.6 Power Lever has been moved suddenly above Flight Idle, high power, beta sleeve in flight position isolating hp oil, but propeller is still in ground range, pitch about 5 deg. Counterweight effort may be insignificant or even fine-seeking. Modulated oil able to enter coarse pitch, but pressure will decay if propeller speed exceeds selected value (85%). Coarse-seeking forces may be insufficient to bring propeller into flight pitch range.

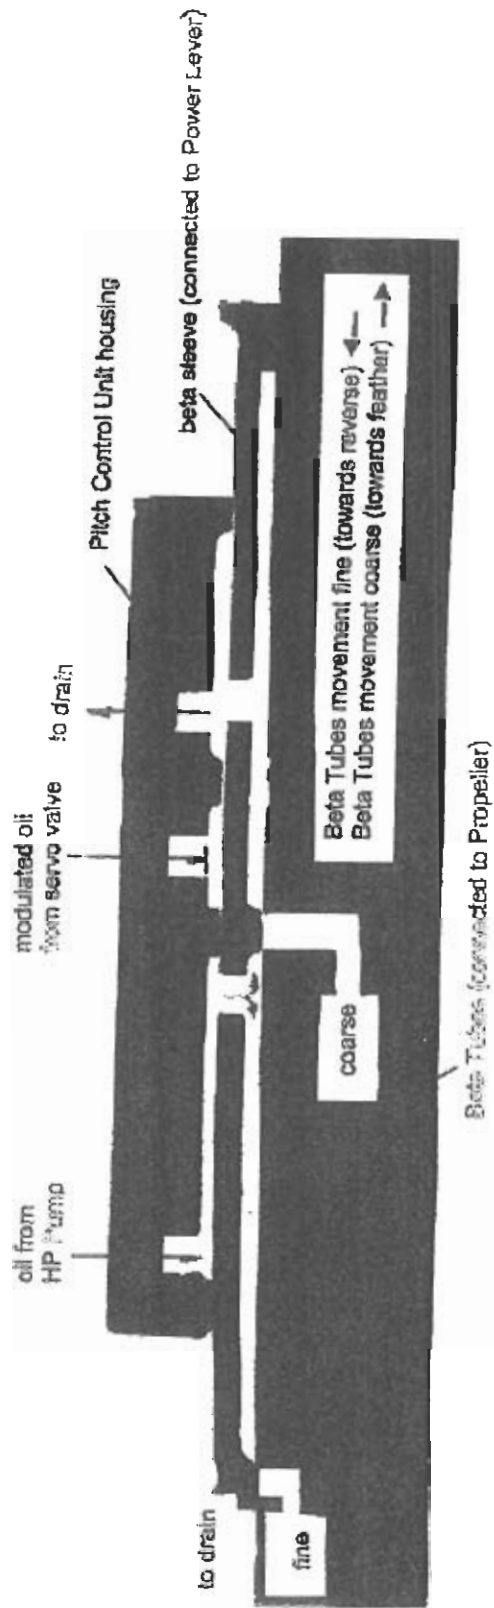


Fig.5 Power Lever below Flight Idle, low power, beta sleeve in ground position Isolating modulated oil, propeller beta controlling, pitch about 5 deg. Counterweight effort may be insignificant or even fine-setting.

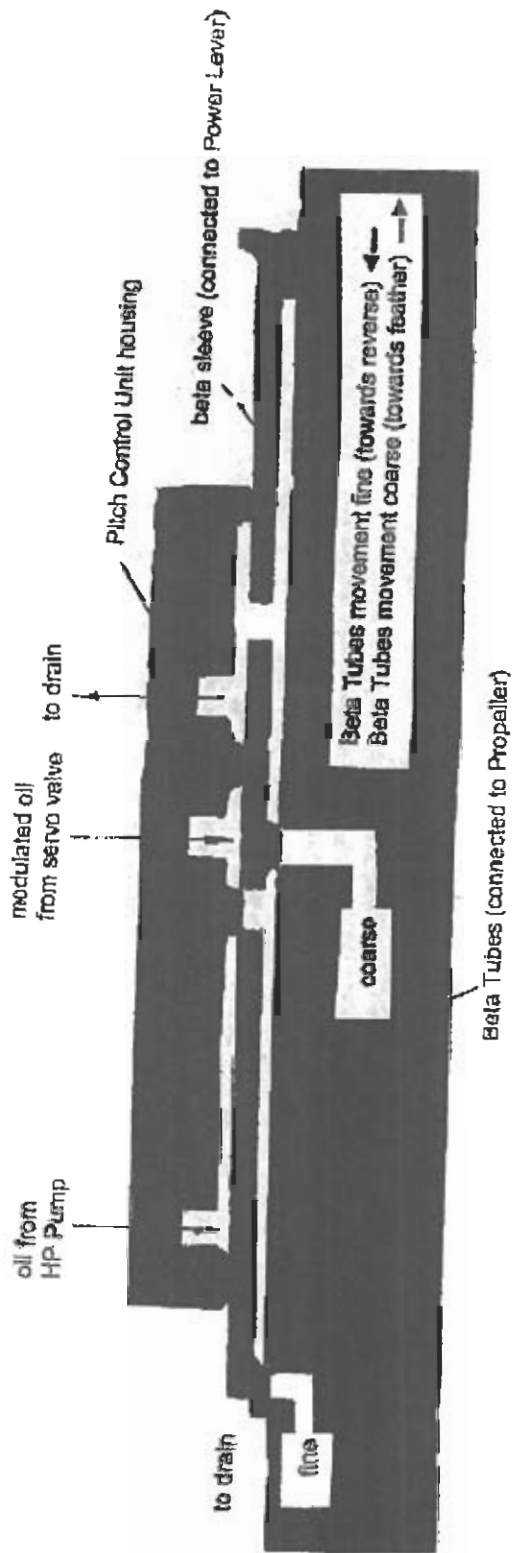


Fig.4 Power Lever just below Flight Idle, beta sleeve between ground and flight positions (ground beta transition), pitch about 11 deg

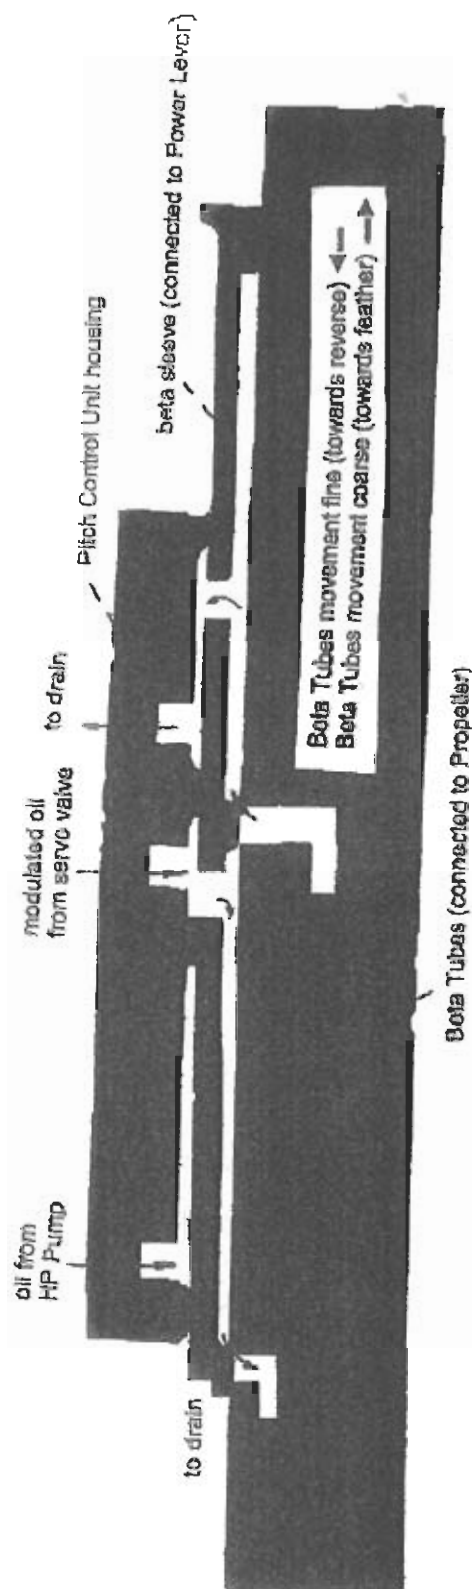


Fig.3 Power Lever at Flight idle, low power, beta sleeve in flight position isolating hp oil, propeller constant speeding with modulated oil pressure in fine pitch balancing coarse seeking counterweight effort, pitch at 15 deg

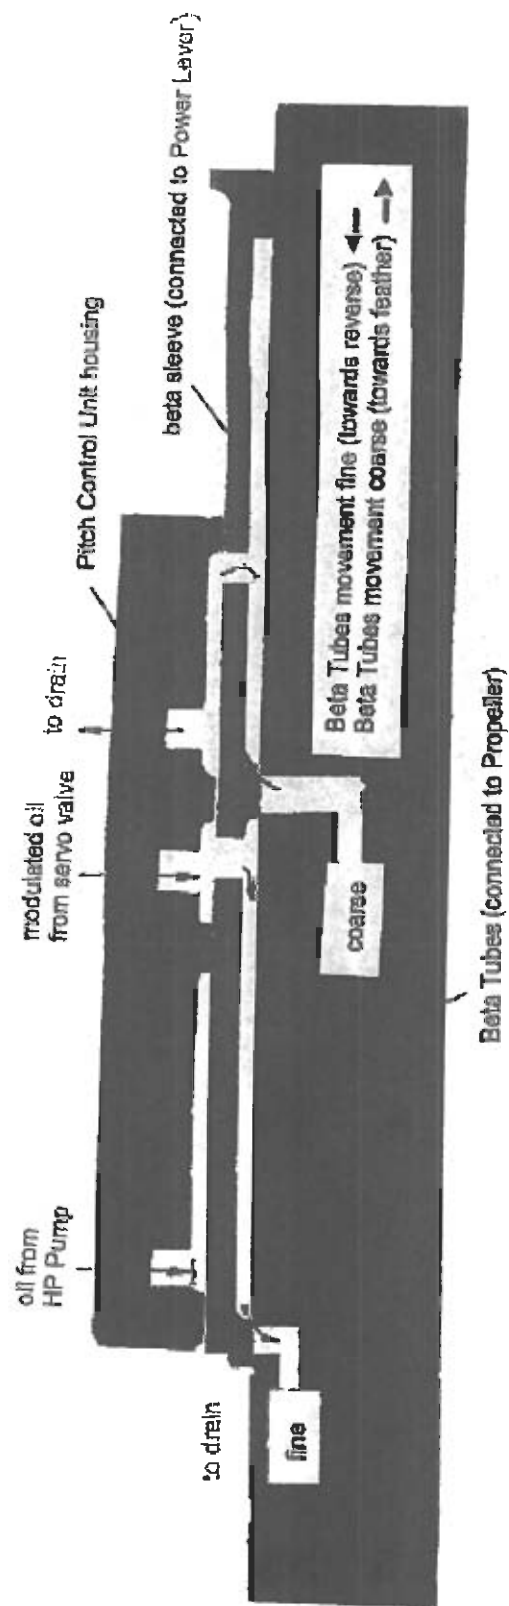


Fig-2 (failure case) Power Lever significantly above Flight Idle, high power, beta sleeve in flight position, but multiple failures in normal speed governor and Overspeed Governor have driven pitch down to beta schedule, pitch about 18 deg

APPENDIX 2 - FIGURES 1-6


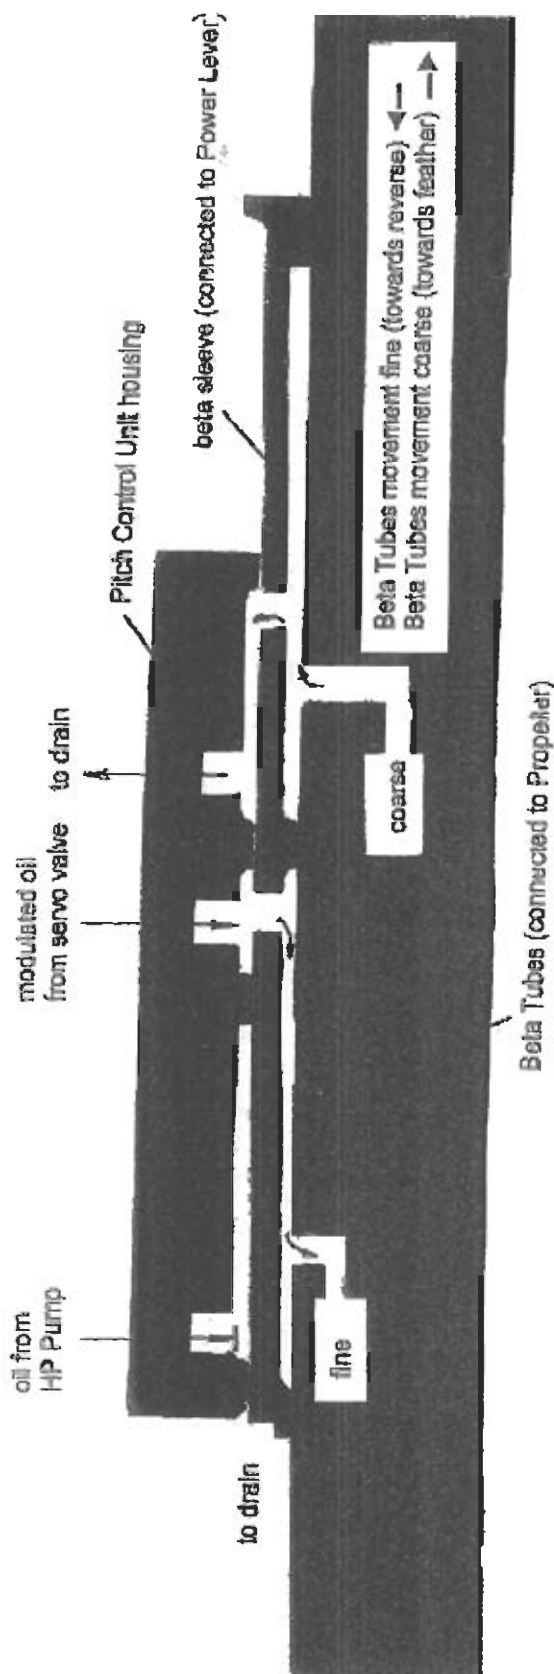


Fig. 1 Power Lever significantly above Flight Idle, high power, beta sleeve in flight position isolating hp oil, propeller constant speeding with modulated oil pressure in fine pitch balancing coarse-seeking counterweight effort, pitch about 30 deg



TAKEN 5 MINUTES AFTER IMPACT

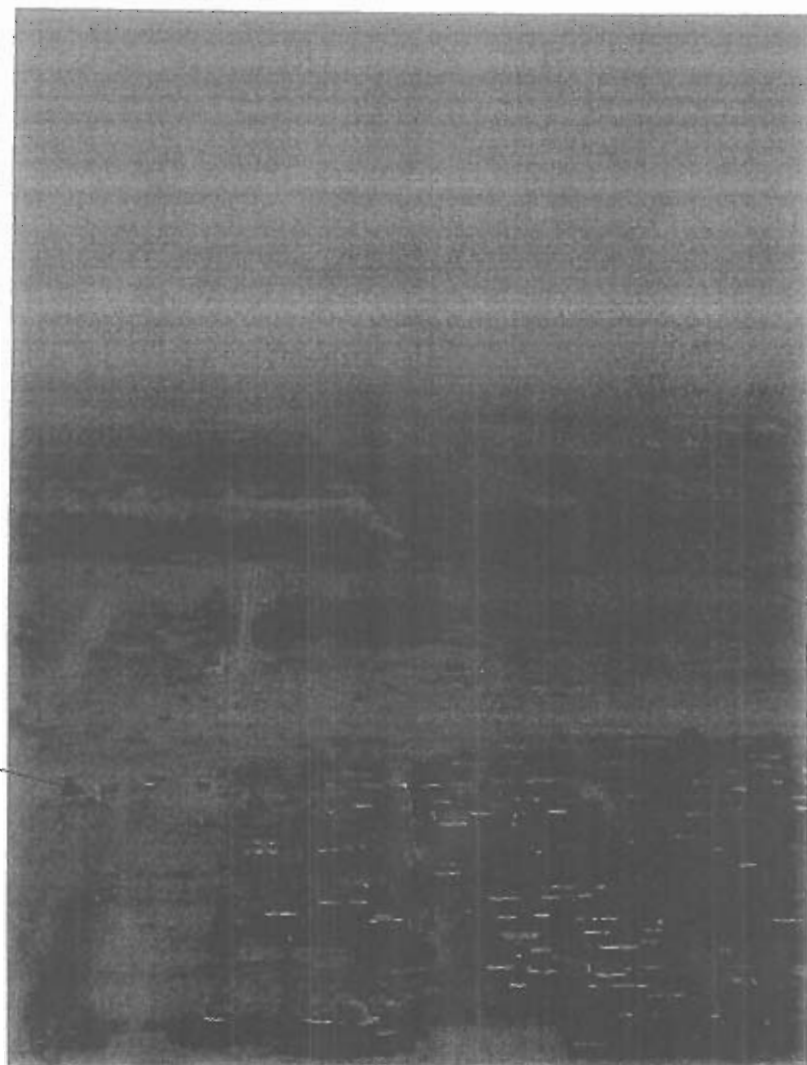

Accident Site

Threshold

Approach

ACCIDENT SITE LOCATION