


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg TDZE 815 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 28L


JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.	MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
Simultaneous approach authorized.		
For inop ALS, increase S-LOC 28L Cat C/D visibility to 1½ SM.		

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

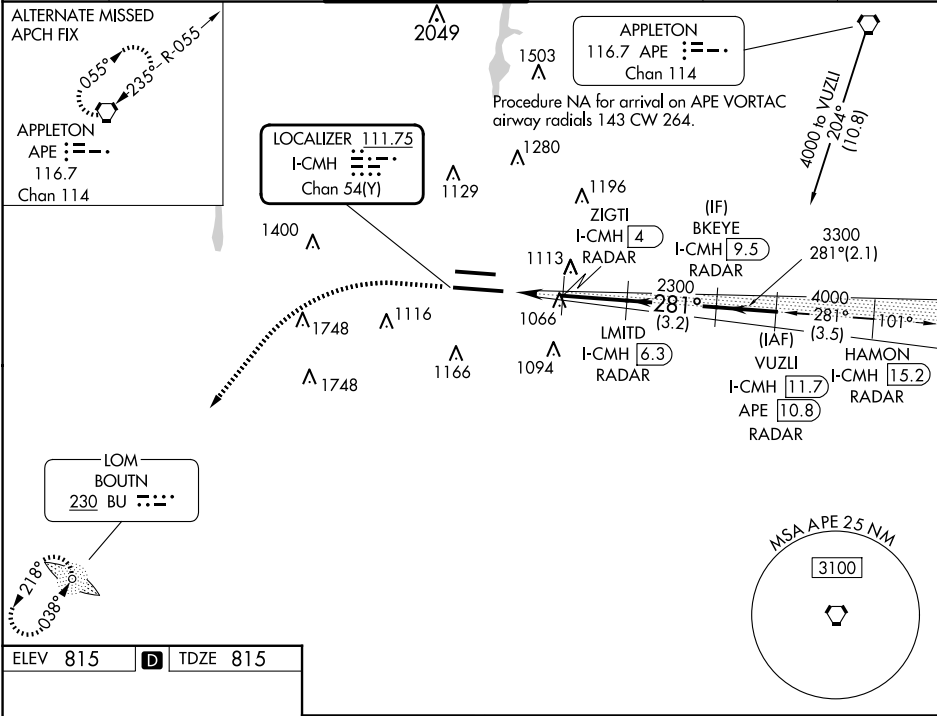

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

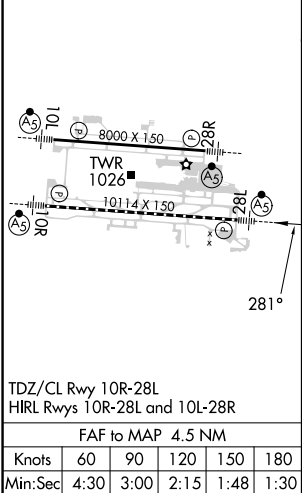

1400 3000 BU VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 68).				
CATEGORY	A	B	C	D
S-ILS 28L	1015/18 200 (200-½)			
S-LOC 28L	1300/24	485 (500-½)	1300/50	485 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2¼ 705 (800-2¼)