


VORTAC MHZ	APP CRS	Rwy Idg	8500
113.2	352°	TDZE	329
Chan 79		Apt Elev	346


When local altimeter setting not received, use Hawkins Fld altimeter setting and increase all MDA 20 feet; increase S-34L Cats C/D/E visibility 1/8 mile.
Circling NA for Cat E southwest of Rwy 16R-34L. Helicopter visibility reduction below 3/4 SM NA.

MALSRR
MISSED APPROACH: Climbing right turn to 3000 on heading 120° and MHZ VORTAC R-134 to RAKIN INT/ MHZ 16.5 DME and hold.

ATIS 121.05	JACKSON APP CON★ 123.9 317.7	JACKSON TOWER★ 120.9 (CTAF) 352.0	GND CON 121.7 348.6	UNICOM 122.95
----------------	---------------------------------	--------------------------------------	------------------------	------------------

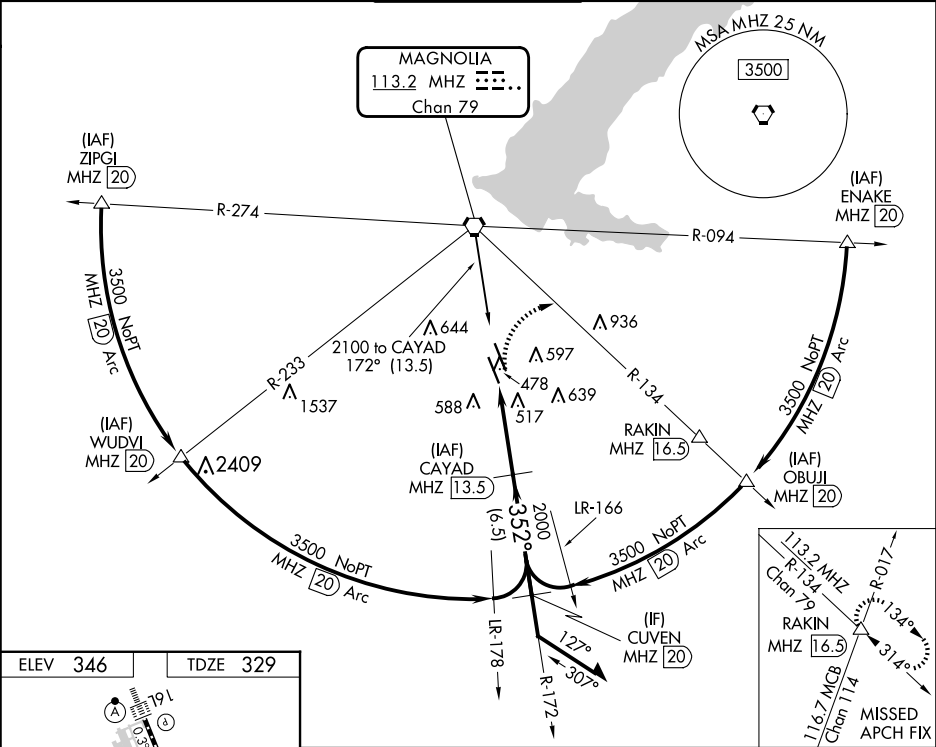

ELEV 346	TDZE 329
----------	----------

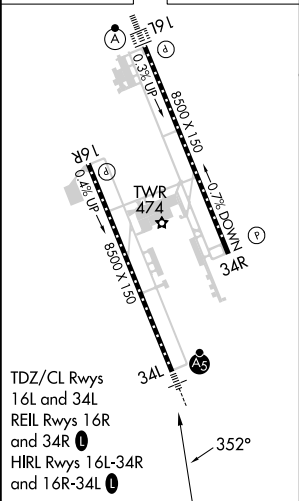

3000	MHZ R-134	RAKIN	△	CAYAD MHZ 13.5	Remain within 15 NM
hdg 120°					
	MHZ 9.9				
	MHZ 8.5				
	1.4	3.6 NM			
CATEGORY	A	B	C	D	E
S-34L	840/55	511 (500-1)	840-1 3/8	511 (500-1 3/8)	
CIRCLING	880-1 534 (600-1)	900-1 554 (600-1)	900-1 1/2 554 (600-1 1/2)	960-2 614 (700-2)	1040-2 1/2 694 (700-2 1/2)