

LOC/DME I-JJC 109.55 Chan 32 (Y)	APP CRS 005°	Rwy Ldg TDZE 595 Apt Elev 629
--	------------------------	---

ILS or LOC RWY 36R
HUNTSVILLE INTL-CARL T JONES FLD (HSV)


RADAR required for procedure entry. DME or RADAR required.

Simultaneous approach authorized. For inop ALS, increase S-ILS 36R Cat E visibility to RVR 4000 and S-LOC 36R Cat C/D/E visibility to 1½ SM; NERTZ Fix minimums: increase S-LOC 36R Cat E visibility to RVR 6000. Circling NA for Cat C/D/E east of Rwy 18L-36R.

MALSR
AS

MISSED APPROACH: Climb to 4000 on heading 005° to intercept RQZ R-234 and right turn to RQZ VORTAC and hold, continue climb-in-hold to 4000. (TACAN aircraft continue climb to 5000 on RQZ VORTAC R-010 to VOYUD/RQZ 6.8 DME and hold north, left turn, 190° inbound, continue climb-in-hold to 5000).

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
-----------------------	--	---	---------------------------------	---------------------------	-------------------------

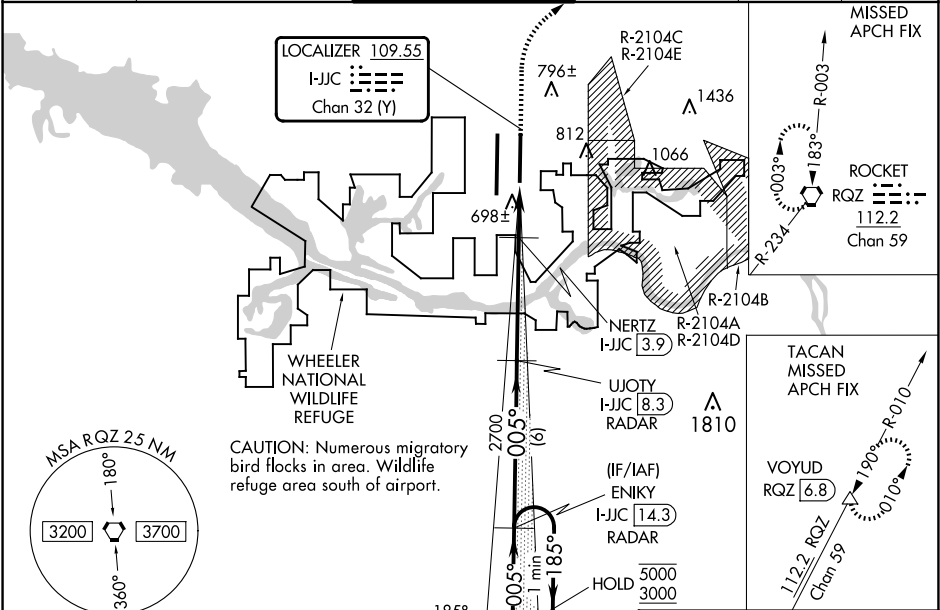

One Minute Holding Pattern		ENIKY I-JJC 14.3 RADAR	UJOTY I-JJC 8.3 RADAR	4000	RQZ R-234	RQZ
5000	185°	005°	005°	hdg 005°		
3000						
GS 3.00° TCH 55		VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).				
		6 NM	4.4 NM	1.1 NM	1 NM	
CATEGORY	A	B	C	D	E	
S-ILS 36R	818/24 223 (200-½)					
S-LOC 36R	1260/24	665 (700-½)	1260-1½ 665 (700-1½)			
CIRCLING	1260-1	631 (700-1)	1260-1¾ 631 (700-1¾)	1260-2 631 (700-2)	1260-2¼ 631 (700-2¼)	
NERTZ FIX MINIMUMS						
S-LOC 36R	980/24	385 (400-½)	980/35 385 (400-¾)			
CIRCLING	1160-1	531 (600-1)	1160-1½ 531 (600-½)	1240-2 611 (700-2)	1260-2¼ 631 (700-2¼)	

ELEV 629 TDZE 595

TDZ/CL Rwy 18R and 36L
HIRL Rwy 18L-36R and 18R-36L

FAC to MAP 6.5 NM

Knots	60	90	120	150	180
Min:Sec	6:30	4:20	3:15	2:36	2:10

SE-4, 22 JAN 2026 to 19 FEB 2026

SE-4, 22 JAN 2026 to 19 FEB 2026