


HI-TACAN Y RWY 28

TACAN NGU Chan 86Y	APCH CRS 290°	Rwy Idg TDZE Arpt Elev 7375 14 15	[USN]	NORFOLK NS (CHAMBERS FLD) (KNGU)
RNAV or RADAR required			MALSF 	MISSED APPROACH: Climb to 2300 on NGU TACAN R-277 then as directed by ATC.
* When ALS inop, increase CAT CDE vis to 1 3/8 miles. ** Circling not authorized S of Rwy 10-28.				
ATIS 118.425 338.225	APP CON 118.9 273.475	CHAMBERS TOWER 124.3 379.15	GND CON 121.8 370.85	ASR/PAR

CAUTION:
Do not mistake Norfolk Intl 5 NM SE for Chambers Fld. Chambers Fld has a single rwy, Norfolk Intl has int runways.


NORFOLK NS HELIPORT 1 NM NW
Use caution in circling approach.

FAC 464 ft from rwy CL
at 3000 ft from thld.

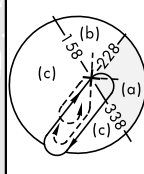

ORF Feeder requires
procedure turn.

CAUTION: Arc segment
enters KNTU class D airspace.

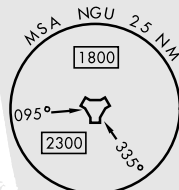

EMERG SAFE ALT 100 NM 6100

