
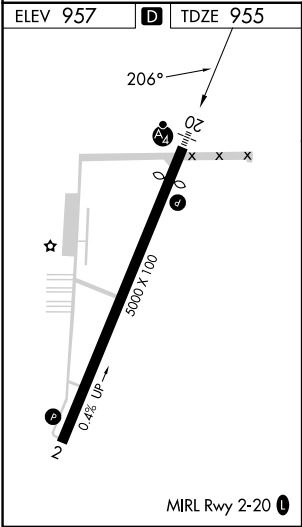


WAAS CH 93601 W20A	APP CRS 206°	Rwy Ldg TDZE 955 Apt Elev 957
--	------------------------	---

RNAV (GPS) RWY 20
DAYTON/WRIGHT BROTHERS (MGY)

RNP APCH: ▼ Inoperative table does not apply. When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase all DAs/MDAs 60 feet and Circling Cat C/D visibility ¼ SM. Rwy 20 helicopter visibility reduction below ¾ SM NA. VDP NA when using James M Cox Dayton Intl altimeter setting. ▲	MALS 	MISSED APPROACH: Climb to 3100 direct SOVVO and hold.
--	----------	--

ASOS 118.375	COLUMBUS APP CON 118.85 269.275	CLNC DEL 119.4	UNICOM 122.8 (CTAF) 0
------------------------	---	--------------------------	---------------------------------

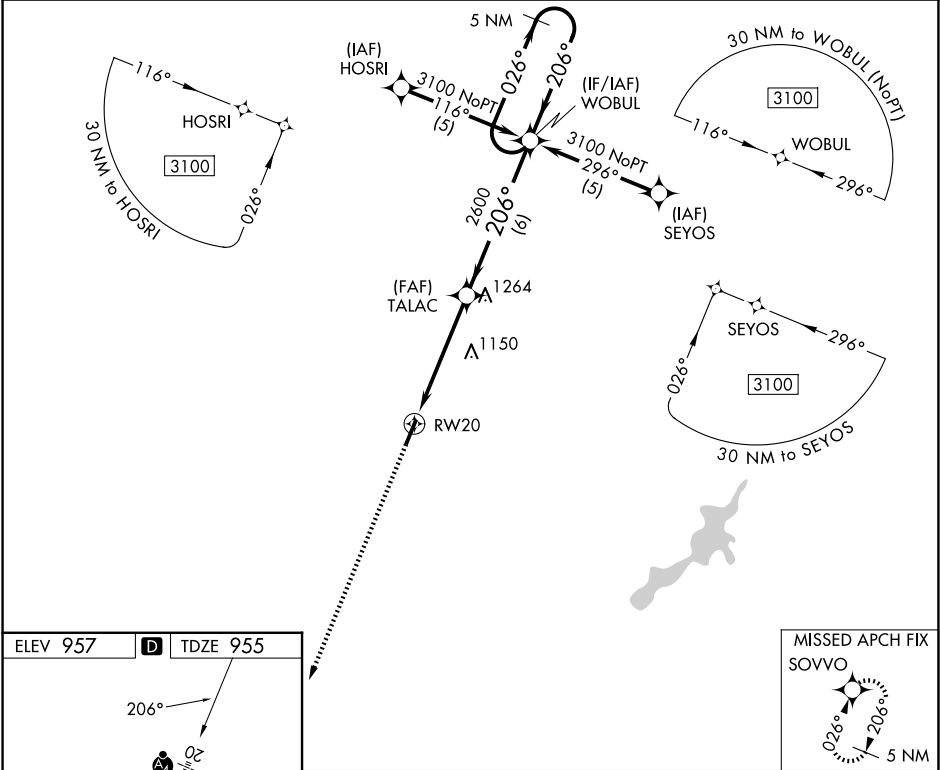

3100

↑

SOVVO

✱

5 NM

Holding Pattern

WOBL

206°

026°

3100

TALAC

206°

2600

* LNAV only.

* 1.4 NM to RW20

RW20

1.4

3.6 NM

6 NM

GP 3.00°

TCH 40°

CATEGORY	A		B	C	D
LPV DA	1294-1¼		339 (400-1¼)		
LNAV MDA	1440-1	485 (500-1)	1440-1¼ 485 (500-1¼)	1440-1½ 485 (500-1½)	
CIRCLING	1480-1¼ 523 (600-1¼)	1520-1¼ 563 (600-1¼)	1660-2 703 (800-2)	1660-2¼ 703 (800-2¼)	