

Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 2103976EDB534FF2AD3DF7B47DBF43F4	APWS Project ID: A6E0164E4F2345ECAAF34BADF050A45E0
Procedure: RNAV (GPS) RWY 27L AMDT 2A		Enroute: NO	Specialist: Martinez, Rafael		Agreement Number:
Airport ID: F45			Airport City: WEST PALM BEACH		State: FL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: UPDATE BARO VNAV & RASS NOTE TO ADDRESS AIRPORT NAME (ID) CHANGE FROM PALM BEACH INTL (PBI) TO PRESIDENT DONALD J TRUMP INTL (DJT). PENDING DATA USED FOR KDJT AIRPORT (07-09-2026). ACTIVE DATA USED FOR KF45 AIRPORT (07-18-2019). CONTACT: BEV L BORDY, AJV-A420, 405-954-8293/TARA MARTINELLI, AJV-A421, 405-954-7931. Digitally signed by TARA N MARTINELLI Jun 26, 2026 QUALITY 9 CHECKED BEGUE QUALITY 16 CHECKED					

WAAS CH 93910 W27A	APP CRS 272°	Rwy Ldg 4300 TDZE 22 Apt Elev 22
--	------------------------	---



RNAV (GPS) RWY 27L
NORTH PALM BEACH COUNTY GENERAL AVIATION (F45)

NA

Circling NA to Rwy 9L and 27R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -1.5°C (5°F) or above 54°C (130°F). Baro-VNAV and VDP NA when using Palm Beach Init altimeter setting. DME/DME RNP-0.3 NA. When local altimeter not received, use Palm Beach Init altimeter setting and increase LPV DA to 369 feet and all visibilities 1/8 SM; increase LNAV/VNAV DA to 423 feet and all visibilities 1/8 SM; increase all MDA 40 feet and Cat C/D visibility 1/8 SM. Rwy 27L helicopter visibility reduction below 3/4 SM NA.

MISSED APPROACH:
Climb to 2500 direct YIGBO and hold.

AWOS-3 119.975	PALM BEACH APP CON 128.3 317.4	UNICOM 123.075 (CTAF) 0
--------------------------	--	-----------------------------------

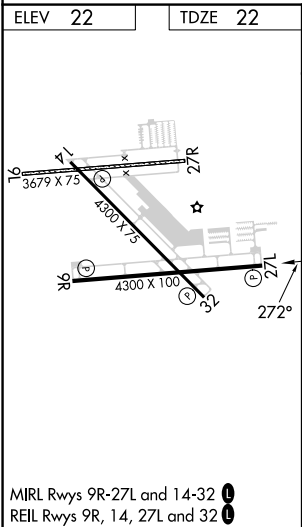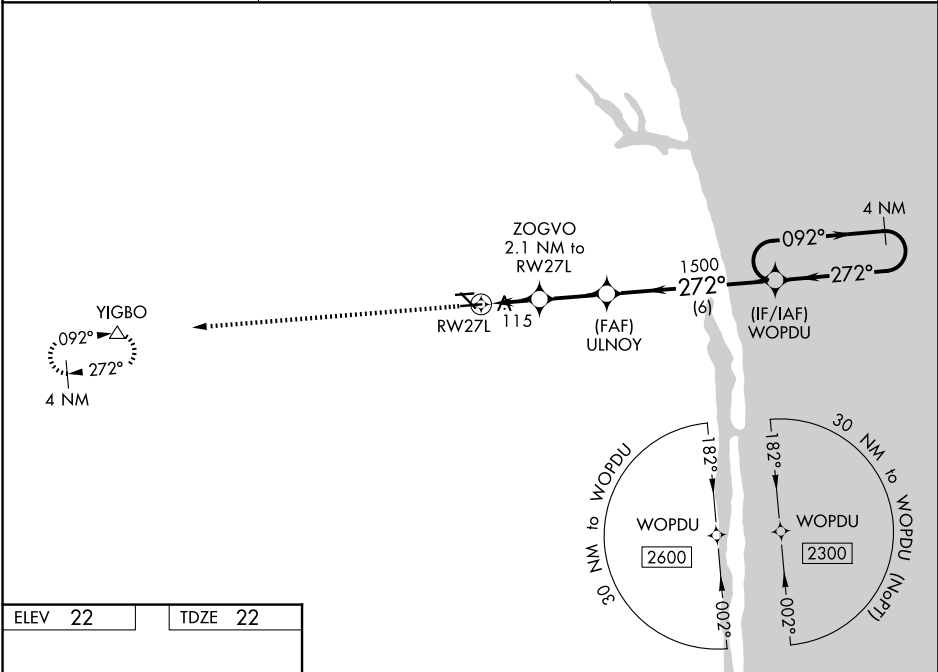

ELEV 22	TDZE 22
MIRL Rwy 9R-27L and 14-32 REIL Rwy 9R, 14, 27L and 32	
WEST PALM BEACH, FLORIDA Amdt 2 01FEB18	
NORTH PALM BEACH COUNTY GENERAL AVIATION (F45) 26°51'N-80°13'W	
RNAV (GPS) RWY 27L	