

Flight Procedures Cover Page	Task Action: Abbreviated Amendment	Task Type: STAR	Estimated Chart Date: 11/27/2025	APWS Task ID: 3DD77F9ABF3842179206B35B78C1FFA9	APWS Project ID: DA362AB0A3EB4AB3A27C5410CF3C9FB5
Procedure: STAR SITTH THREE (RNAV) ATLANTA GA KATL		Enroute: YES	Specialist: Copeland, Guy		Agreement Number:
Airport ID: KATL		Airport City: ATLANTA			State: GA
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION VALIDATION. CONTACT: ROBERT HAMILTON, AJV-A433, 405-954-4608 07/08/2025 QUALITY 14 CHECKED QUALITY 38 CHECKED					

(SITTH.SITTH2) 18032


SITTH TWO ARRIVAL(RNAV)

AL-26 (FAA)

HARTSFIELD-JACKSON ATLANTA INTL (ATL)

ATLANTA, GEORGIA

SE-4, 01 FEB 2018 to 01 MAR 2018

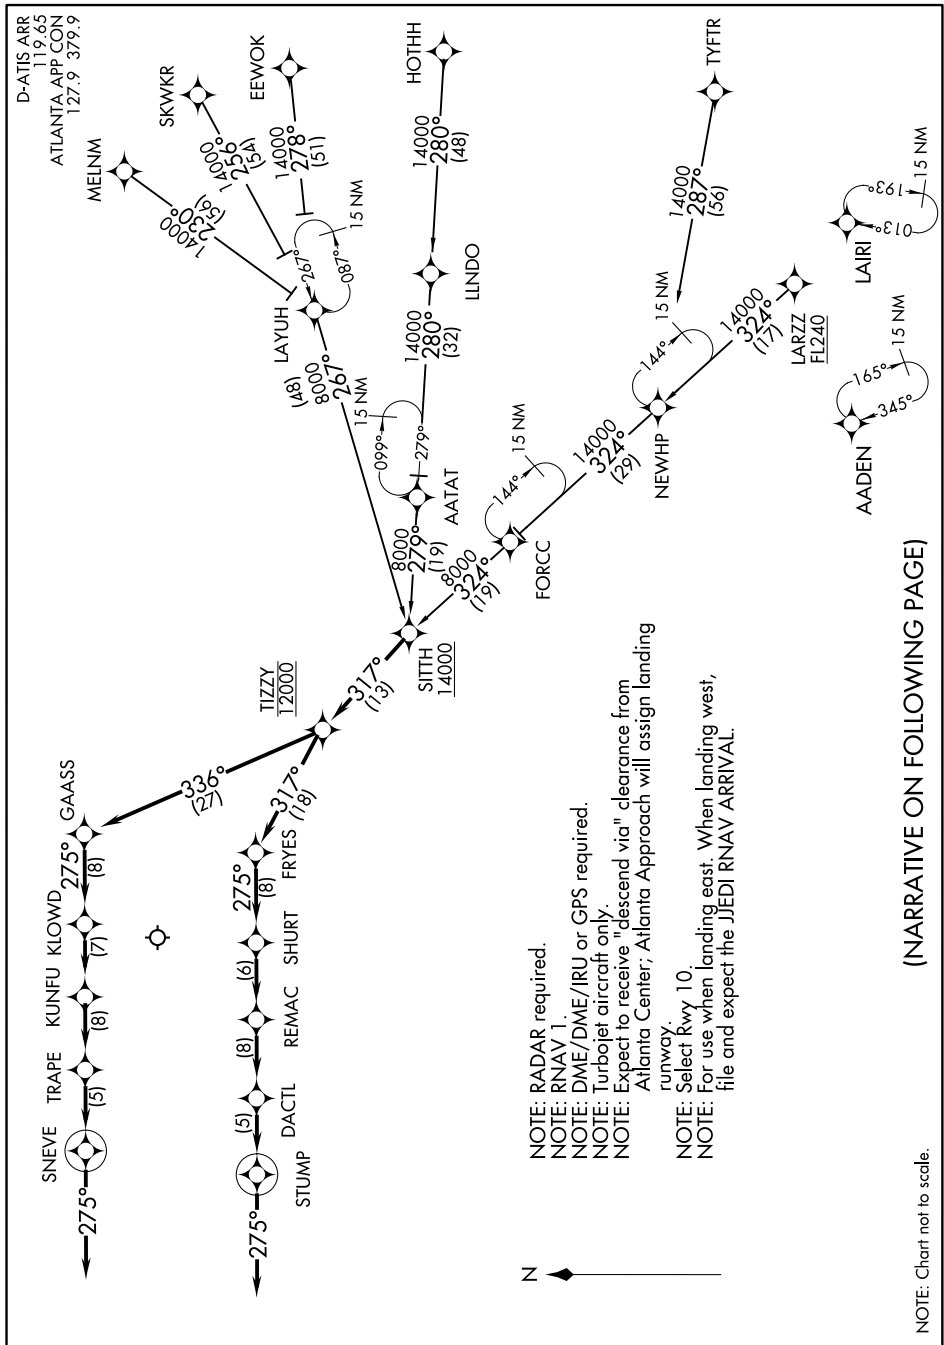

(NARRATIVE ON FOLLOWING PAGE)

NOTE: Chart not to scale.

SITTH TWO ARRIVAL(RNAV)

(SITTH.SITTH2) 01FEB18

ATLANTA, GEORGIA

HARTSFIELD-JACKSON ATLANTA INTL (ATL)

ARRIVAL ROUTE DESCRIPTION

EEWOK TRANSITION (EEWOK.SITTH2)

HOTHH TRANSITION (HOTHH.SITTH2)

LARZZ TRANSITION (LARZZ.SITTH2)

LAYUH TRANSITION (LAYUH.SITTH2)

MELNM TRANSITION (MELNM.SITTH2): Assigned by ATC only.

SKWKR TRANSITION (SKWKR.SITTH2)

TYFTR TRANSITION (TYFTR.SITTH2)

From SITTH on track 317° to cross TIZZY at 12000.

LANDING RWYS 8L/R: From TIZZY on track 336° to GAASS, then on track 275° to KLOWD, then on track 275° to KUNFU, then on track 275° to TRAPE, then on track 275° to SNEVE, then on track 275°. Expect RADAR vectors to final approach course.

LANDING RWYS 9L/R, 10: From TIZZY on track 317° to FRYES, then on track 275° to SHURT, then on track 275° to REMAC, then on track 275° to DACTL, then on track 275° to STUMP, then on track 275°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS

ASSIGNED RWY 10 OR RWY NOT ASSIGNED: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct DEWHY and proceed on the ILS or RNAV Rwy 10 approach.

ASSIGNED RWY 9L: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct RYENN and proceed on the ILS or RNAV Rwy 9L approach.

ASSIGNED RWY 9R: Cross SITTH at or above 14000; cross TIZZY at 12000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct ANDIY and proceed on the ILS or RNAV Rwy 9R approach.

ASSIGNED RWY 8L: Cross SITTH at or above 14000; cross TIZZY at 12000; cross GAASS at 12000, cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct LARII and proceed on the ILS or RNAV Rwy 8L approach.

ASSIGNED RWY 8R: Cross SITTH at or above 14000; cross TIZZY at 12000; cross GAASS at 12000, cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct GPEAT and proceed on the ILS or RNAV Rwy 8R approach.