


Flight Procedures Cover Page	Task Action: Abbreviated Amendment	Task Type: STAR	Estimated Chart Date: 11/27/2025	APWS Task ID: 9B3357A542F3450A8F8FF93DF504DE0C	APWS Project ID: DA362AB0A3EB4AB3A27C5410CF3C9FB5
Procedure: STAR JJEDI FOUR (RNAV) ATLANTA GA KATL		Enroute: YES	Specialist: Copeland, Guy		Agreement Number:
Airport ID: KATL			Airport City: ATLANTA		State: GA
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION VALIDATION. CONTACT: ROBERT HAMILTON, AJV-A433, 405-954-4608 07/08/2025 QUALITY 14 CHECKED QUALITY 38 CHECKED					

D-ATIS ARR
119.65
ATLANTA APP CON
127.9 379.9



RNAV 1 - DME/DME/IRU or GPS.
RADAR required.

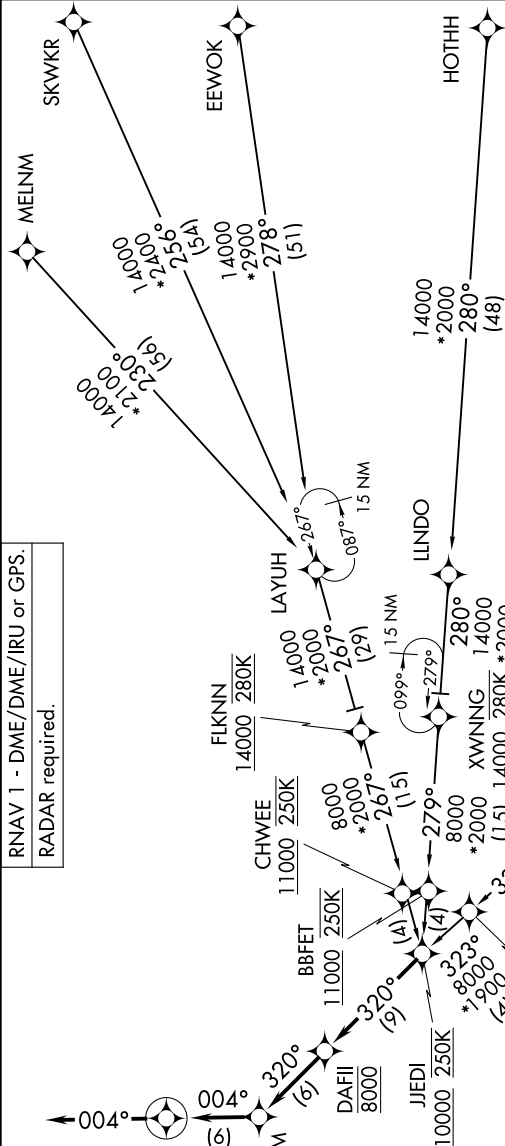

NOTE: Turbojet aircraft only.
NOTE: Expect to receive "descend via" clearance from Atlanta Center; Atlanta Approach will assign landing runway.
NOTE: Select Rwy 28.
NOTE: For use when landing west. When landing east, file and expect the SITHH ARRIVAL (RNAV).

NOTE: Chart not to scale.

ARRIVAL ROUTE DESCRIPTION

EEWOK TRANSITION (EEWOK.JJEDI3)
HOTHH TRANSITION (HOTHH.JJEDI3)
LARZZ TRANSITION (LARZZ.JJEDI3)
LAYUH TRANSITION (LAYUH.JJEDI3)
MELNM TRANSITION (MELNM.JJEDI3): Assigned by ATC only.
SKWKR TRANSITION (SKWKR.JJEDI3)
TYFTR TRANSITION (TYFTR.JJEDI3)

From JJEDI on track 320° to cross DAFII at 8000, then on track 320° to GRHAM, then on track 004° to POOBA, then on track 004°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS:

ASSIGNED RUNWAY 28 OR RUNWAY NOT ASSIGNED: Cross JJEDI at or above 10000; cross DAFII at 8000; cross POOBA at 5000; after POOBA descend to 3000 and proceed direct PRMAN; proceed on the ILS or RNAV RWY 28 approach.

ASSIGNED RUNWAY 27L: Cross JJEDI at or above 10000; cross DAFII at 8000; cross POOBA at 6000; after POOBA proceed direct SLVAA and proceed on the ILS or RNAV RWY 27L approach.

ASSIGNED RUNWAY 27R: Cross JJEDI at or above 10000; cross DAFII at 8000; cross POOBA at 6000; after POOBA proceed direct YOUYU and proceed on the ILS or RNAV RWY 27R approach.

ASSIGNED RUNWAY 26L: Cross JJEDI at or above 10000; cross DAFII at 8000; cross POOBA at 6000; after POOBA proceed direct JIRRI and proceed on the ILS or RNAV RWY 26L approach.

ASSIGNED RUNWAY 26R: Cross JJEDI at or above 10000; cross DAFII at 8000; cross POOBA at 6000; after POOBA proceed direct ZELOW and proceed on the ILS or RNAV RWY 26R approach.