MIRAMAR MCAS (JOE FOSS FLD) (KNKX)

LAKEE-THREE DEPARTURE (LAKEE3 • LAKEE)

SAN DIEGO, CALIFORNIA

ATIS ★ 133.475 352.0
CLNC DEL
125.975 254.325
GND CON
128.625 307.325
FOSS TOWER ★
135.2 298.925
SOCAL DEP CON
132.2 269.1 E

AL-903 [USN]

Rwy	Knots	60	120	180	240	300	360
* 24L/R ⓐ	V/V(fpm)	260	520	780	1040	1300	1560
** 24L/R ⓑ	V/V(fpm)	280	560	840	1120	1400	1680
† 24L/R ⓒ	V/V(fpm)	678	1356	2034	2712	3390	4068
† 24L/R ⓓ	V/V(fpm)	235	470	705	940	1175	1410

* Military Minimum ** Civil Minimum † ATC Climb Rate
ⓐ to 3600 ⓒ to 7000
ⓑ to 3800 ⓓ 7500 to 11,000

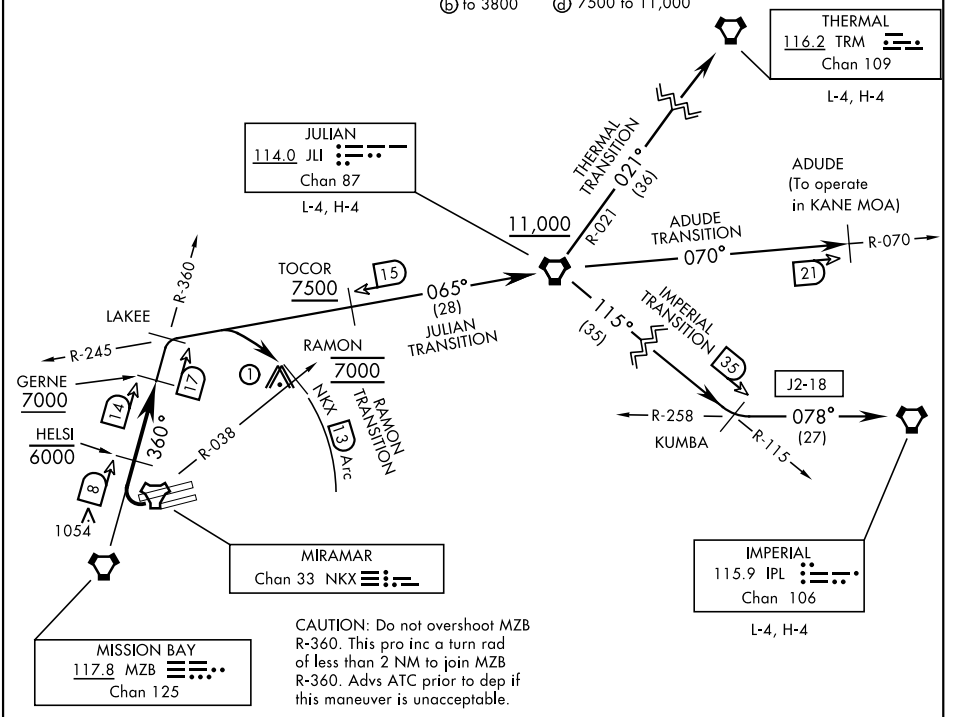

CAUTION: Do not overshoot MZB R-360. This pro inc a turn rad of less than 2 NM to join MZB R-360. Advs ATC prior to dep if this maneuver is unacceptable.

① 3018' Twr 12.5 NM from DER.

EMERG SAFE ALT 100 NM 13,600

DEPARTURE ROUTE DESCRIPTION

TAKEOFF RWY 24L/R: Turn right to intercept and proceed via MZB VORTAC R-360 to LAKEE INT. Cross HELSI at or below 6000. Cross GERNE at or above 7000. Thence...

ADUDE TRANSITION (LAKEE3·ADUDE): Via JLI VORTAC R-245 to JLI. Then via JLI R-070 to ADUDE. Cross TOCOR at or above 7500. Cross JLI VORTAC at or above 11,000. (To operate in KANE MOA.)

IMPERIAL TRANSITION (LAKEE3·IPL): Via JLI VORTAC R-245 to JLI. Then via JLI R-115 to KUMBA INT, then via IPL VORTAC R-258 to IPL. Cross TOCOR at or above 7500. Cross JLI VORTAC at or above 11,000.

(Continued on next page)

SW-3, 17 APR 2025 to 15 MAY 2025