| APP CRS | Rwy ldg | 8000 |
|---|---|---|
| 281° | TDZE | 813 |
| | Apt Elev | 815 |

# RNAV (RNP) Z RWY 28R
## JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.

For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.16 all Cats visibility to RVR 4500 and increase RNP 0.30 all Cats visibility to RVR 5500. Simultaneous approach authorized.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 to APE VORTAC and hold.

| D-ATIS | COLUMBUS APP CON | COLUMBUS TOWER | GND CON | CLNC DEL | CPDLC |
|---|---|---|---|---|---|
| 124.6 | 125.95 371.975 | 132.7 257.8 | 121.9 348.6 | 126.3 | |

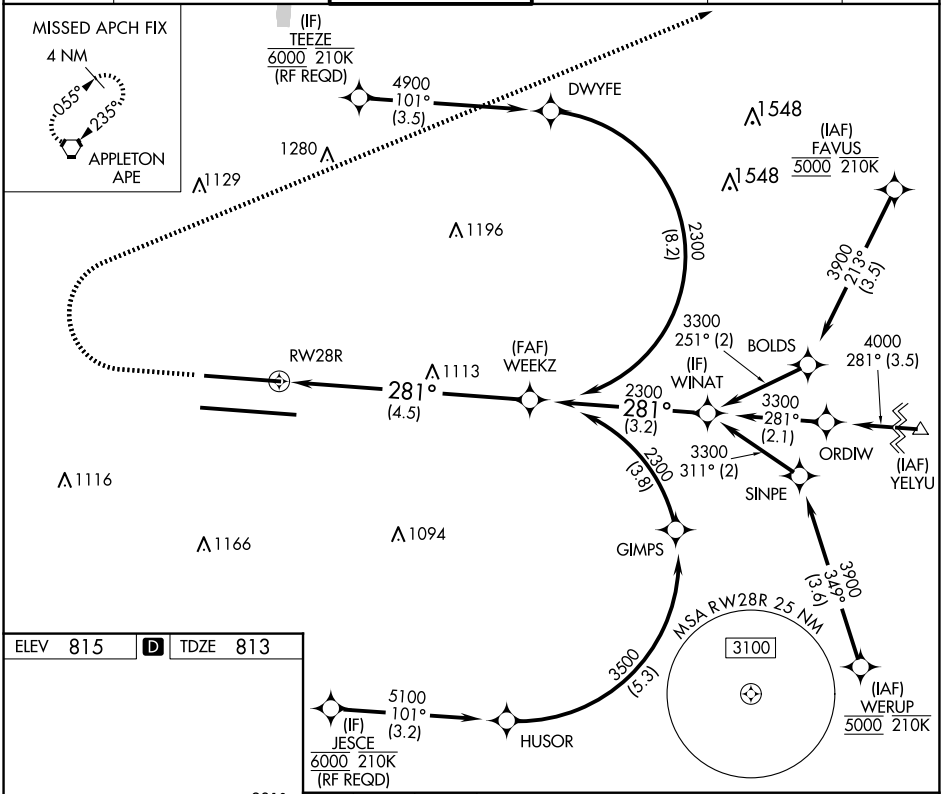


ELEV 815 | D | TDZE 813

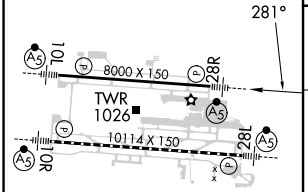


| 1400 | 3000 | APE |
|---|---|---|
| | | |

See planview for multiple IF locations.

| CATEGORY | A | B | C | D |
|---|---|---|---|---|
| RNP 0.16 DA | 1129/24 316 (400-½) | | | |
| RNP 0.30 DA | 1185/35 372 (400-⅝) | | | |

TDZ/CL Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

**AUTHORIZATION REQUIRED**

EC-2, 12 JUN 2025 to 10 JUL 2025

EC-2, 12 JUN 2025 to 10 JUL 2025