LOC/DME I-CMH	APP CRS	Rwy Ldg 10114
111.75	281°	TDZE 815
Chan 54 (Y)		Apt Elev 815

ILS RWY 28L (SA CAT I & II)
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.

Simultaneous approach authorized.
SA CAT I, SA CAT II: Requires specific OPSPEC, MSPEC, or LOA approval.

MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

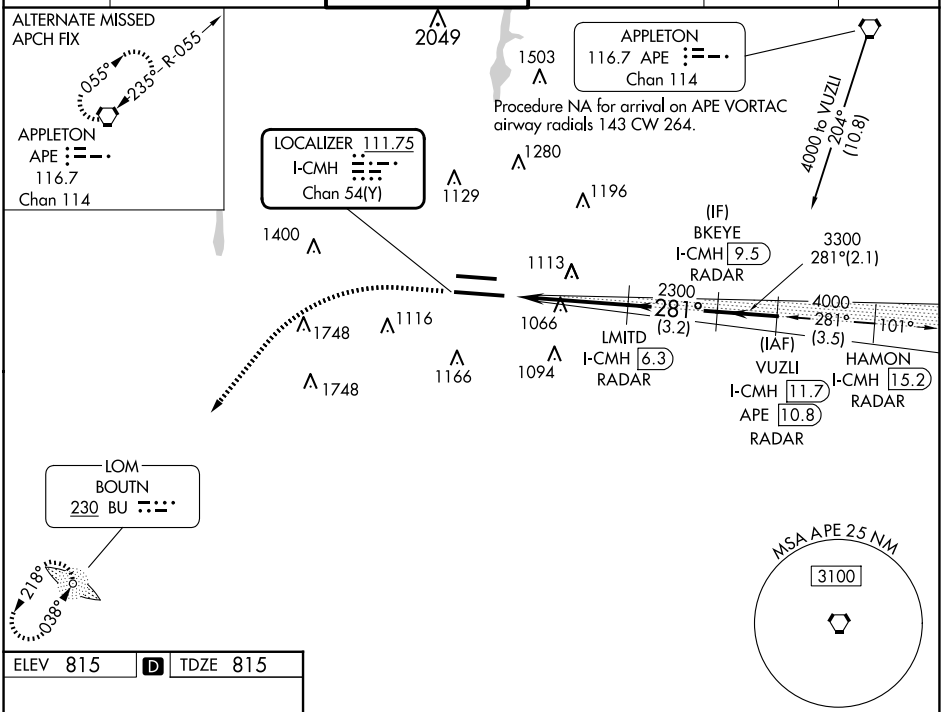

ELEV 815	D	TDZE 815

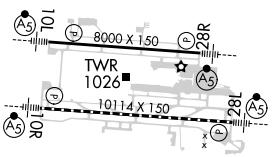

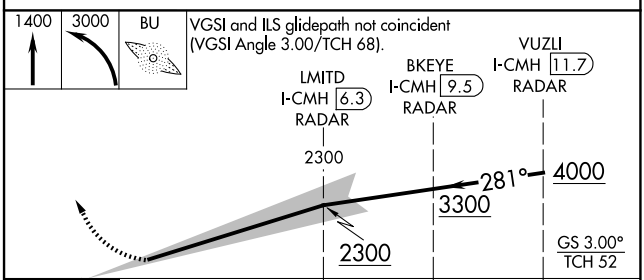

CATEGORY	A	B	C	D
S-ILS 28L	SA CAT I RA 157/14 150 DA 965			
S-ILS 28L	SA CAT II RA 100/12 100 DA 915			

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

EC-2, 04 SEP 2025 to 02 OCT 2025

EC-2, 04 SEP 2025 to 02 OCT 2025