APP CRS	Rwy ldg	8000
281°	TDZE	813
	Apt Elev	815

RNAV (RNP) Z RWY 28R
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.

For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.16 all Cats visibility to RVR 4500 and increase RNP 0.30 all Cats visibility to RVR 5500. Simultaneous approach authorized.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 to APE VORTAC and hold.

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

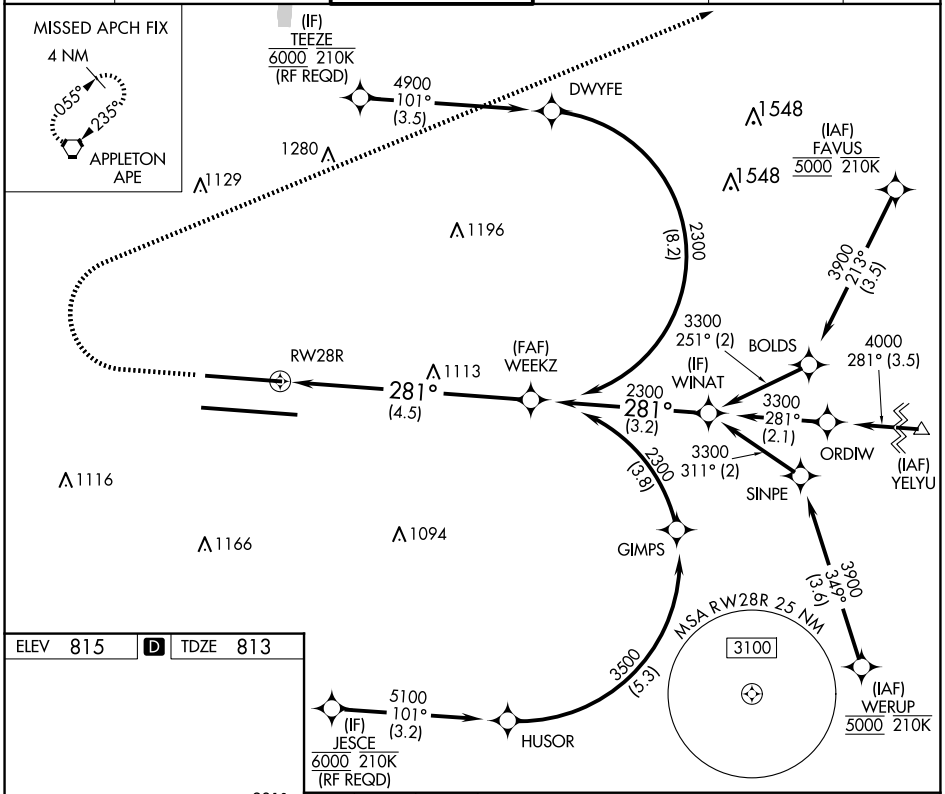

ELEV 815 | D | TDZE 813

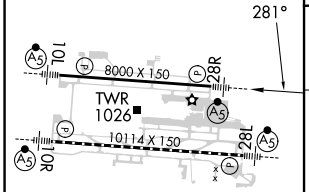

1400	3000	APE

See planview for multiple IF locations.

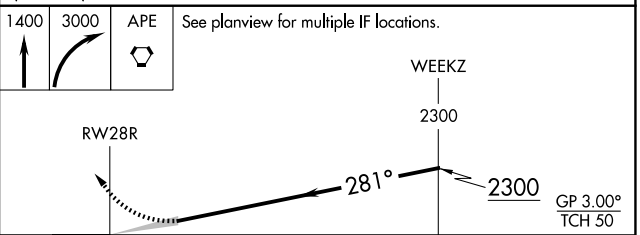

CATEGORY	A	B	C	D
RNP 0.16 DA	1129/24 316 (400-½)			
RNP 0.30 DA	1185/35 372 (400-⅝)			

AUTHORIZATION REQUIRED

TDZ/CL Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

EC-2, 04 SEP 2025 to 02 OCT 2025

EC-2, 04 SEP 2025 to 02 OCT 2025