LOC/DME I-AQI	APP CRS	Rwy Ldg 10114
111.75	101°	TDZE 809
Chan 54 (Y)		Apt Elev 815

ILS or LOC RWY 10R
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.

Simultaneous approach authorized.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON
124.6	125.95 371.975	132.7 257.8	121.9 348.6

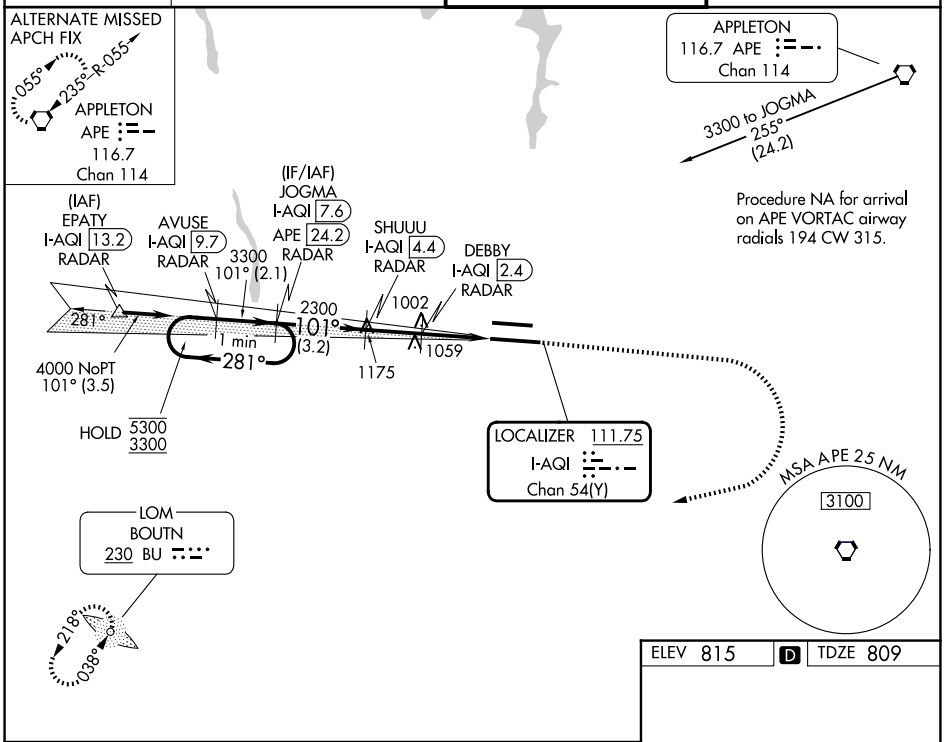

ELEV 815 D TDZE 809

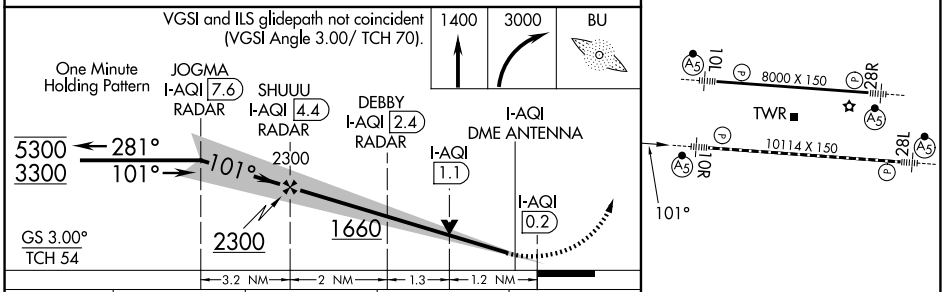

CATEGORY	A	B	C	D
S-ILS 10R	1009/18		200 (200-½)	
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-⅞)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2¼ 705 (800-2¼)

TDZL/RCLS Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

EC-2, 25 DEC 2025 to 22 JAN 2026

EC-2, 25 DEC 2025 to 22 JAN 2026