DAYTON, OHIO

TACAN RWY 5L

TACAN	APCH CRS	Rwy Idg	TDZE	Arpt Elev
FFO Chan 29	059°	12,600	803	823

[USAF]

WRIGHT-PATTERSON AFB (KFFO)

▼ * When ALS inop, increase RVR CAT AB to 55 and vis to 1 mile, CAT CDE vis to 1¾ miles.
** When Rwy 23R VGSI inop, circling to Rwy 23R NA at night.

ALSF-1 (A1)

† MISSED APPROACH: Climb to 2000 via FFO R-058 to 5 DME, turn right direct CLACK climbing to 3100 and hold.

ATIS	COLUMBUS APP CON	PATTERSON TOWER	GND CON
124.475 269.9	118.85 269.275	127.8 281.45	121.8 335.8

† Missed approach requires use of RNAV or ATC radar monitoring.

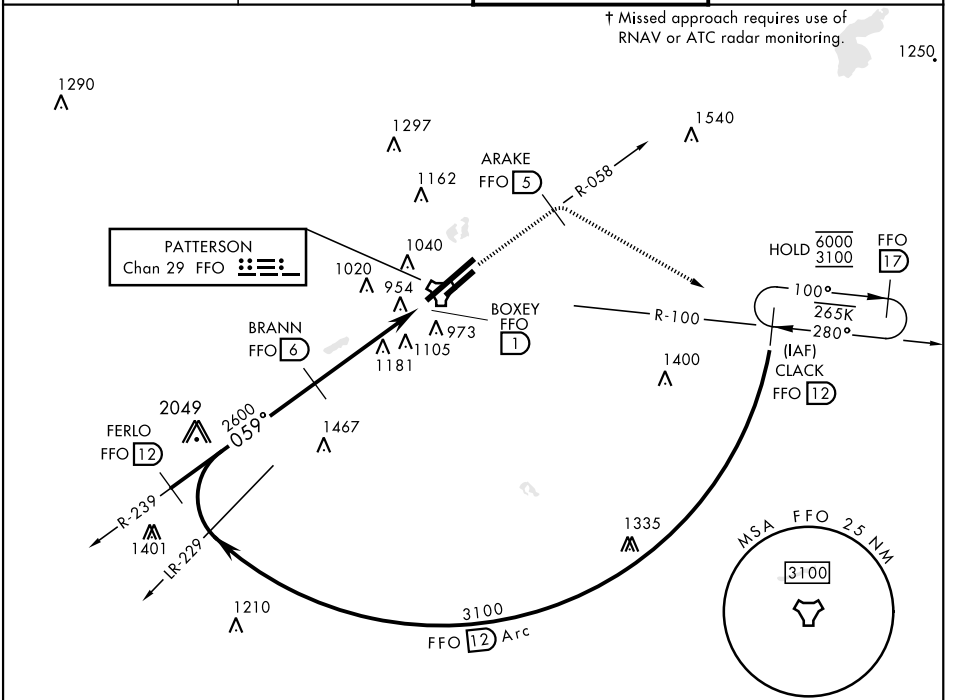

EMERG SAFE ALT 100 NM 3700

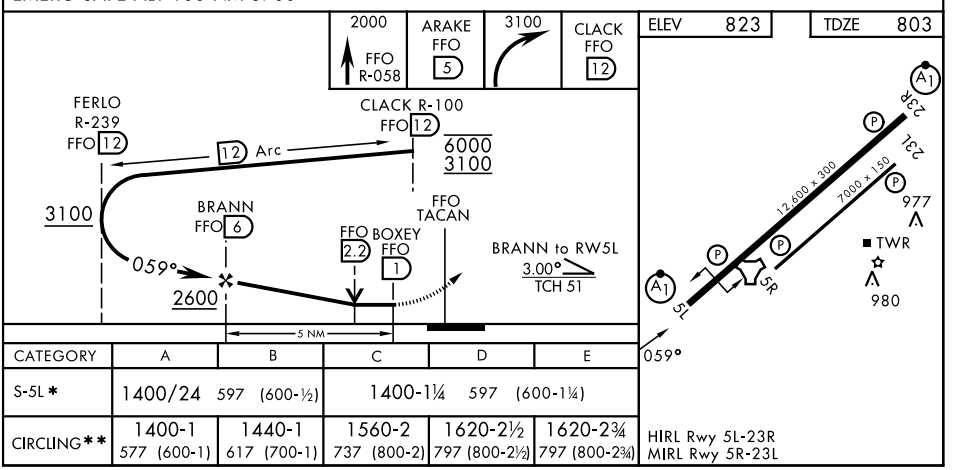

CATEGORY	A	B	C	D	E
S-5L *	1400/24 597 (600-½)		1400-1¼ 597 (600-1¼)		
CIRCLING**	1400-1 577 (600-1)	1440-1 617 (700-1)	1560-2 737 (800-2)	1620-2½ 797 (800-2½)	1620-2¾ 797 (800-2¾)

HIRL Rwy 5L-23R
MIRL Rwy 5R-23L

DAYTON, OHIO
Amdt 7 05JAN17

39° 50′N-84° 03′W

WRIGHT-PATTERSON AFB (KFFO)

TACAN RWY 5L

EC-2, 11 JUN 2026 to 09 JUL 2026
EC-2, 11 JUN 2026 to 09 JUL 2026