CLOVIS, NEW MEXICO

TACAN RWY 31

CANNON AFB (KCVS)

TACAN CVS Chan 53	APCH CRS 316°	Rwy ldg 8194 TDZE 4270 Arpt Elev 4295

(USAF)

Missed approach requires use of RNAV or ATC radar monitoring.

* When ALS inop, increase CAT AB vis to 1 mile, CAT CDE increase vis to 1 3/8 miles.

MALSR (A5)

MISSED APPROACH: Climb to 6000 out CVS TACAN R-306 to 5.5 DME (LERAY) then turn left climbing to 7000 intercept CVS TACAN R-193 to 12 DME (CLINK) and hold.

ATIS	CANNON APP CON	TOWER	GND CON
119.1 269.9	118.425 352.1	120.4 270.25	121.9 275.8

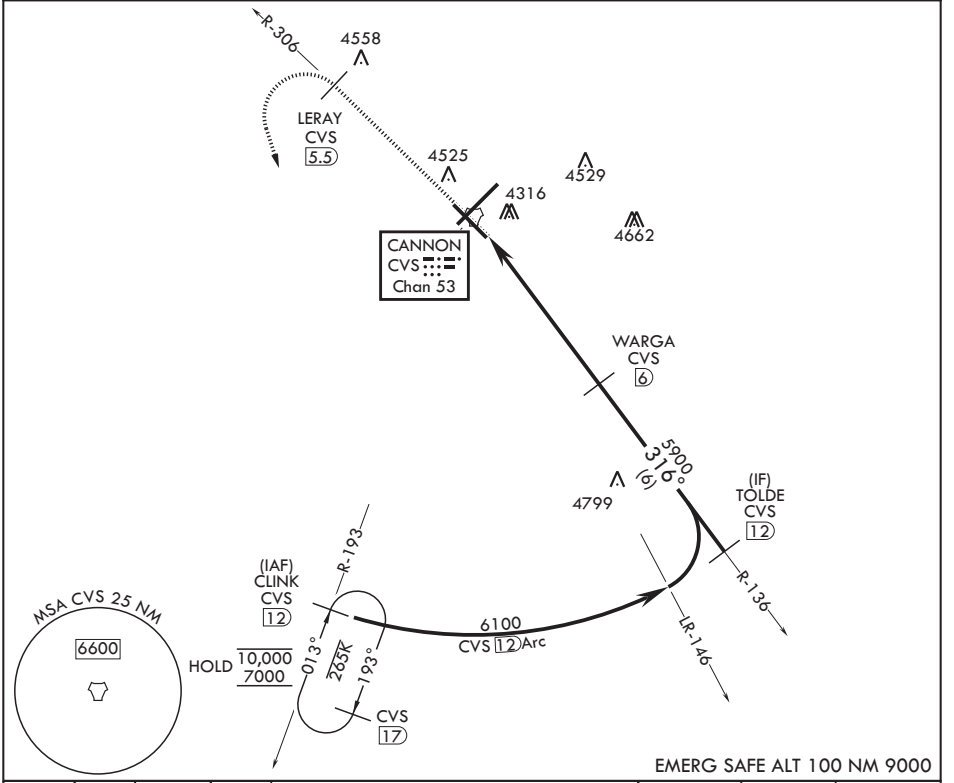

6000 CVS R-306	LERAY CVS 5.5	7000 CVS R-193	CLINK CVS 12

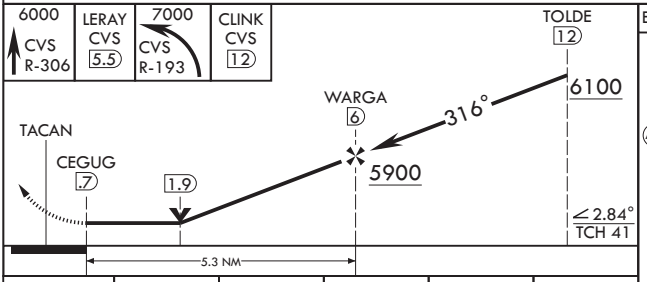

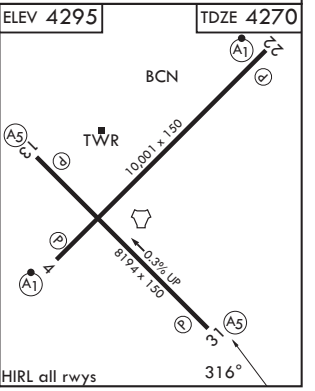

CATEGORY	A	B	C	D	E
S-31*	4700-½	430 (500-½)	4700-¾	430	(500-¾)
CIRCLING	4840-1	545 (600-1)	4860-1½ 565 (600-1½)	5000-2¼ 705 (800-2¼)	5020-2½ 725 (800-2½)

CLOVIS, NEW MEXICO

Amdt 3 10OCT19

34°23'N - 103°19'W

CANNON AFB (KCVS)

TACAN RWY 31

SW-1, 03 SEP 2026 to 01 OCT 2026

SW-1, 03 SEP 2026 to 01 OCT 2026