CLOVIS, NEW MEXICO

TACAN RWY 4

TACAN CVS Chan **53**	APCH CRS **048°**	Rwy ldg **10,001** TDZE **4284** Arpt Elev **4295**

(USAF)

CANNON AFB (KCVS)

Missed approach requires use of RNAV or ATC radar monitoring.

* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 60, vis to 1 1/8 miles.

ALSF-1 (A1)

MISSED APPROACH: Climb to 6000 via CVS TACAN R-036 to 5.1 DME (FETEP), cross FETEP at or below 6000, then turn left climbing to 7000 to intercept CVS TACAN R-003 to 12 DME (HEDOB) and hold,.

ATIS	CANNON APP CON	TOWER	GND CON
119.1 269.9	**118.425 352.1**	**120.4 270.25**	**121.9 275.8**

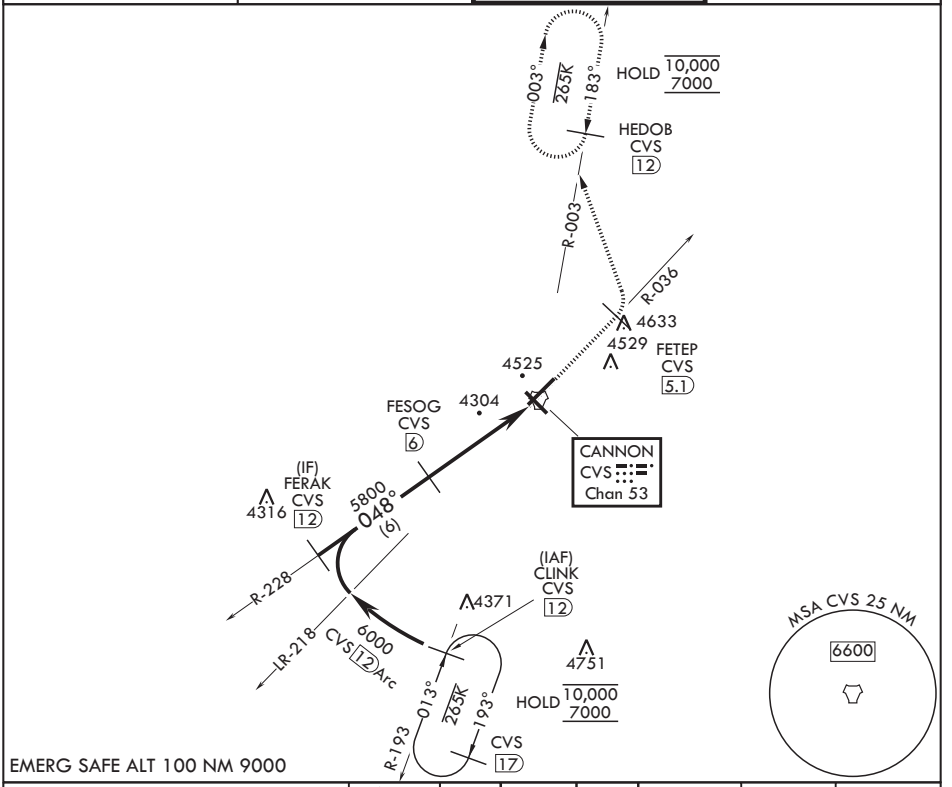

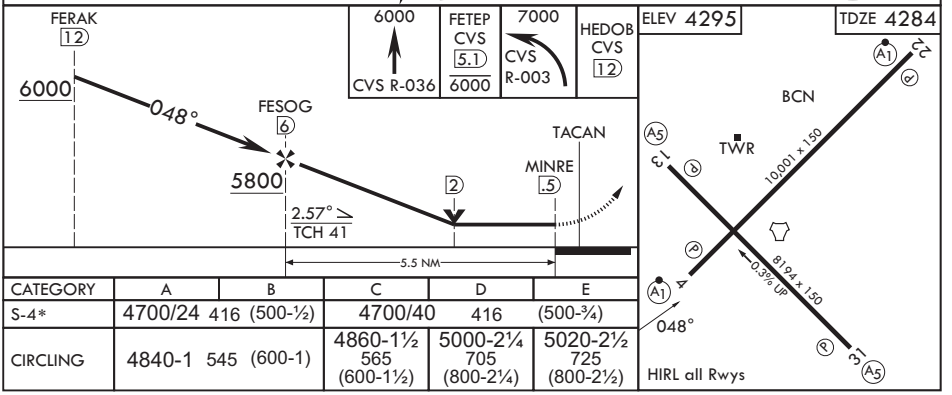

CATEGORY	A	B	C	D	E
S-4*	4700/24	416 (500-½)	4700/40	416	(500-¾)
CIRCLING	4840-1	545 (600-1)	4860-1½ 565 (600-1½)	5000-2¼ 705 (800-2¼)	5020-2½ 725 (800-2½)

CLOVIS, NEW MEXICO

Amdt 3 10OCT19

34°23'N - 103°19'W

CANNON AFB (KCVS)

TACAN RWY 4

SW-1, 03 SEP 2026 to 01 OCT 2026