
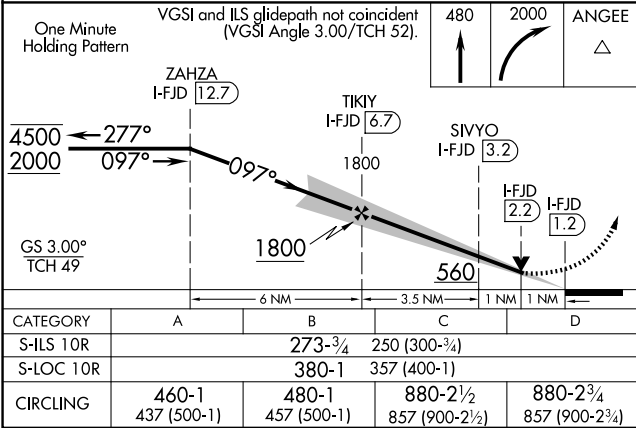


LOC/DME I-FJD	APP CRS	Rwy Ldg	6483
110.55	097°	TDZE	23
Chan 42(Y)		Apt Elev	23

ILS or LOC RWY 10R
TREASURE COAST INTL (FPR)

RNP APCH - GPS.	MISSED APPROACH: Climb to 480 then climbing right turn to 2000 direct ANGEЕ and hold.
DME required.	
Autopilot coupled approach NA below 720 MSL. Circling Rwy 10L/28R NA at night.	

ATIS 134.825	PALM BEACH APP CON 132.8	FORT PIERCE TOWER ★ 128.2 (CTAF) 0	GND CON (GCO) 119.55
-----------------	-----------------------------	---------------------------------------	-------------------------

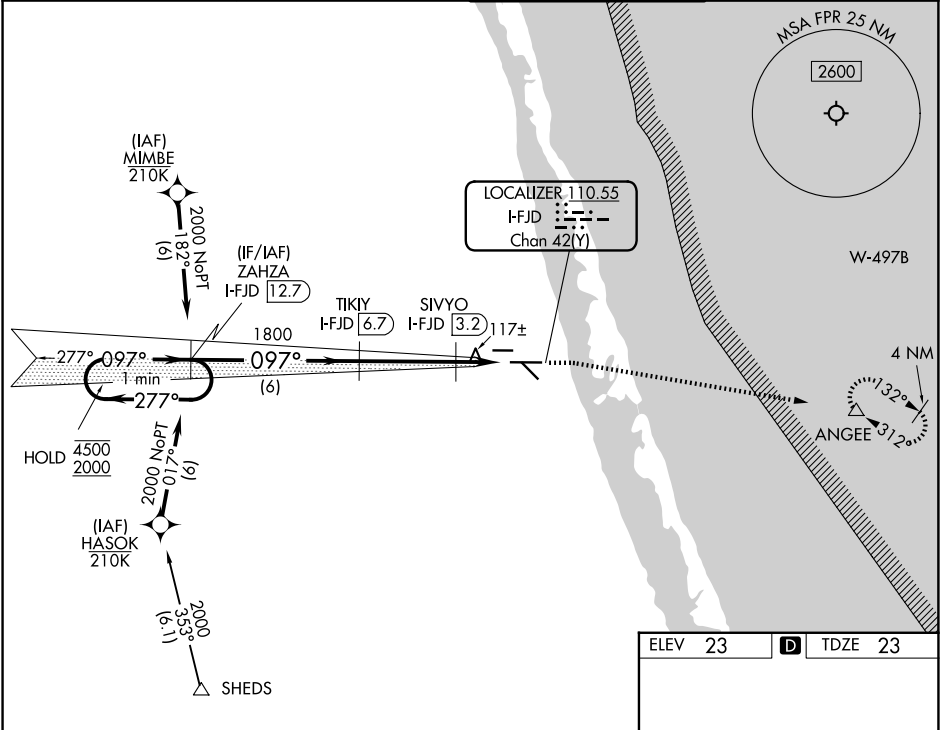

ELEV 23	TDZE 23
One Minute Holding Pattern	
VGS1 and ILS glidepath not coincident (VGS1 Angle 3.00/TCH 52).	
ZAHZA I-FJD 12.7	
TIKIY I-FJD 6.7	
SIVYO I-FJD 3.2	
H-I-FJD 2.2	
H-I-FJD 1.2	
6492 X 150	
6492 X 100	
TWR	
REIL Rwy 10R and 28L 0	
MIRL all Rwy 0	