

WAAS CH 86210 W05A	APP CRS 053°	Rwy Ldg TDZE Apt Elev	5590 5498 5507
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 5

FOUR CORNERS RGNL (FMN)

RNP APCH-GPS.


▼

⚠

Baro-VNAV and VDP NA when using Durango altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C or above 54°C. Circling NA for Cat D southeast of Rwy 5 and south of Rwy 25. When local altimeter setting not received, use Durango altimeter setting and increase LPV DA to 5993 feet and LNAV/VNAV DA to 6163 and all visibilities $\frac{3}{8}$ SM; increase all MDAs 260 feet and visibility LNAV Cat B/C/D and Circling Cat A/B/C $\frac{3}{4}$ SM.

MISSED APPROACH:
Climb to 8400 direct
DIYEP and hold.

ATIS 127.15	DENVER CENTER 118.575 348.7	FARMINGTON TOWER★ 118.9 (CTAF) 0 257.8	GND CON 121.7	UNICOM 122.95
-----------------------	---------------------------------------	--	-------------------------	-------------------------

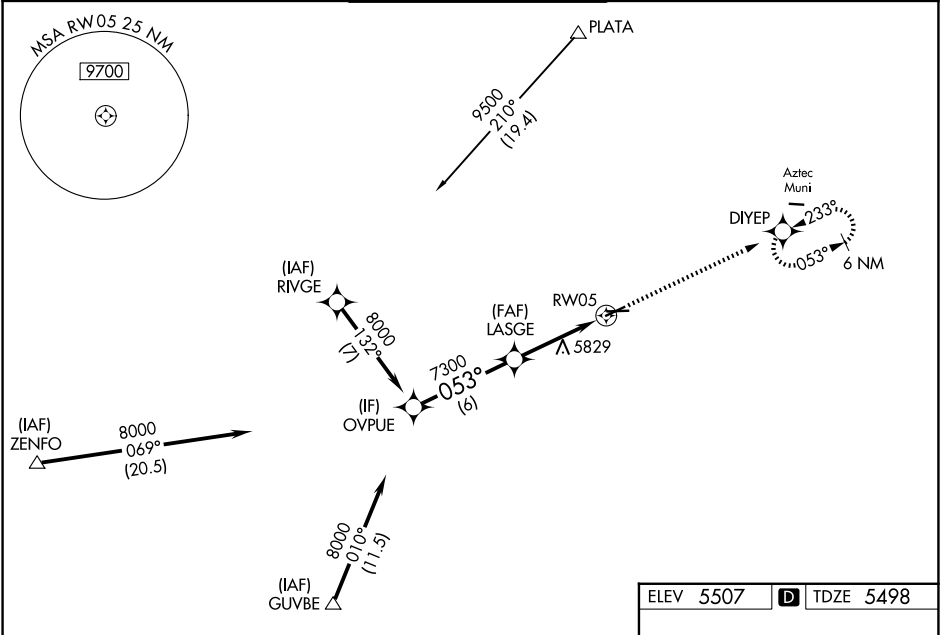

Procedure Turn NA

GP 3.00° TCH 55

8000

053°

7300

6 NM

3.7 NM

1.8 NM

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 42).

8400

DIYEP

* LNAV only

* 1.8 NM to RW05

RW05

053°

0.5% UP

0.4% UP

6501 X 150

6704 X 100

TWR

REIL Rwy 23 and 25

MIRL Rwy 5-23 and 7-25

CATEGORY	A	B	C	D
LPV DA	5750- $\frac{3}{4}$ 252 (300- $\frac{3}{4}$)			
LNAV/VNAV DA	5920-1 $\frac{1}{4}$ 422 (500-1 $\frac{1}{4}$)			
LNAV MDA	6100-1	602 (600-1)	6100-1 $\frac{3}{4}$	602 (600-1 $\frac{3}{4}$)
CIRCLING	6100-1 593 (600-1)	6180-1 673 (700-1)	6380-2 $\frac{1}{2}$ 873 (900-2 $\frac{1}{2}$)	6460-3 953 (1000-3)