

APP CRS	Rwy Ldg	9803
259°	TDZE	38
	Apt Elev	38

RNAV (GPS) RWY 26

HILO INTL (ITO) (PHTO)

RNP APCH.

⚠


Circling NA south of Rwy 8-26. Rwy 26 helicopter visibility reduction below ¾ SM NA. WAAS VNAV NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to ¾ SM and increase LNAV Cat A/B visibility to 1 SM.

MALSR

⚠

MISSED APPROACH: Climb to 500 then climbing right turn to 4000 direct CABIX and hold, continue climb-in-hold to 4000.

ATIS 126.4	HILO APP CON* 119.7 269.2	HILO TOWER* 118.1(CTAF) 0 263.1	GND CON 121.9
---------------	------------------------------	------------------------------------	------------------

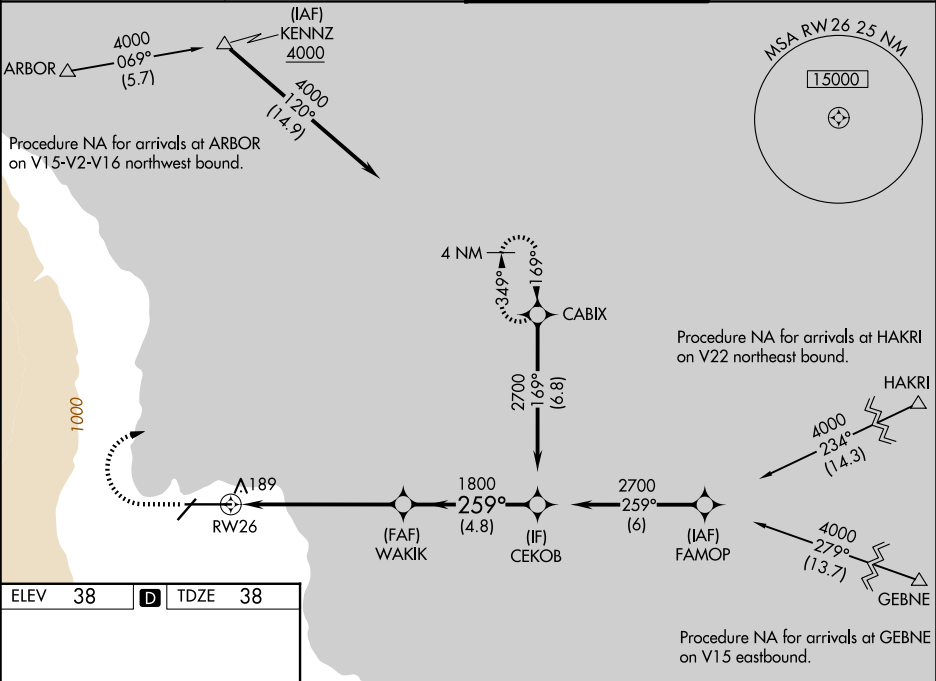

ELEV 38	D	TDZE 38
---------	---	---------

500

4000

CABIX

VGSI and RNAV glidepath not coincident (VGSI Angle 2.60/TCH 70).

*LNAV only

1.3

4.9 NM

4.8 NM

REIL Rwy 3

MIRL Rwy 3-21

MIRL Rwy 8-26

CATEGORY	A	B	C	D
LNAV/VNAV DA	350-¾	312 (400-¾)		
LNAV MDA	460-¾	422 (500-¾)		
CIRCLING	500-1 462 (500-1)	540-1 502 (600-1)	840-2¼ 802 (900-2¼)	1320-3 1282 (1300-3)