


VORTAC SJU	APP CRS	Rwy Ldg	9384
114.0	082°	TDZE	9
Chan 87		Apt Elev	10

VOR or TACAN RWY 8

LUIS MUNOZ MARIN INTL (SJU)(TJSJ)

ADF or DME required.	MALSR	MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 via heading 320° and SJU VORTAC R-004 outbound to DEEDY INT/SJU 15 DME and hold.
For inop ALS, increase S-8 Cat E visibility to 2 SM.		
Circling NA for Cat E south of Rwy 10-28.		

D-ATIS	SAN JUAN APP CON	SAN JUAN TOWER	GND CON
125.8	119.4 269.2 (W & SW) 120.9 290.2 (N & E)	132.05 257.8	121.9 348.6

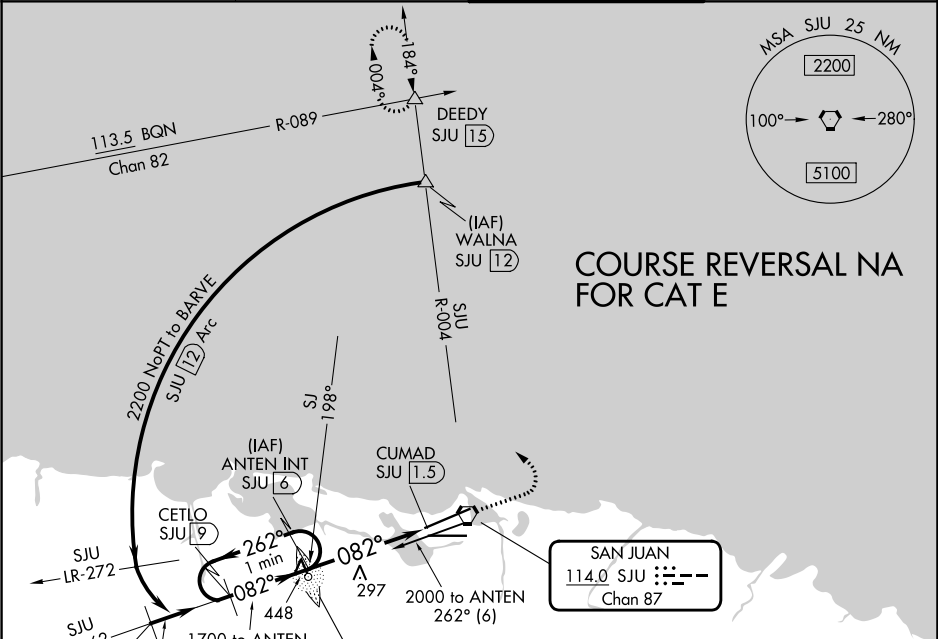

One Minute Holding Pattern

2000

262°

082°

1700

082°

3.45°

TCH 46

3 NM

1.5

2000

3000

hdg 320°

ANTEN INT SJU 6

SJU 3

CUMAD SJU 1.5

DEEDY

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 70).

CATEGORY	A	B	C	D	E
S-8	560-½ 551 (600-½)	560-1 551 (600-1)	560-1¼ 551 (600-1¼)	560-1½ 551 (600-1½)	
CIRCLING	600-1 590 (600-1)	740-2 730 (800-2)	920-3 910 (1000-3)		

REIL Rwy 26

HIRL Rwy 8-26 and 10-28

FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Seq	4:30	3:00	2:15	1:48	1:30

ELEV 10

TDZE 9

082°

10400 X 193

TWR

8016 X 150

28