AURORA, COLORADO

TACAN RWY 32

BUCKLEY SFB (KBKF)

TACAN	APCH CRS	Rwy Idg	TDZE	Arpt Elev
BKF Chan 33	328°	11,006	5663	5663

[USAF]

* When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE vis to 1¾ miles.
** Circling not authorized east of Rwy 14-32.


ALSF-1

MISSED APPROACH: Climbing right turn to 8200 and intercept BKF TACAN R-148 direct BEKEE and hold or as directed by ATC.

ATIS ★	DENVER APP CON	TOWER ★	GND CON
119.675 259.3	128.45 251.075	121.0 291.675	121.6 275.8

CAT E remain within 4.25 NM of rwy when circling.

Missed approach requires use of RNAV or ATC RADAR monitoring.

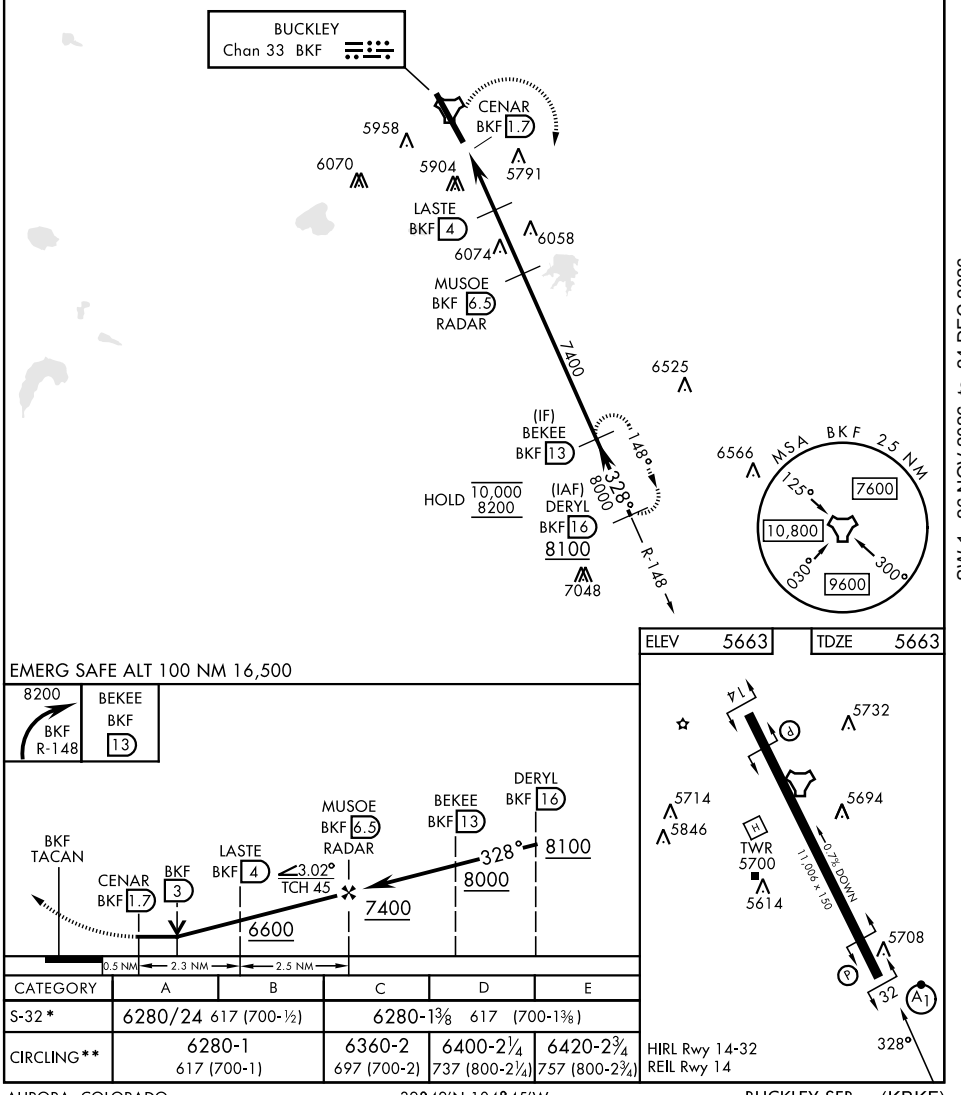

CATEGORY	A	B	C	D	E
S-32*	6280/24 617 (700-½)		6280-1⅜ 617 (700-1⅜)		
CIRCLING**	6280-1 617 (700-1)		6360-2 697 (700-2)	6400-2¼ 737 (800-2¼)	6420-2¾ 757 (800-2¾)

HIRL Rwy 14-32
REIL Rwy 14

AURORA, COLORADO 39°42'N-104°45'W BUCKLEY SFB (KBKF)

Amdt 3 27APR17

TACAN RWY 32

SW-1, 26 NOV 2026 to 24 DEC 2026