YIGO, GUAM I, GUAM

TACAN Y RWY 24L

VORTAC UNZ 115.8 Chan 105	APCH CRS 236°	Rwy ldg 11,199 TDZE 607 Arpt Elev 617

(USAF)

ANDERSEN AFB (PGUA)

* When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.

SALS (A2)

MISSED APPROACH: Climb to 3000 direct CCOOK, then climbing left turn to intercept UNZ R-056 to DWAFF and hold.

ATIS	GUAM APP CON/DEP CON	TOWER	GND CON
118.175 254.325	119.8 269.0	126.2 233.7	121.7 275.8

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

(IAF) DWAFF UNZ 30 3000

R-056

236°

265K

056°

HOLD 10,000 3000

(IF) TIMAE UNZ 26

2600

236°

HIPRI UNZ 19.7

2200 (6.3)

791

685

CCOOK UNZ 12.9

R-054

Missed Approach requires use of RNAV or ATC RADAR monitoring.


NIMITZ 115.8 UNZ Chan 105

MSA UNZ 25 NM


2600

EMERG SAFE ALT 100 NM 2900

3000 | CCOOK UNZ 12.9 | UNZ R-056 | DWAFF UNZ 30

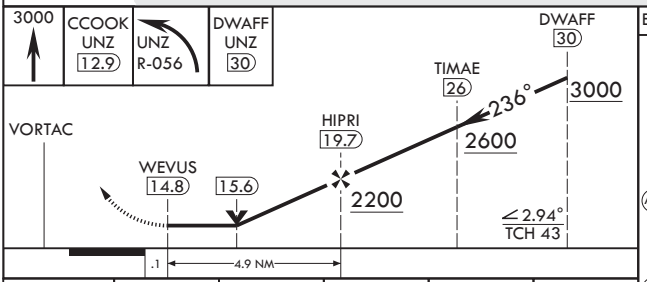

ELEV 617 TDZE 607

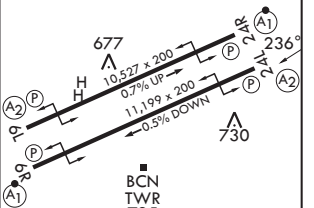

CATEGORY	A	B	C	D	E
S-24L*	940/40 333 (400-¾)		940/45	333	(400-⅞)
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¾ 623 (700-1¾)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)

PAC, 29 OCT 2026 to 24 DEC 2026