YIGO, GUAM I, GUAM

TACAN Z RWY 24R

TACAN UAM Chan **54**	APCH CRS **231°**	Rwy ldg **10,527** TDZE **617** Arpt Elev **617**

(USAF) ANDERSEN AFB (PGUA)

RADAR or DME required

* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.


ALSF-1

MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.

ATIS	GUAM APP CON/DEP CON	TOWER	GND CON
118.175 254.325	**119.8 269.0**	**126.2 233.7**	**121.7 275.8**


CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

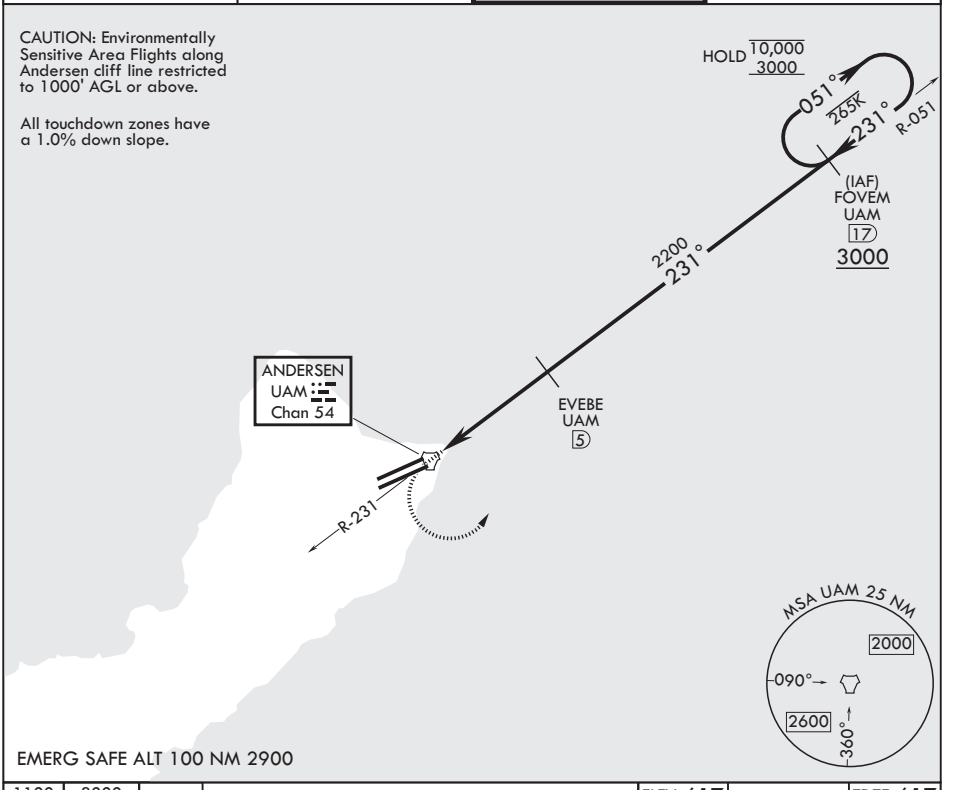


1100 | 3000 UAM R-051 | FOVEM UAM 17

VGSI and ILS glidepath not coincident (VGSI angle 3.00/TCH 59).

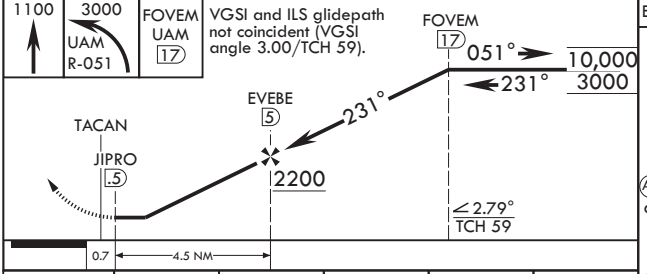

ELEV 617 TDZE 617

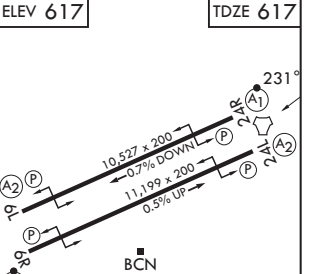

CATEGORY	A	B	C	D	E
S-24R*	940/24 323 (400-½)		940/40	323	(400-¾)
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¾ 623 (700-1¾)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)

HIRL all rwys