

Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 04/17/2025	APWS Task ID: 35EC9E9D51734727855C0C7034E08087	APWS Project ID: 79EC0732E6C84B5AB8D99C7722227959
Procedure: LOC RWY 1R AMDT 4D		Enroute: NO	Specialist: Copeland, Guy		Agreement Number:
Airport ID: KTPA			Airport City: TAMPA		State: FL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: P NOTAM FOR INCREASED CIRCLING MINIMUMS. PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED JULY 07, 2021 GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. CONTACT ROBERT HAMILTON, AJV-A431 405-954-4608. QUALITY 41 CHECKED QUALITY 18 CHECKED					

TAMPA, FLORIDA

OLD


23110

LOC/DME I-TWJ 111.95 Chan 56 (Y)	APP CRS 007°	Rwy Idg TDZE Apt Elev	8300 21 26
--	------------------------	-----------------------------	---------------------------------------


LOC RWY 1R
TAMPA INTL (TPA)

DME required. ⚠		MISSED APPROACH: Climb to 500 then climbing right turn to 2000 direct LAL VORTAC and hold.	
--------------------	--	--	--

ARR 126.45	D-ATIS 128.475	DEP 128.475	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------	---------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

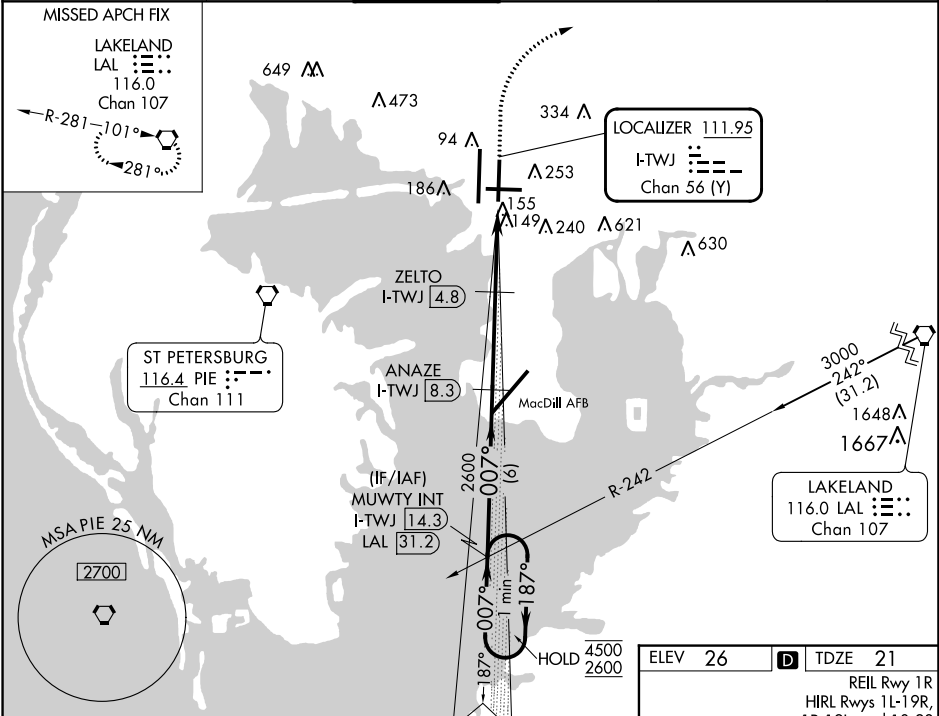

VGSI and descent angle not coincident (VGSI Angle 3.00/TCH 71).	500	2000	LAL
One Minute Holding Pattern	↑	↪	⬡

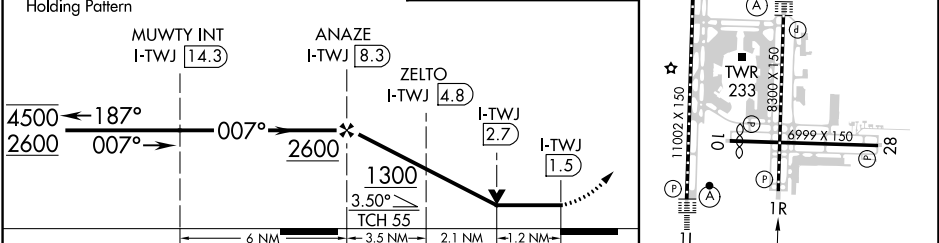

CATEGORY	A	B	C	D
S-LOC 1R	460/55	439 (500-1)	460-1¼	439 (500-1¼)
CIRCLING	560-1	534 (600-1)	680-1¾ 654 (700-1¾)	980-3 954 (1000-3)

ELEV 26	TDZE 21
REIL Rwy 1R HIRL Rws 1L-19R, 1R-19L, and 10-28 TDZ/CL Rws 1L and 19L	
FAF to MAP 6.8 NM	
Knots	60 90 120 150 180
Min:Sec	6:48 4:32 3:24 2:43 2:16