


Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 07/09/2026	APWS Task ID: 4A4B467932E3453591179137B59EE1DB	APWS Project ID: EC5195079ECB4217B809FB52B14D457D
Procedure: RNAV (GPS) RWY 4, ORIG-D		Enroute: NO	Specialist: Smart, Phillip		Agreement Number:
Airport ID: KAJG			Airport City: MOUNT CARMEL		State: IL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: CLEARs T-NOTAM !FDC 5/1382. Processed IAW Technical Support Group (AJF-17) Memo dated 07/07/2021 Guidance for Procedural Changes Requiring Flight Inspection/Validation. CONTACT CASEY HILL, MANAGER AJV-A431, 405.954.0624. QUALITY 9 CHECKED BEGUE QUALITY 34 CHECKED					

APP CRS	Rwy Idg	4000
043°	TDZE	429
	Apt Elev	429

RNAV (GPS) RWY 4
MOUNT CARMEL MUNI (AJG)

RNP APCH.	MISSED APPROACH: Climb to 2500 direct RUOFF and hold.
▼ Rwy 4 helicopter visibility reduction below ¾ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C.	

AWOS-3 134.9	EVANSVILLE APP CON★ 125.6 343.7	UNICOM 122.7 (CTAF) 0
-----------------	------------------------------------	--------------------------

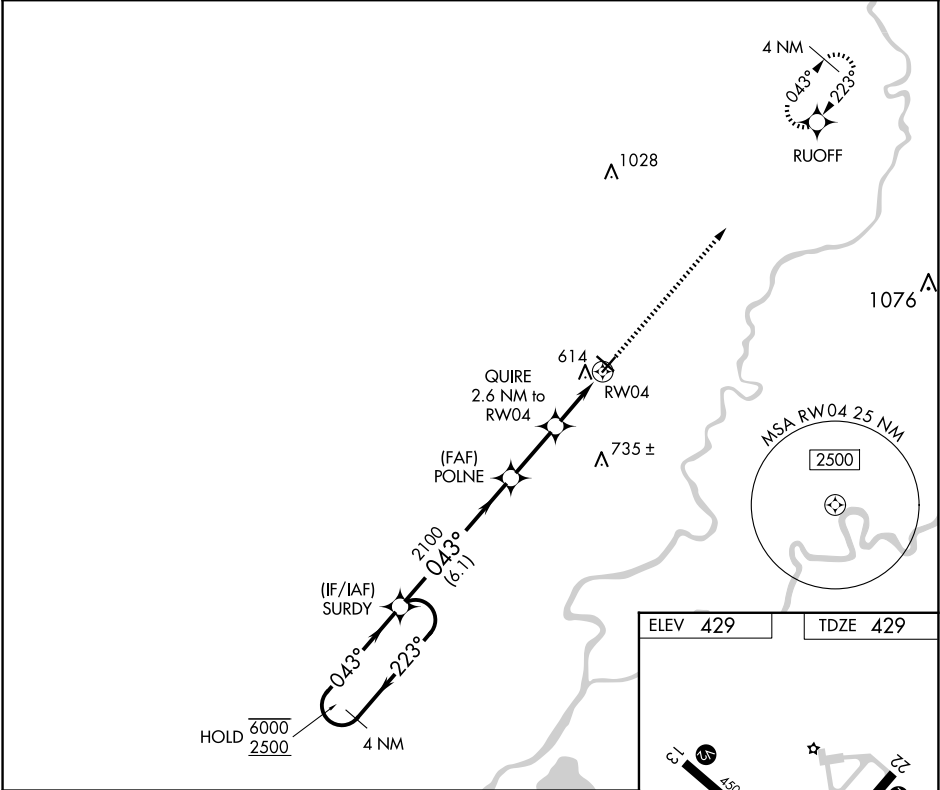

4 NM Holding Pattern	SURDY	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 23).	2500 RUOFF
6000 ← 223°	2500 → 043°	043°	*LNAV only
GP 3.00°	TCH 40	2100	*1.5 NM to RW04
	6.1 NM	2.5 NM	1.1 NM
CATEGORY	A	B	C
LNAV/VNAV	DA	937-1¾ 508 (600-1¾)	NA
LNAV MDA	920-1 491 (500-1)	920-1¾ 491 (500-1¾)	NA

