

Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 60B870F3A9814BC38CA78A10E6EEEF88	APWS Project ID: ABF3FC7612DA4E40AF98E82A27DF380F
Procedure: RNAV (GPS) RWY 5 AMDT 1B		Enroute: NO	Specialist: Martinez, Rafael		Agreement Number:
Airport ID: KBCT			Airport City: BOCA RATON		State: FL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: UPDATE BARO VNAV & RASS NOTE TO ADDRESS AIRPORT NAME (ID) CHANGE FROM PALM BEACH INTL (PBI) TO PRESIDENT DONALD J TRUMP INTL (DJT). PENDING DATA USED FOR KDJT AIRPORT (07-09-2026). ACTIVE DATA USED FOR KBCT AIRPORT (07-14-2022). CONTACT: BEV L BORDY, AJV-A420, 405-954-8293/TARA MARTINELLI, AJV-A421, 405-954-7931. Digitally signed by TARA N MARTINELLI May 11, 2026 QUALITY 20 CHECKED QUALITY 29 CHECKED					

WAAS CH 82101 W05A	APP CRS 049°	Rwy Ldg TDZE Apt Elev	5580 12 13
--	------------------------	-----------------------------	---------------------------------------


RNAV (GPS) RWY 5
BOCA RATON (BCT)

RNP APCH-GPS.

⚠ Baro-VNAV NA when using Palm Beach Intl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. When local altimeter setting not received, use Palm Beach Intl altimeter setting: increase LPV DA to 326 feet; increase LNAV/VNAV DA to 501 feet; increase all MDAs 60 feet and visibility LNAV Cats C and D $\frac{1}{4}$ SM and Circling Cats C and D $\frac{1}{4}$ SM. In minimum visibility conditions bright lights on highway $\frac{1}{4}$ mile north of airport may be mistaken for runway lights. Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

MISSED APPROACH:
Climb to 2000 direct
KISEC and hold.

D-ATIS 121.125	PALM BEACH APP CON 127.35 343.6	BOCA RATON TOWER ★ 118.425 (CTAF) 0	GND CON 121.8	GCO 127.35
--------------------------	---	---	-------------------------	----------------------

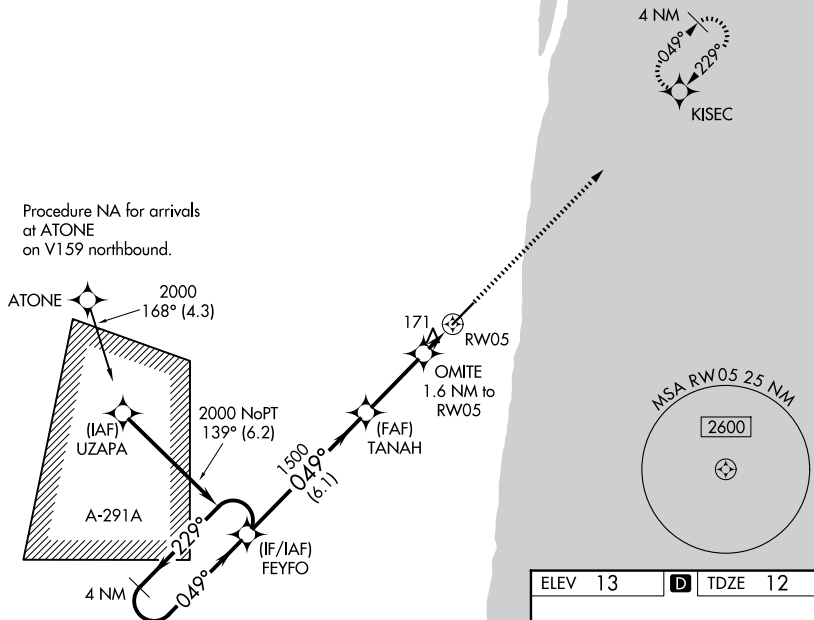

SE-3, 19 MAR 2026 to 16 APR 2026

4 NM Holding Pattern

2000

GP 3.00°
TCH 40

229°

049°

FEYFO

1500

TANAH

1500

560

OMITE

1.6 NM to RW05

RW05

6.1 NM


3 NM

1.6 NM

2000

KISEC

VGSI and RNAV glidepath not coincident (VGSI Angle 3.25/TCH 46).

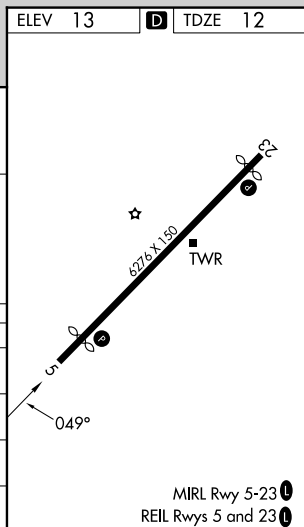BOCA RATON, FLORIDA
Amdt 1A 06OCT22

26°23'N-80°06'W

BOCA RATON (BCT)

RNAV (GPS) RWY 5