

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 10/02/2025	APWS Task ID: 612C2FC10D2B46F7B70444F99D0240D9	APWS Project ID: 018C2994CB524080A025FC3FF9711EED
Procedure: RNAV (RNP) Z RWY 30 AMDT 2		Enroute: NO	Specialist: Gorman, Barbara		Agreement Number:
Airport ID: KPSC			Airport City: PASCO		State: WA
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: PENDING DATA USED FOR KPSC AIRPORT AND RUNWAYS. CONTACT: CASIMIR TABAKA: 405.954.7931 8/8/25: THIS IS AN UPDATE COPY OF THE FORM DEVELOPED ON 5/1/2025: ADDED 10/2/2025 TO REQUIRED EFFECTIVE DATE.					

QUALITY
38
CHECKED




QUALITY
39
CHECKED

RNAV (RNP) Z RWY 30
TRI-CITIES (PSC)

APP CRS	Rwy Idg	7504
301°	TDZE	405
	Apt Elev	410

▼ For uncompensated Baro-VNAV systems, procedure NA below -14°C (7°F) or above 54°C (130°F). RF required. GPS required. For inoperative ODALS, increase RNP 0.11 visibility all Cats to 1¼ mile, and increase RNP 0.30 visibility all Cats to 1½ mile.	ODALS ⬮	MISSED APPROACH: Climb to 5200 on track 301° to WEDAV, left turn to YOCUY, and on track 254° to PAIDS and hold.
---	-----------------------	--

ATIS 125.65	SPOKANE APP CON* 128.75 377.2	TRI-CITIES TOWER* 135.3 (CTAF) 0 323.3	GND CON 121.8	CLNC DEL 120.0	UNICOM 122.95
----------------	----------------------------------	---	------------------	-------------------	------------------

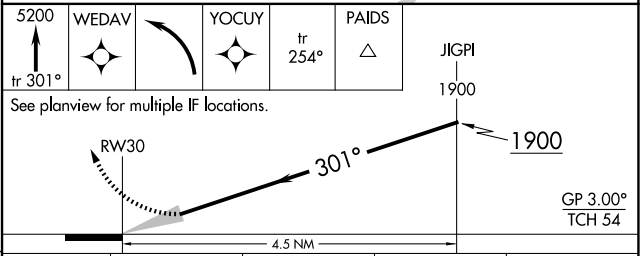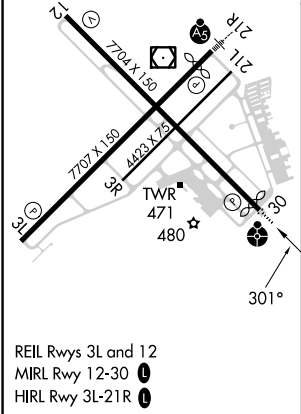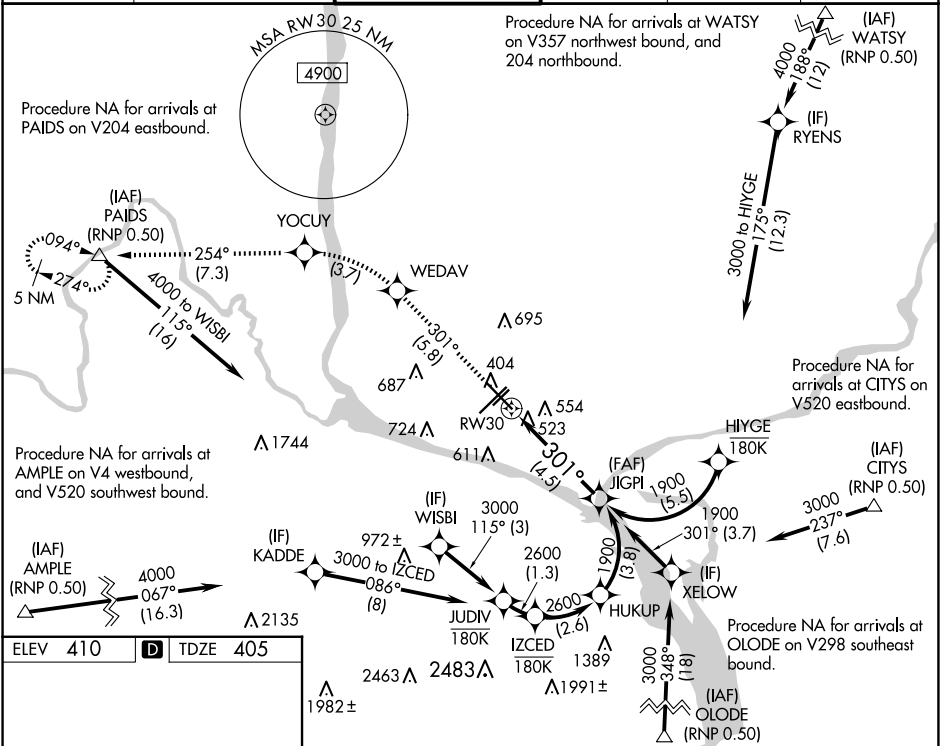


CATEGORY	A	B	C	D
RNP 0.11 DA		778-1½	373 (400-1½)	
RNP 0.30 DA		834-1¼	429 (500-1¼)	
AUTHORIZATION REQUIRED				

PASCO, WASHINGTON

AL-474 (FAA)

FIG

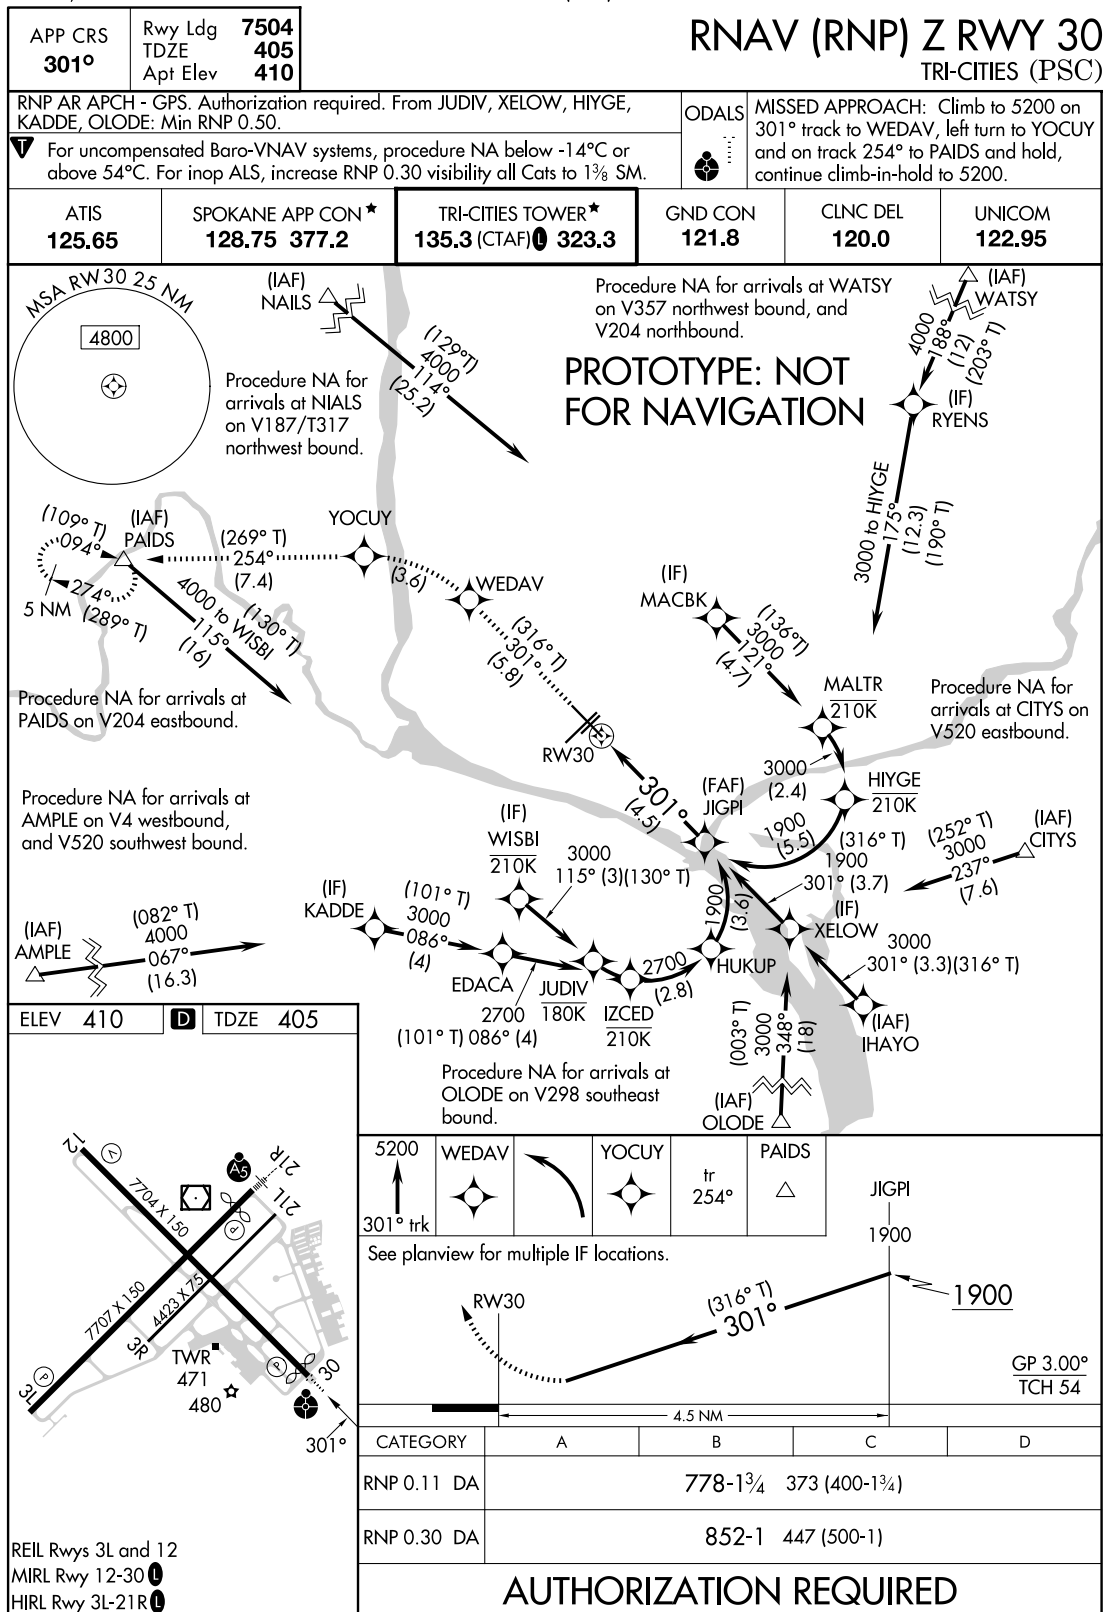

AUTOMATED AL-474 RNAV (RNP) Z RWY 30

NW-1

10 JUN 2025

COMPILER: CG

REVIEWER:

DBL CHKR:

EFF: FIG

PASCO, WASHINGTON

TRI-CITIES (PSC)

Amdt 2 FIG

46°16'N-119°07'W

RNAV (RNP) Z RWY 30

