


Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 614D89574313459FA7C90E5DC876264C	APWS Project ID: 0AB7A7F8AD604D089E64B81F91A9C0E9
Procedure: RNAV (GPS) RWY 36 ORIG-D		Enroute: NO	Specialist: Johnson, Timothy		Agreement Number:
Airport ID:			Airport City: WEST POINT		State: MS
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: Visibility Initiative (Garmin) - Update IAP visibility minimums IAW Order 8260.3, Chapter 3, Section 3-3. Visibility Minimums. PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. CONTACT: CASEY HILL (405) 954-0624. QUALITY 6 CHECKED SN 4/23/26 QUALITY 29 CHECKED					

APP CRS 360°	Rwy Ldg 3850 TDZE 203 Apt Elev 205
------------------------	---


RNAV (GPS) RWY 36
MCCHAREN FLD (M83)

 Use Golden Triangle Rgnl altimeter setting, when not received, use Columbus AFB altimeter setting. DME/DME RNP-0.3 NA. Helicopter visibility reduction below 1 SM NA. Procedure NA at night.  NA	MISSED APPROACH: Climb to 1000 then climbing left turn to 2500 direct CLOUT and hold.
---	--

COLUMBUS APP CON ★ 135.6 323.275	CTAF 122.9 0
--	------------------------

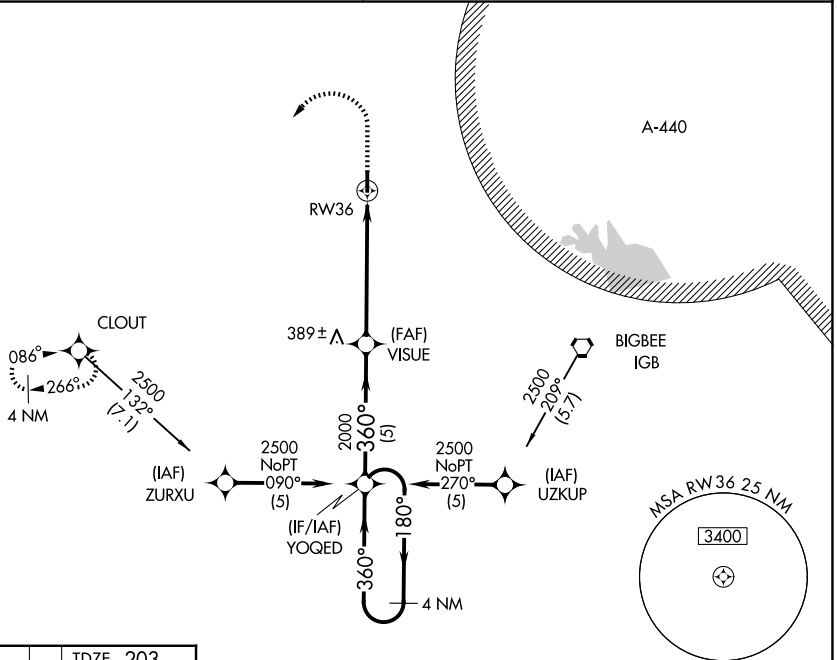

ELEV 205		TDZE 203
----------	--	----------

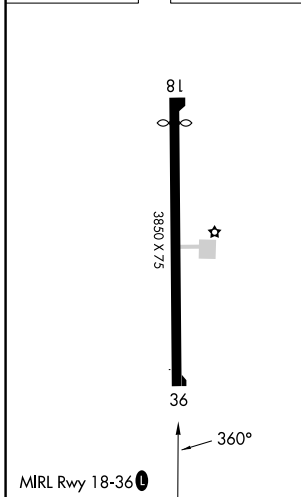

4 NM Holding Pattern

YOQED

VISUE

1000

2500

CLOUT

2500 ← 180° → 360°

360°

2000

3.02° TCH 40

RW36

5 NM

5.5 NM

CATEGORY	A	B	C	D
GLS DA		NA		
LNAV/VNAV		NA		
LNAV MDA	760-1	557 (600-1)	760-1½ 557 (600-1½)	NA
CIRCLING	920-1 715 (800-1)	1020-1¼ 815 (900-1¼)	1020-2½ 815 (900-2½)	NA

WEST POINT, MISSISSIPPI

Orig-C 08OCT20

33°35'N-88°40'W

MCCHAREN FLD (M83)

RNAV (GPS) RWY 36

SC-4, 16 APR 2026 to 14 MAY 2026

SC-4, 16 APR 2026 to 14 MAY 2026