

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 7B78D418AE0C46A098BED1C790A3834F	APWS Project ID: E29FB7B08FCC4F0EB40A84F150DEB1A6
Procedure: RNAV (GPS) RWY 5 AMDT 2		Enroute: NO	Specialist: Kenney, Taylor		Agreement Number:
Airport ID: KSLK			Airport City: SARANAC LAKE		State: NY
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: PENDING AIRNAV DATA USED CANCELS NOTAM FDC 4/2205 CRC REMAINDER CHANGED FROM A45F8027 TO 009F6F09 POC: ROB HAMILTON, AJV-A433, (405) 954-4608 QUALITY 9 CHECKED BEGUE QUALITY 40 CHECKED					

WAAS
CH **48926**
W05A

APP CRS
049°

Rwy Ldg
TDZE **1654**
Apt Elev **1663**

EXISTING

RNAV (GPS) RWY 5
ADIRONDACK RGNL (SLK)

RNP APCH-GPS.

 Circling Rwy 5, 9, 27 NA at night. Rwy 5 helicopter visibility reduction below 1 SM NA. Rwy 5 straight-in minimums NA at night.



 -32°C

MISSED APPROACH: Climbing left turn to 6000 direct MUNZA and hold, continue climb-in-hold to 6000.


ASOS **124.175**

BOSTON CENTER **120.35 342.25**

UNICOM **123.0 (CTAF) 0**

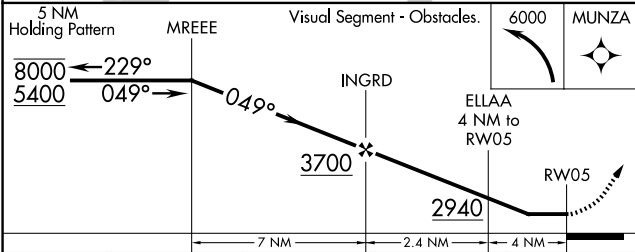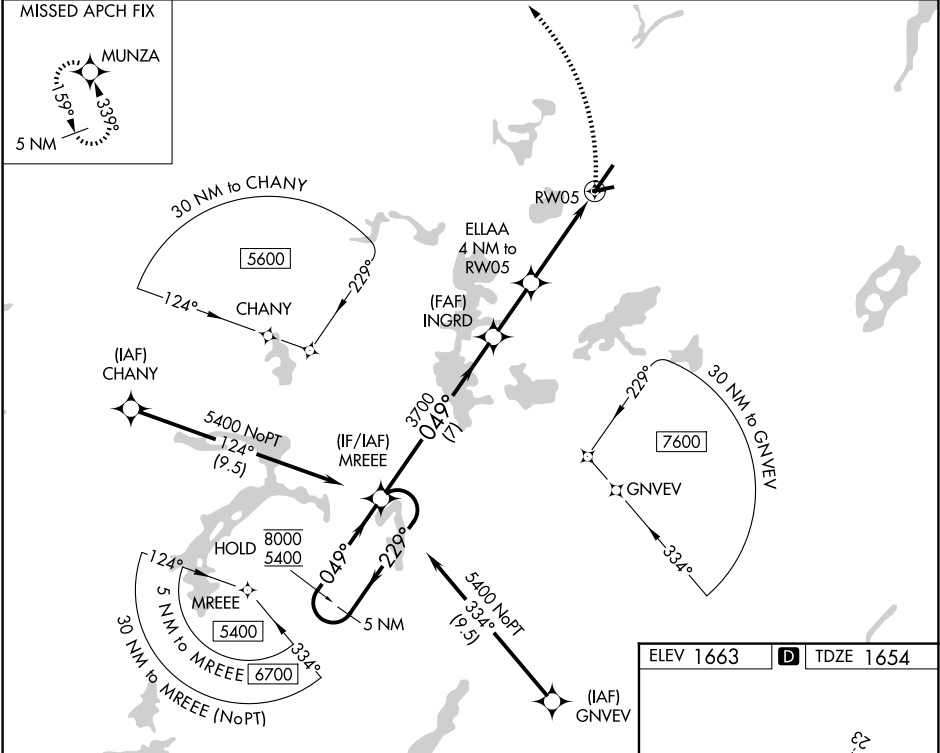

CATEGORY	A	B	C	D
LP MDA	2420-1 766 (800-1)	2420-1 ¼ 766 (800-1 ¼)	2420-2 ½	766 (800-2 ½)
LNAV MDA	2540-1 ¼	886 (900-1 ¼)	2540-2 ½	886 (900-2 ½)
CIRCLING	2540-1 ¼ 877 (900-1 ¼)	2660-1 ½ 997 (1000-1 ½)	2660-3 997 (1000-3)	2680-3 1017 (1100-3)

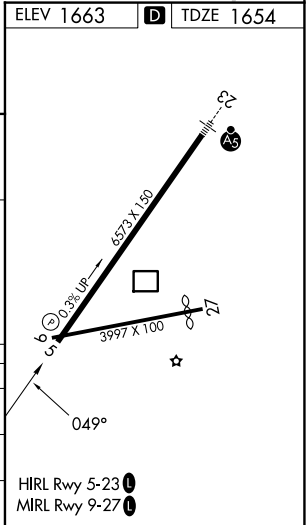

NE-2, 22 JAN 2026 to 19 FEB 2026

NE-2, 22 JAN 2026 to 19 FEB 2026