

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 8B5A4855BA944E7F9A2406DF8E988FE3	APWS Project ID: CE876E1550BD46F5924DD9E430A8E7DC
Procedure: RNAV (GPS) RWY 23 AMDT 2E		Enroute: NO	Specialist: Secaida, Roni		Agreement Number:
Airport ID: KCAE			Airport City: COLUMBIA		State: SC
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: REASON FOR PROJECT: T-NOTAM CLEARING THIS CANCELS FDC 4/5882 Contact Casey Hill, (405) 954-0624 QUALITY 29 CHECKED QUALITY 39 CHECKED					

WAAS CH 40026 W23A	APP CRS 232°	Rwy Ldg TDZE Apt Elev	7001 213 236
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 23


COLUMBIA METRO (CAE)

RNP APCH - GPS.

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. Rwy 23 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climb to 2300 direct EDURE and hold.

ATIS 120.15	COLUMBIA APP CON 124.15 338.2 (110°-289°) 133.4 285.6 (290°-109°)	COLUMBIA TOWER 119.5 257.8	GND CON 121.9 348.6
-----------------------	---	--------------------------------------	-------------------------------

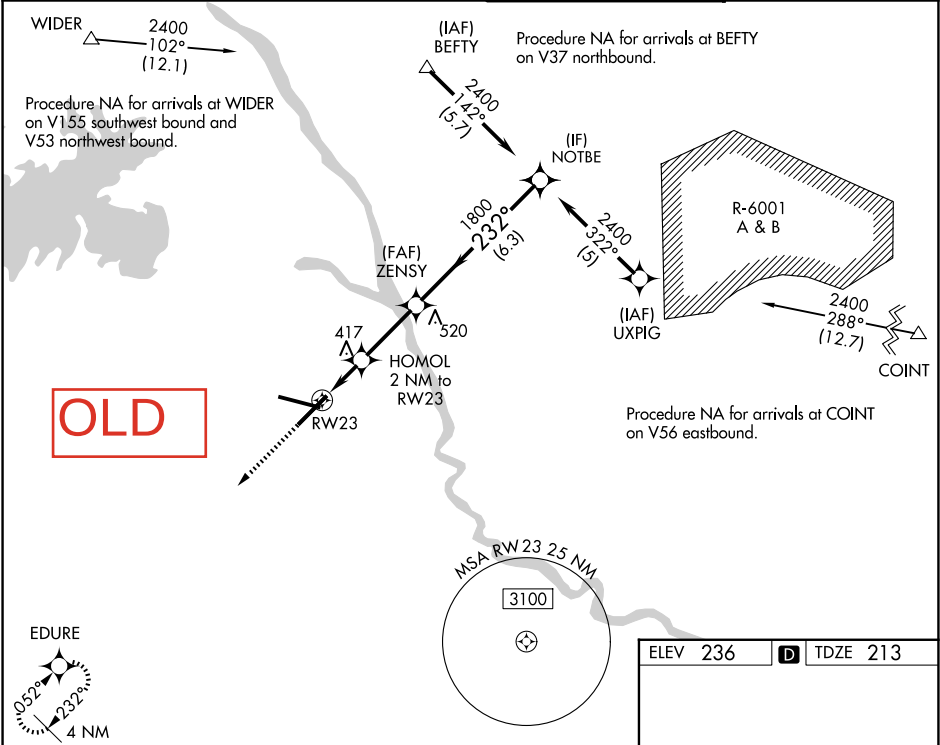

2300	EDURE	VGSI and RNAV glidepath not coincident (VGSI angle 3.00/TCH 69).				NOTBE
*LNAV only.		HOMOL 2 NM to RW23	ZENSY 1800	232°	2400	
		*1.3 NM to RW23		1800		GP 3.00° TCH 54
		*900				
		1.3	0.7	2.8 NM	6.3 NM	
CATEGORY		A	B	C	D	
LPV DA		503/50 290 (300-1)				
LNAV/VNAV DA		709-1¾ 496 (500-1¾)				
LNAV MDA		680/50 467 (500-1)	680/60 467 (500-1¼)	680-1½ 467 (500-1½)		
CIRCLING		740-1 504 (600-1)	860-1 624 (700-1)	1040-2¼ 804 (900-2¼)	1040-2½ 804 (900-2½)	

