


Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 12/02/2021	APWS Task ID: A8F5C49F19D4480BBE8394FFA8AEBD85	APWS Project ID: CBA8F214D4DC4F95AB85A7E0EE6CA7AB
Procedure: RNAV (GPS) RWY 25 AMDT 3E		Enroute: NO	Specialist: Martinez, Rafael		Agreement Number:
Airport ID: O88			Airport City: RIO VISTA		State: CA
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: P-NOTAM. THIS CANCELS FDC 0-4057. ORDER 8260.3, CHAPTER 2, NEW CIRCLING CRITERIA APPLIED. CONTACT: LONNIE EVERHART 405-954-4576/DAVID TEFFETELLER 202-267-5177.					

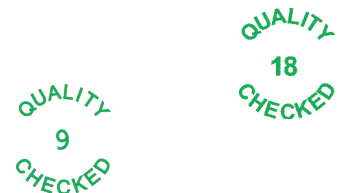


WAAS CH 82325 W25A	APP CRS 252°	Rwy Idg TDZE Apt Elev	4199 23 23
--	------------------------	-----------------------------	---------------------------------------

RNAV (GPS) RWY 25
RIO VISTA MUNI (O88)

NA Circling Rwy 33 NA at night. DME/DME RNP-0.3 NA. VDP NA when using Concord altimeter setting. When local altimeter setting not received, use Concord altimeter setting and increase all MDA 60 feet and increase LP and LNAV Cat C visibility 1/8 mile and Circling Cat C visibility 1/4 mile.	MISSED APPROACH: Climb to 500 then climbing right turn to 3100 direct JIRAG and hold, continue climb-in-hold to 3100.
--	--

AWOS-AV 127.075	TRAVIS APP CON 119.9 322.325	UNICOM 122.725 (CTAF) 0
---------------------------	--	-----------------------------------

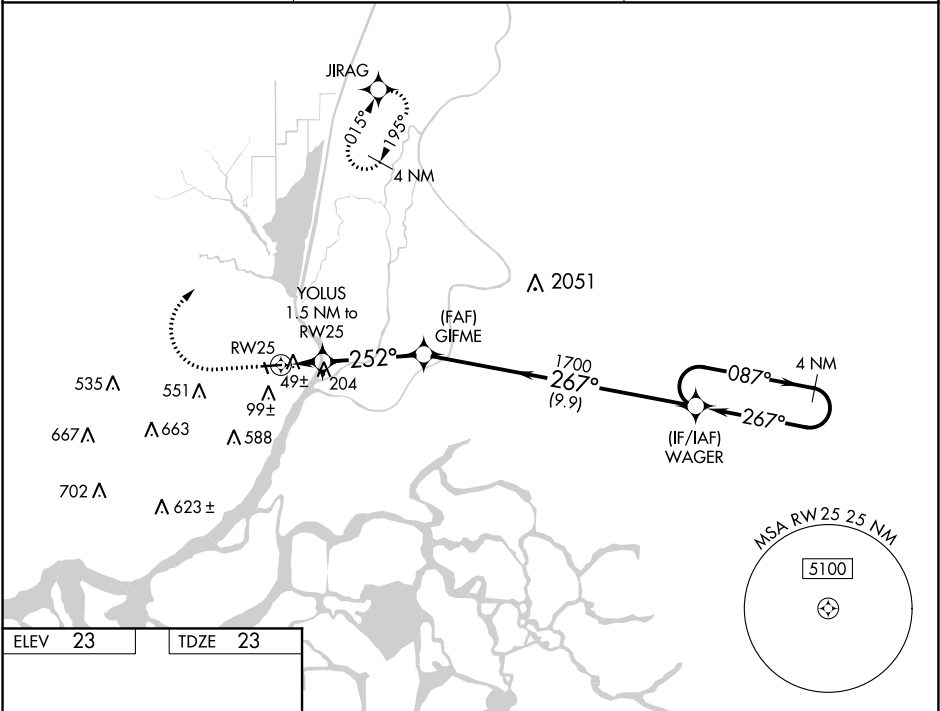

ELEV 23	TDZE 23	500 3100 JIRAG VGSI and descent angles not coincident (VGSI Angle 4.00/TCH 40). 4 NM Holding Pattern YOLUS 1.5 NM to RW25 0.6 NM to RW25 3.00° TCH 40 252° 1700 267° 087° 3200 520 500 3100 0.6 0.9 3.6 NM 9.9 NM			
REIL Rwy 25 0		MRL Rwy 7-25 and 15-33 0			
RIO VISTA, CALIFORNIA		RIO VISTA MUNI (O88)			
Amdt 3D 22JUN17		38°12'N-121°42'W			
		RNAV (GPS) RWY 25			

