



Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 04/17/2025	APWS Task ID: BC173FA0909940D59E721311B9F6A60B	APWS Project ID: 58484363161643289C55DA6CA629E7B9
Procedure: RNAV (GPS) RWY 9 AMDT 1C		Enroute: NO	Specialist: Young, Silvia		Agreement Number:
Airport ID: KAMN			Airport City: ALMA		State: MI
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: ACTIVE DATA USED FOR KAMN AIRPORT AND RWYS. NEW CRC REMAINDER: E6AEEC71 CONTACT JOSEPH L. ZEDER 405.954.9111 QUALITY 20 CHECKED					

WAAS CH 90228 W09A	APP CRS 095°	Rwy Idg TDZE Apt Elev	5004 754 754
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 9

GRATIOT COMMUNITY (AMN)

RNP APCH - GPS.			MISSED APPROACH: Climb to 2600 direct CEGEE and hold.
Rwy 9 helicopter visibility reduction below ¾ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV and VDP NA when using MOP altimeter setting. When local altimeter setting not received, use MOP altimeter setting: increase LVP DA to 1071 feet; increase LNAV/VNAV DA to 1199 feet and all visibilities ¼ SM; increase all MDAs 60 feet and LNAV visibility Cat C and D ¼ SM.			
AWOS-3P 124.175	GREAT LAKES APP CON★ 126.45 235.625	UNICOM 122.8 (CTAF) 0	

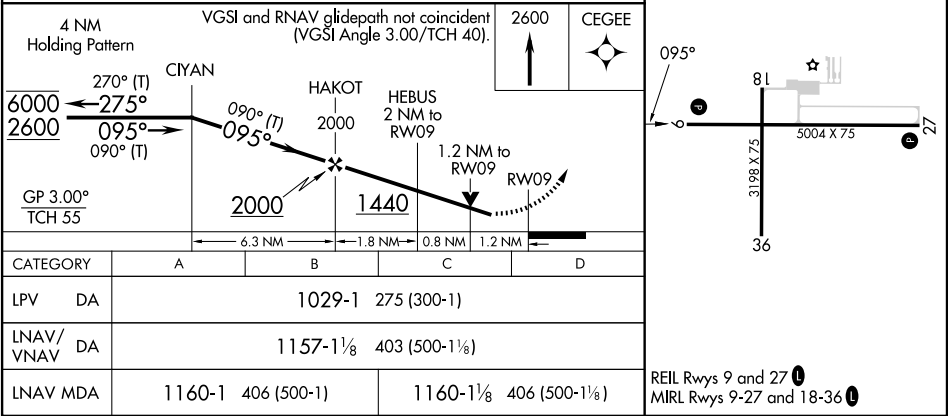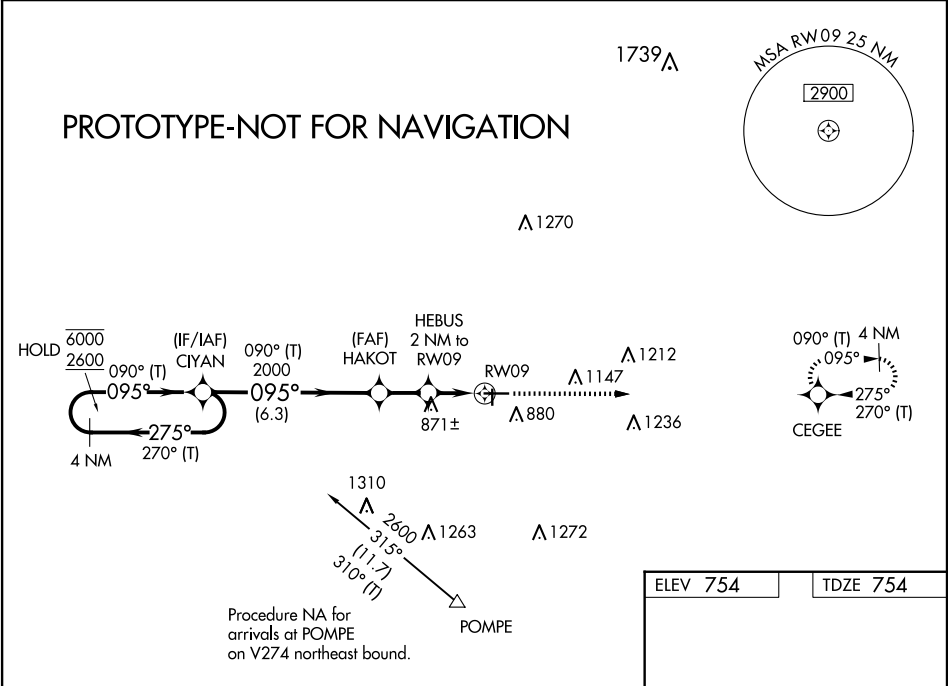

WAAS CH 90228 W09A	APP CRS 095°	Rwy Idg TDZE 753 Apt Elev 754	5004
--	------------------------	---	-------------


RNAV (GPS) RWY 9
GRATIOT COMMUNITY (AMN)

RNP APCH.

⚠ Baro-VNAV NA when using Mount Pleasant altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 39°C. Rwy 9 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Mount Pleasant altimeter setting and increase all DA 42 feet and VNAV all Cats visibility ½ mile, increase all MDA 60 feet, and LNAV Cat C and D visibility ¼ mile. VDP NA when using Mount Pleasant altimeter setting.

MISSED APPROACH: Climb to 2600 direct CEGEE and hold.

AWOS-3P 124.175	GREAT LAKES APP CON* 126.45 235.625	UNICOM 122.8 (CTAF) 0
---------------------------	---	---------------------------------

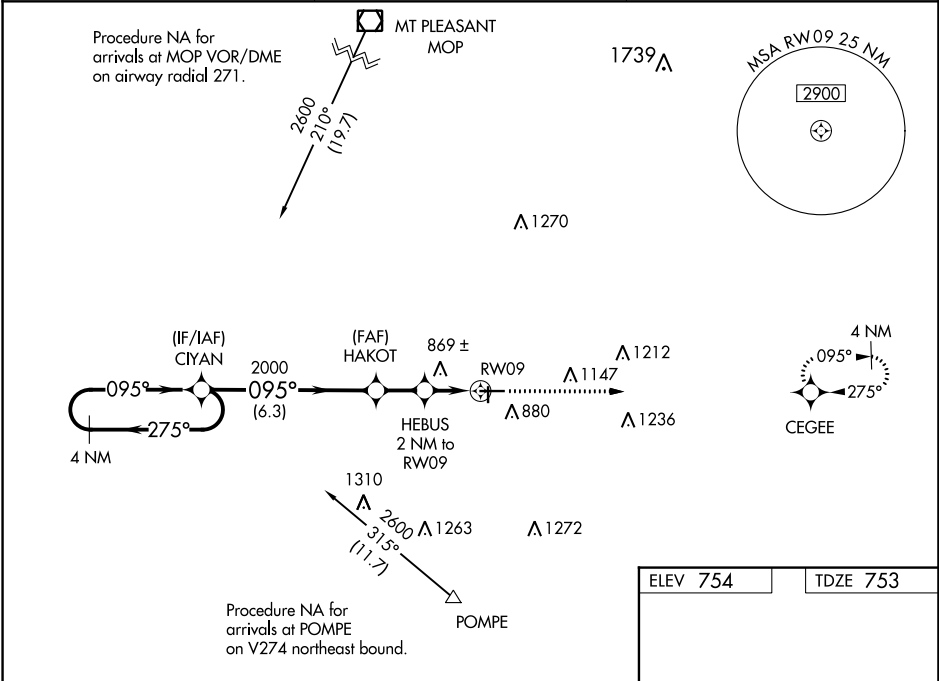

4 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 40).

2600

275° 095°

GP 3.00° TCH 55

CIYAN

HAKOT

HEBUS 2 NM to RW09

*1.2 NM to RW09

RW09

2000

*1440

6.3 NM 1.8 NM 0.8 NM 1.2 NM

2600

CEGEE

*LNAV only

095°

81

5004 X 75

36

3188 X 75

27

CATEGORY	A	B	C	D
LPV DA	1028-1 275 (300-1)			
LNAV/VNAV DA	1156-1¾ 403 (500-1¾)			
LNAV MDA	1160-1 407 (500-1)		1160-1½ 407 (500-1½)	

REIL Rwy 9 and 27 0

MIRL Rwy 9-27 and 18-36 0


**KAMN,
GRATIOT COMMUNITY
ALMA, MI
RNAV (GPS) RWY 9 A1C
LPV FINAL
1:100,000**

**LPV Final
Missed LPV HAT Adj
TREE (836)26-144609**

**Missed Level Surface
WINDMILL (1236)26-021158**

Missed Level Surface
WINDMILL (1236)26-021158

KAMN,
GRATIOT COMMUNITY
ALMA, MI
RNAV (GPS) RWY 9 A1C
LNAV/VNAV FINAL
1:100,000

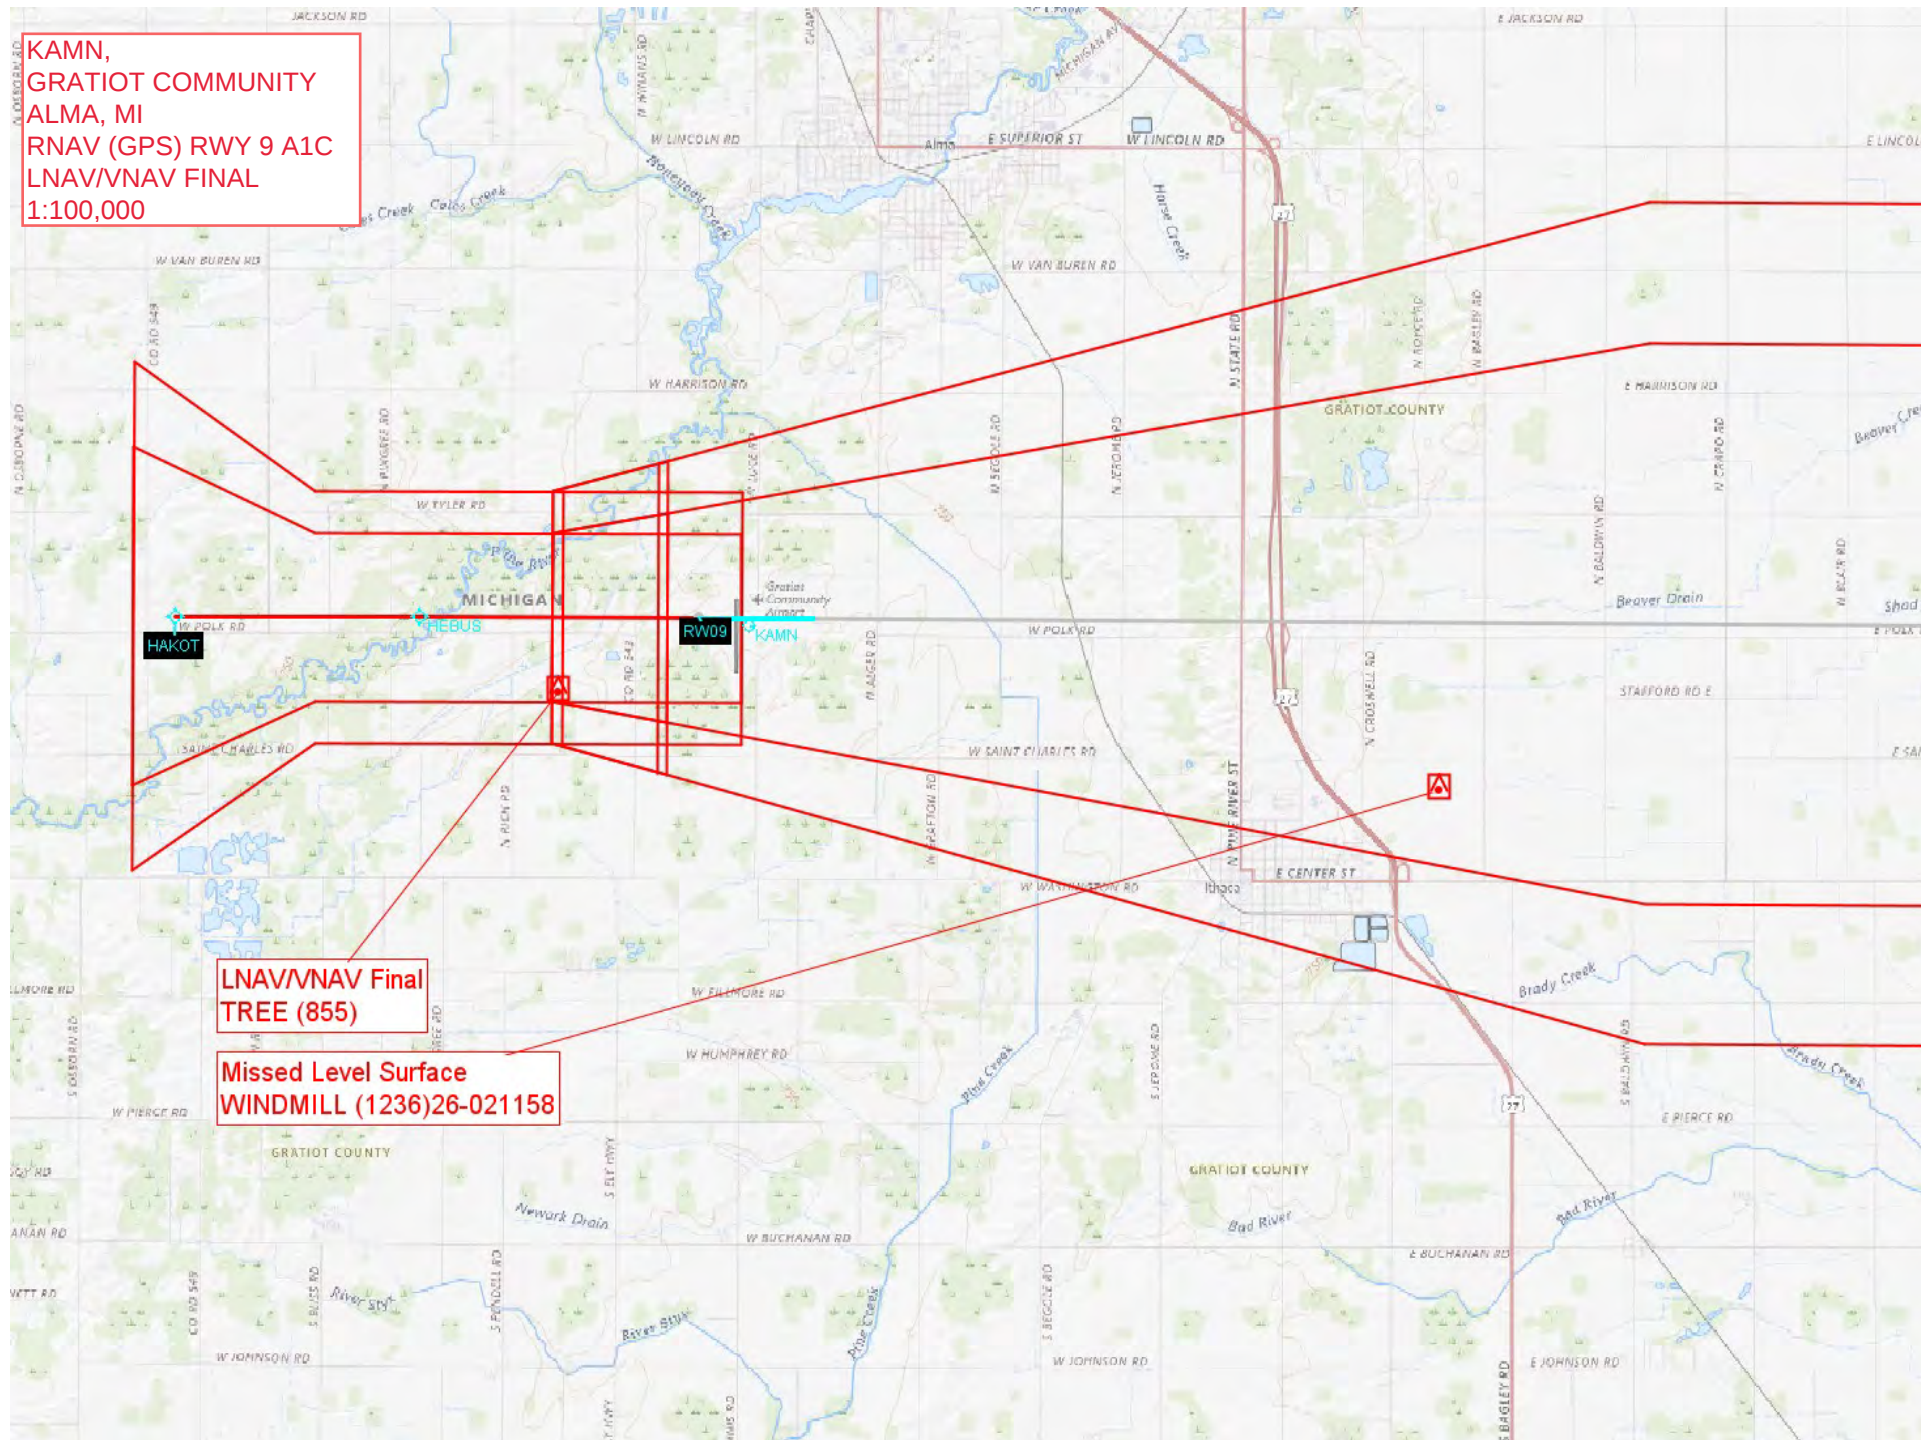

KAMN,
GRATIOT COMMUNITY
ALMA, MI
RNAV (GPS) RWY 9 A1C
LNAV FINAL
1:100,000

LNAV HAKOT to HEBUS
AAO (1001)

LNAV HEBUS to KAMN:RW09:AER
TREE (871)26-143295

Missed Level Surface
WINDMILL (1236)26-021158

