

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 07/09/2026	APWS Task ID: CDB03F435ECD4694B6FEF212A20924EF	APWS Project ID: 4390E1862EE8406E862455450859885A
Procedure: RNAV (GPS) RWY 27 AMDT 0B		Enroute: NO	Specialist: Raimi, Kamarudini		Agreement Number:
Airport ID: KRAL			Airport City: RIVERSIDE		State: CA
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: UTILIZED ACTIVE DATA FOR KRAL AIRPORT AND RUNWAYS. CLEARED FDC-NOTAM 4/0544 - ADDED VGSI AND RNAV GLIDEPATH NOT COINCIDENT (VGSI ANGLE 3.00/TCH 40) NOTE [CHART PROFILE NOTE: VGSI AND RNAV GLIDEPATH NOT COINCIDENT (VGSI ANGLE {ANGLE}/TCH {FEET}).] CRC REMAINDER CHANGED FROM "433F9A74" TO "AA2EC50D." CONTACT ROBERT HAMILTON: AJV-A433, 405-954-4608. 06/04/2026 QUALITY 14 CHECKED QUALITY 29 CHECKED					


WAAS CH 82201 W27A	APP CRS 269°	Rwy Idg 5401 TDZE 819 APT Elev 819
--	------------------------	---

RNAV (GPS) RWY 27

RIVERSIDE (KRAL)

RNP APCH - GPS FOR UNCOMPENSATED BARO-VNAV SYSTEMS, LNAV/VNAV NA BELOW 2°C OR ABOVE 54°C.	MISSED APPROACH: CLIMB TO 4000 DIRECT ICIYE AND ON TRACK 245.62 TO PRADO AND HOLD.
VGSI AND RNAV GLIDEPATH NOT COINCIDENT (VGSI ANGLE {ANGLE}/TCH {FEET}).	
RWY 27 HELICOPTER VISIBILITY REDUCTION BELOW 3/4 SM NOT AUTHORIZED. CIRCLING NA FOR CAT D NORTH OF RWY 9-27. PROCEDURE NA FOR ARRIVALS AT BANDS ON V372 NORTHEAST BOUND AND ON V16 370 EASTBOUND.	

PROTOTYPE-NOT FOR NAVIGATION

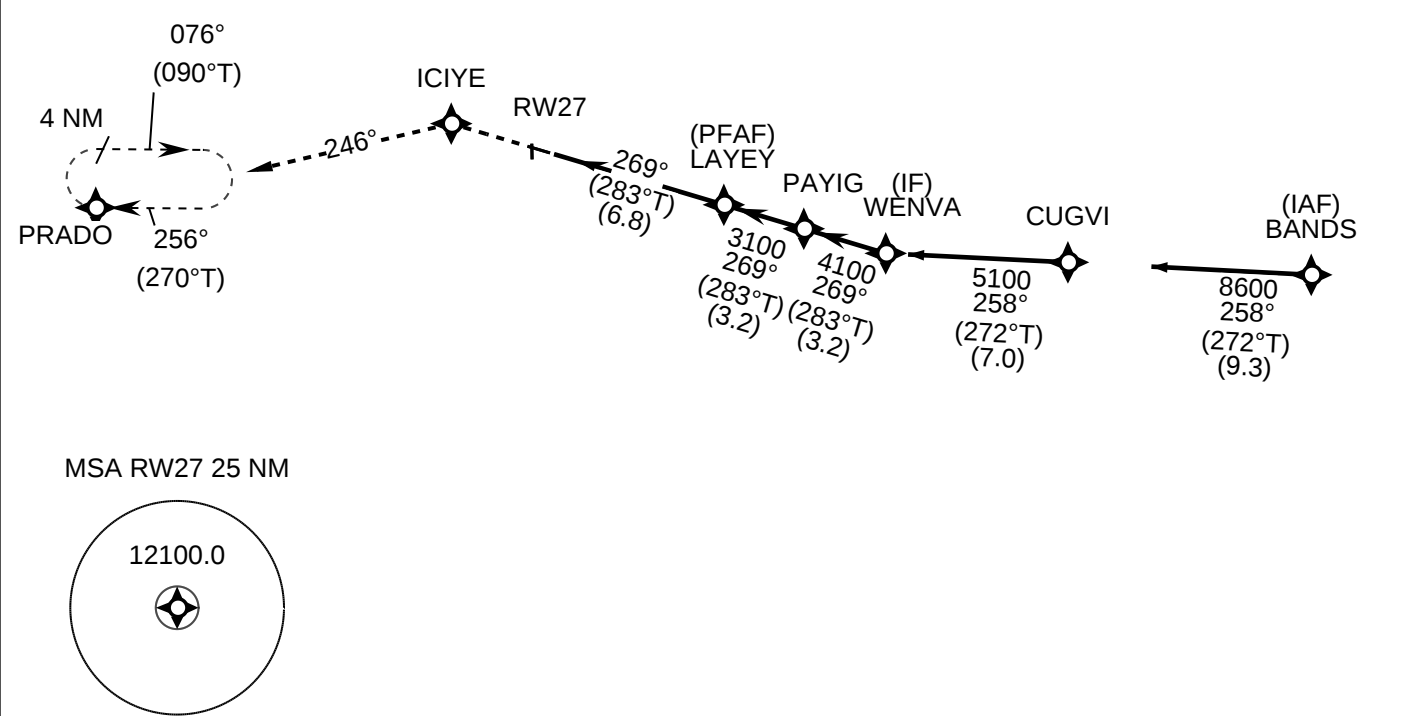

1219 4000 ICIYE tr 246° PRADO VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 40).					WENVA				
4.1 NM to RW27 LAYEY 3100 PAYIG 4100 5100 269° (283°T)									
4.1 NM 2.7 NM 3.2 NM 3.2 NM									
CATEGORY	A		B		C		D		
LPV	1237-1 1/8 418								
LNAV/VNAV	1369-1 5/8 550								
LNAV	2180-1 1/4 1361		2180-1 1/2 1361		2180-3 1361				
CIRCLING	2180-1 1/4 1361		2180-1 1/2 1361		2180-3 1361				

OLD

RNAV (GPS) RWY 27


WAAS CH 82201 W27A	APP CRS 269°	Rwy Ldg 5401 TDZE 818 Apt Elev 818
--	------------------------	---

	DME/DME RNP -0.3 NA.
	For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C (4°F) or above 46°C (116°F). Circling NA for Cat D north of Rwy 9-27. Visibility reduction by helicopters NA.


MISSED APPROACH: Climb to 4000 direct ICIYE and via 246° track to PRADO and hold.


ATIS 128.8	SOCAL APP CON 135.4 377.125	RIVERSIDE TOWER ★ 121.0 (CTAF) 0 257.8	GND CON 124.12	UNICOM 122.95
----------------------	---------------------------------------	--	--------------------------	-------------------------


MISSED APCH FIX

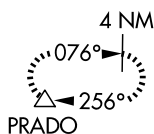

Procedure NA for arrivals at BANDS via V372 northeast bound and via V16-370 eastbound.

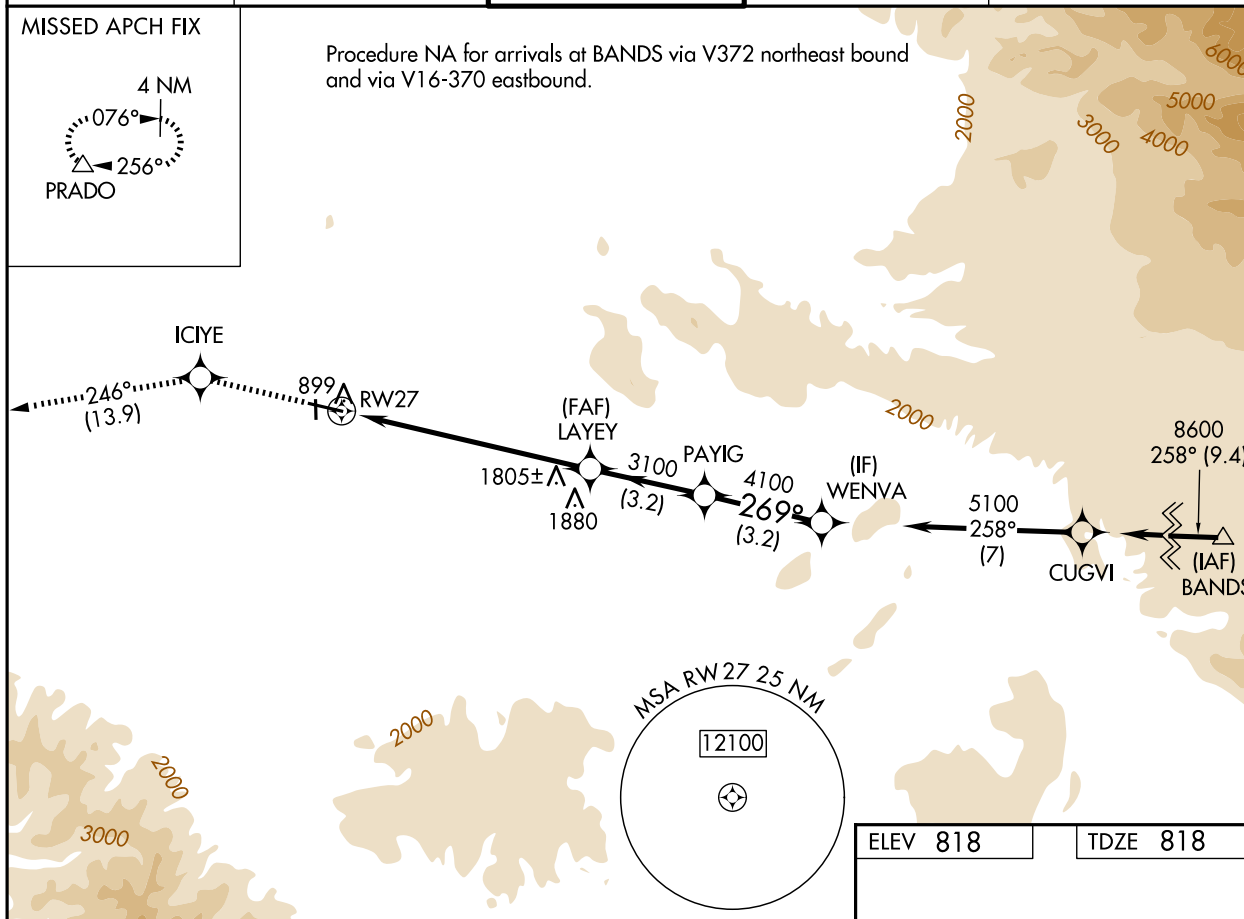

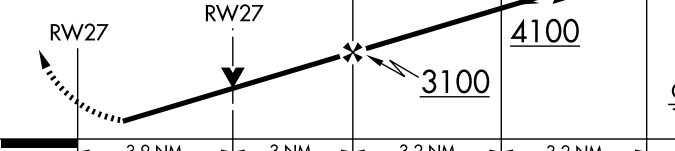4000 ↑	ICIYE ✱	tr 246°	PRADO △	Procedure Turn NA		WENVA		
* LNAV only				* 3.9 NM to RW27				
								
CATEGORY		A		B		C		D
LPV	DA	1236-1½ 418 (500-1½)						
LNAV/ VNAV	DA	1368-2 550 (600-2)						
LNAV	MDA	2100-1¼ 1282 (1300-1¼)	2100-1½ 1282 (1300-1½)	2100-3		1282 (1300-3)		
CIRCLING		2100-2 1282 (1300-2)		2100-3		1282 (1300-3)		

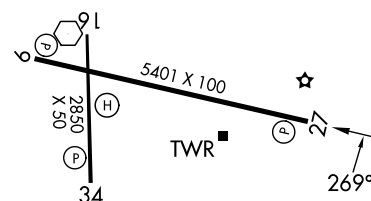MIRL Rwy 9-27 and 16-34 **L**

RIVERSIDE, CALIFORNIA
Orig-A 03DEC20

33°57'N-117°27'W

RIVERSIDE (RAL)
RNAV (GPS) RWY 27

SW-3, 25 DEC 2025 to 22 JAN 2026