



Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 04/20/2023	APWS Task ID: CF043C576E184E9DA829ECDC8920140B	APWS Project ID: 3952D85928344A688E9434D37E522840
Procedure: RNAV (GPS) RWY 33 ORIG		Enroute: NO	Specialist: Johnson, Timothy		Agreement Number:
Airport ID: KCGS			Airport City: COLLEGE PARK		State: MD
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: PENDING DATA USED FOR KCGS CONTACT: ALLAN WILL (405) 954-6103 Digitally signed by JASON KRETSCHMER Dec 22, 2022 QUALITY 25 CHECKED QUALITY 9 CHECKED					

WAAS	APP CRS	Rwy Idg	2809
CH 73044	329°	TDZE	49
W33A		Apt Elev	49

RNAV (GPS) RWY 33

COLLEGE PARK (CGS)

RNP APCH - GPS.		MISSED APPROACH: Climb to 2200 direct PINEY and hold.
▼ Rwy 33 helicopter visibility reduction below 1 SM NA. Procedure NA at night. ▲ When local altimeter setting not received, use Ronald Reagan Washington Intl altimeter setting and increase all MDAs 40 feet.		
AWOS-3 121.225	POTOMAC APP CON 125.65 348.725	UNICOM 122.975 (CTAF) 0

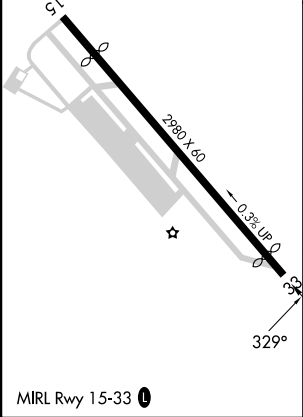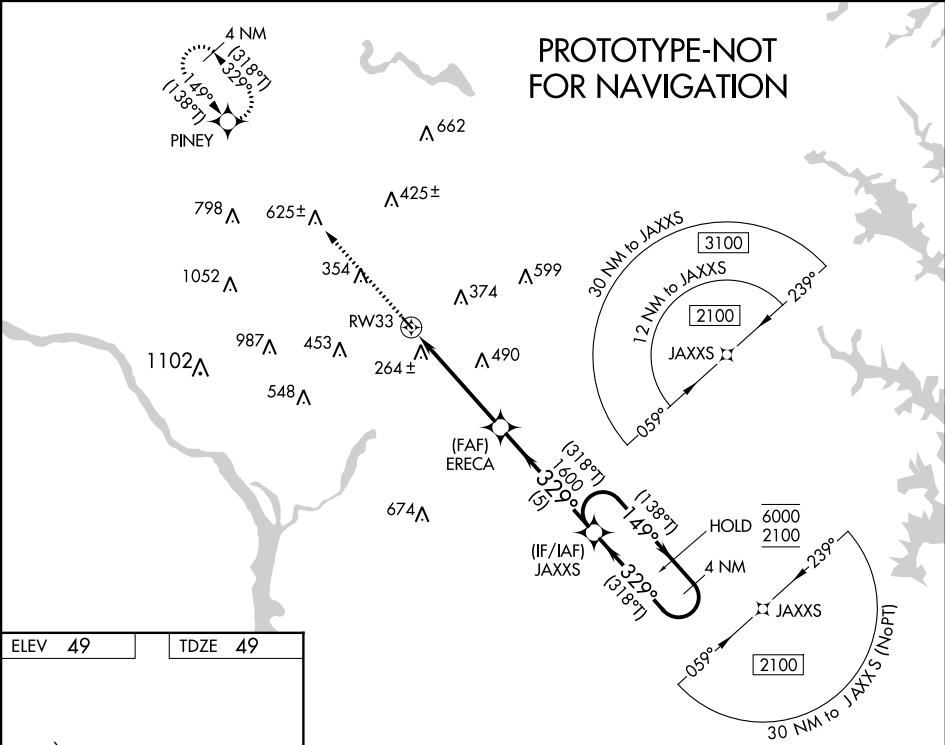

2200 PINEY		JAXXS	
↑		4 NM Holding Pattern (138°T) 149° → 6000 2100	
ERCA		← 329° (318°T)	
RW33		3.00° TCH 40	
4.8 NM		5 NM	
CATEGORY	A	B	C D
LP MDA	660-1	611 (700-1)	NA
LNAV MDA	680-1	631 (700-1)	NA
CIRCLING	680-1 631 (700-1)	720-1 671 (700-1)	NA

