

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 05/16/2024	APWS Task ID: DCBF39617D3E482C83CB0F1806B3D18A	APWS Project ID: CFC1DE67CAAB483C9E02DEF3C3CEE12A
Procedure: RNAV (GPS) RWY 23L AMDT 0C		Enroute: NO	Specialist: Milligan, Walker		Agreement Number:
Airport ID: KLCK			Airport City: COLUMBUS		State: OH
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: ACTIVE DATA USED FOR LCK AIRPORT AND RUNWAYS NEW LNAV CONTROLLING OBSTACLE 856 TREE (39-077316) 395005N/0825248W, NO CHANGE TO MINS. YRK VORMON FAS DATA CHANGED - CRC REMAINDER CHANGED DUE TO NEW LTP LOCATION IN AIRPORT SURVEY DATED 4/26/2022. CONTACT DAVID DANNER, AJV-A421, 405-954-5077. QUALITY 21 CHECKED QUALITY 30 CHECKED					


[illegible]

WAAS CH 62811 W23A	APP CRS 232°	Rwy Idg 12103 TDZE 740 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 23L

RICKENBACKER INTL (LCK)

RNP APCH - GPS.		For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 47°C. Circling NA northwest of Rwy 5L-23R. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 975 feet; increase LNAV/VNAV DA to 1157 feet and all visibilities to RVR 4000; increase all MDAs 40 feet and LNAV visibility Cats C/D to RVR 5000 and Circling Cat D to 2 1/4 SM. * RVR 1800 authorized with use of FD or AP or HUD to DA, NA when using John Glenn Columbus Intl altimeter setting.		MALSR 	MISSED APPROACH: Climb to 3000 direct YERKU and hold.
ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8	

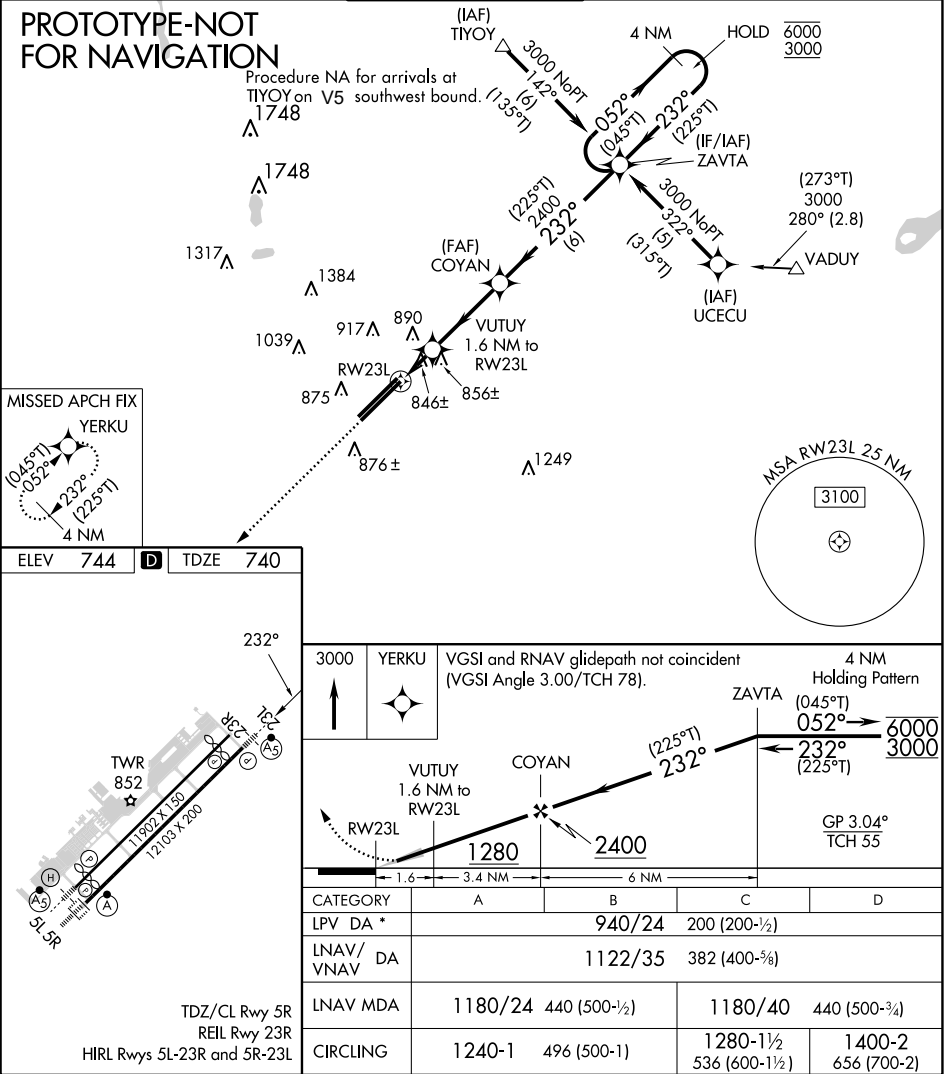

WAAS CH 62811 W23A	APP CRS 230°	Rwy Idg 12103 TDZE 740 Apt Elev 740
--	------------------------	--

RNAV (GPS) RWY 23L
RICKENBACKER INTL (LCK)


⚠ Circling NA NW of Rwy 5L-23R. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C (4°F) or above 47°C (116°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 975 feet; increase LNAV/VNAV DA to 1157 feet and all visibilities to RVR 4000; increase all MDAs 40 feet and LNAV visibility Cats C/D to RVR 5000 and Circling Cat D to 2½ SM. ** RVR 1800 authorized with use of FD or AP or HUD to DA, NA when using John Glenn Columbus Intl altimeter setting.

MALSRL

AS

MISSED APPROACH:
Climb to 3000 direct YERKU and hold.

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8
-----------------------	--	-----------------------------------	---------------------------------	----------------------------------

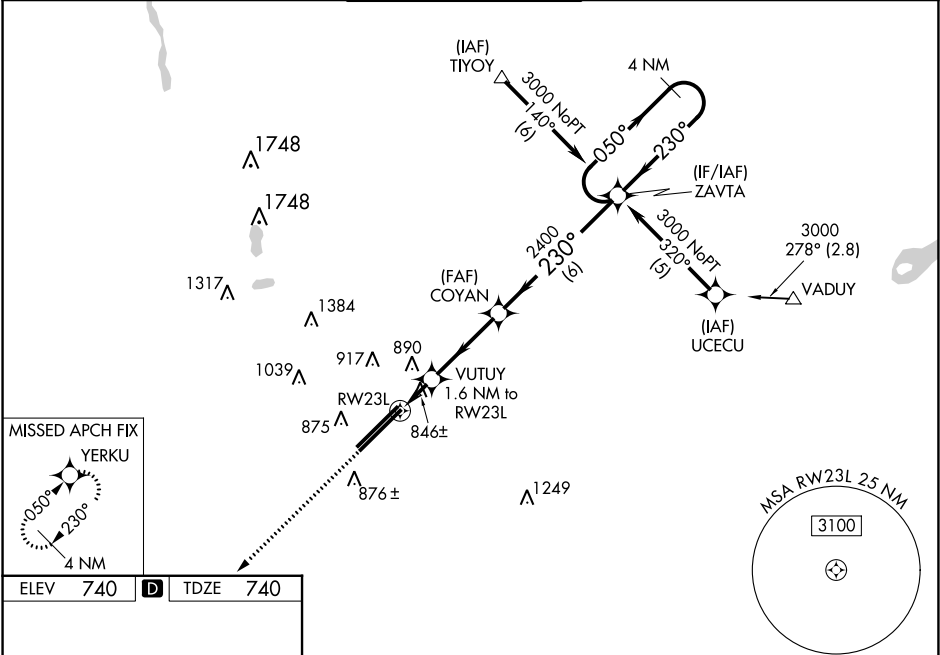

ELEV 740 **D** **TDZE 740**

3000 **YERKU** **VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 78).**

*** LNAV only.**

3000 **4 NM Holding Pattern**

050° **230°** **3000**

GP 3.00° TCH 55

TWR 852 **1192-1159** **12103-200**

5L-5R

TDZ/CL Rwy 5R **REIL Rwy 23R** **HIRL Rwys 5L-23R and 5R-23L**

3000 **YERKU** **VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 78).**

*** LNAV only.**

3000 **4 NM Holding Pattern**

050° **230°** **3000**


GP 3.00° TCH 55

TWR 852 **1192-1159** **12103-200**

5L-5R

TDZ/CL Rwy 5R **REIL Rwy 23R** **HIRL Rwys 5L-23R and 5R-23L**

CATEGORY	A	B	C	D
LPV DA **	940/24 200 (200-½)			
LNAV/VNAV DA	1122/35 382 (400-¾)			
LNAV MDA	1180/24 440 (500-½)		1180/40 440 (500-¾)	
CIRCLING	1240-1 496 (500-1)		1280-1½ 536 (600-1½) 1400-2 656 (700-2)	

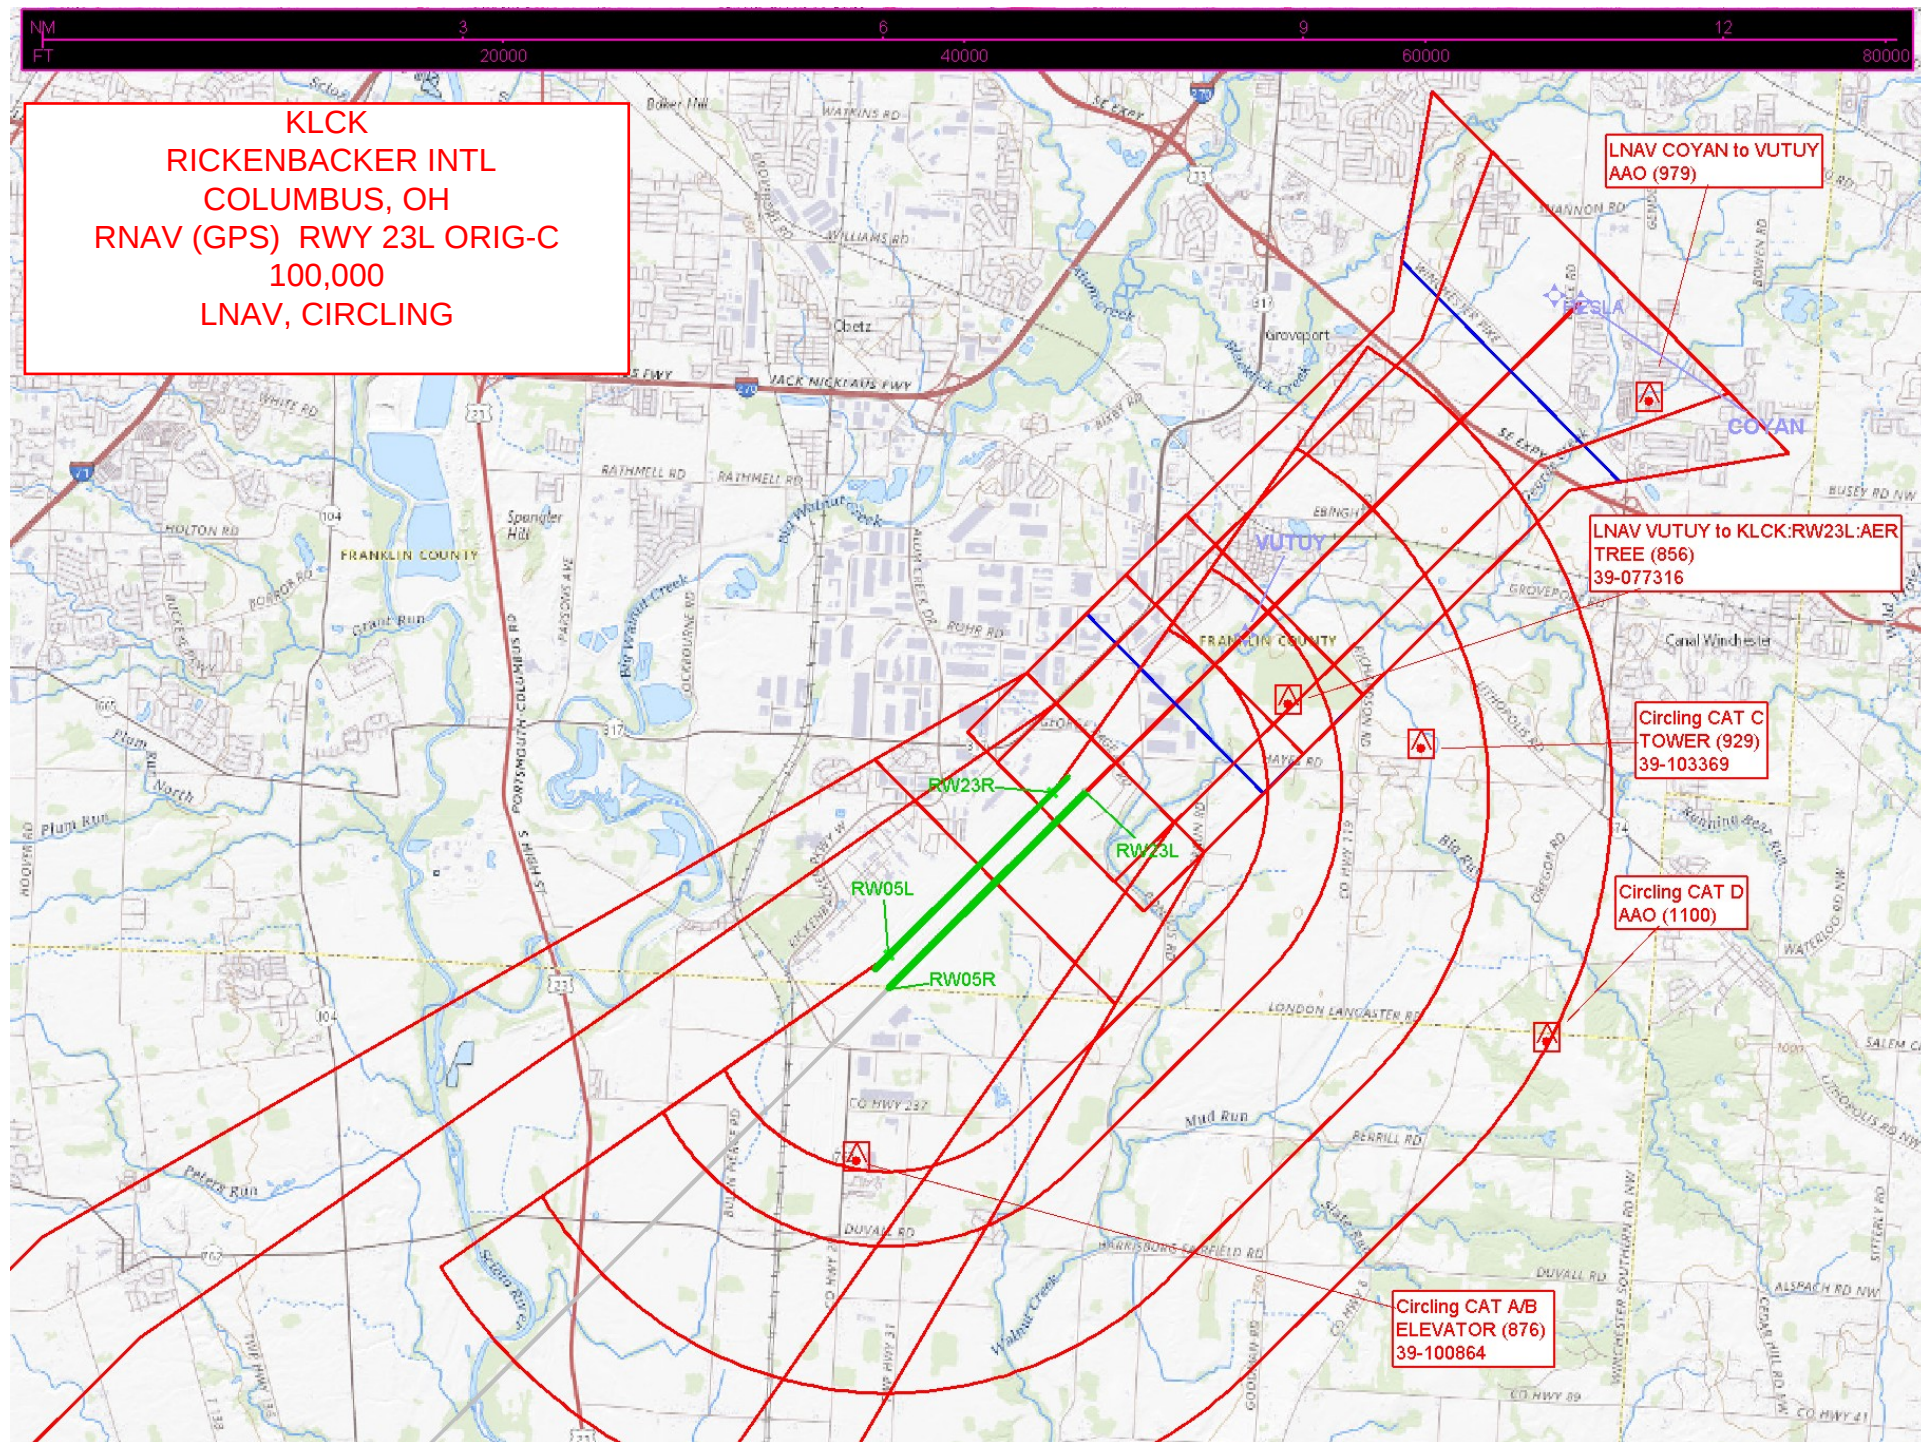

100000

Circling CAT A/B
ELEVATOR (876)
39-100864

Missed Level Surface
TOWER (1259)
39-002176