


LOC I-TPA 110.3	APP CRS 187°	Rwy ldg 8300
		TDZE 26
		Apt Elev 26

ILS RWY 19L (SA CAT I)


TAMPA INTL (TPA)

<p>Simultaneous approach authorized. RADAR required. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.</p>	<p>ALSIF-2</p>	<p>MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.</p>


ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

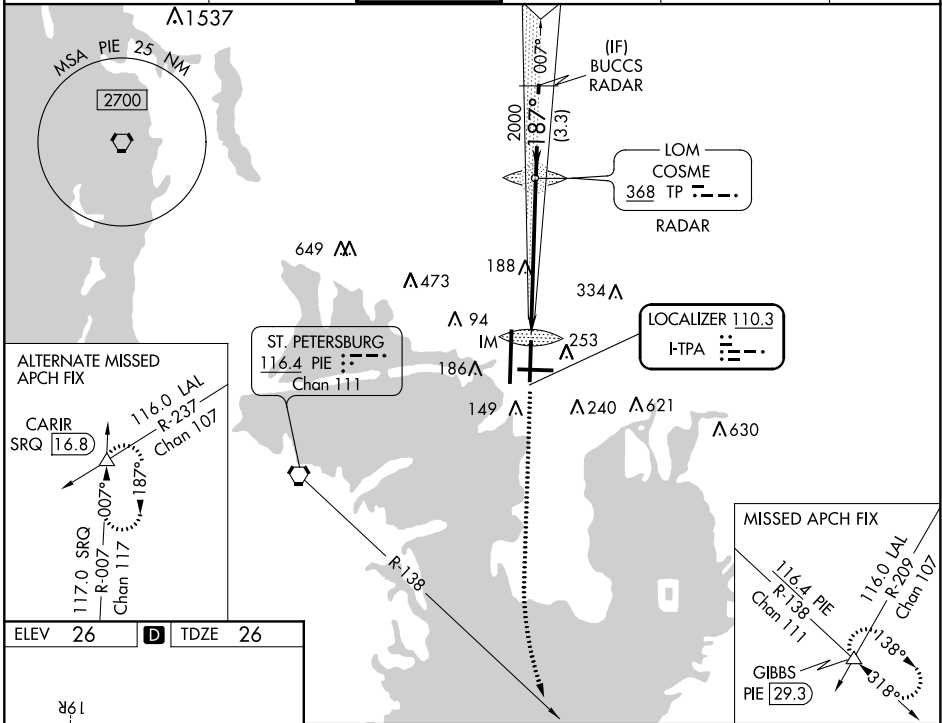

ELEV 26	D	TDZE 26
---------	----------	---------

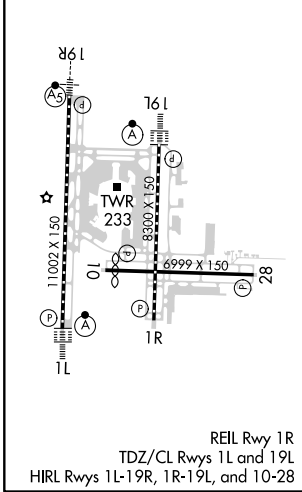

600	2800	PIE R-138	GIBBS	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 61).
-----	------	-----------	-------	-----------------------------------------------------------------

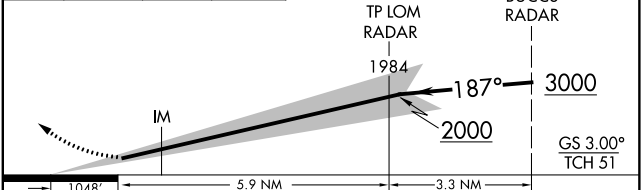

CATEGORY	A	B	C	D
S-ILS 19L	RA 150/14	150	DA 176	

SA CATEGORY I ILS- SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SE-3, 25 MAR 2021 to 22 APR 2021

SE-3, 25 MAR 2021 to 22 APR 2021