
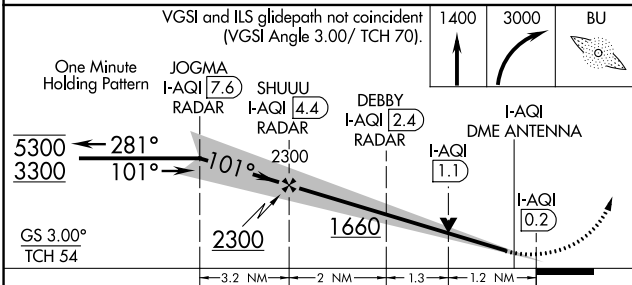


LOC/DME I-AQI 111.75	APP CRS 101°	Rwy Idg 10113 TDZE 809 Apt Elev 815
Chan 54 (Y)		

ILS or LOC RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.		MALSR		MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.	
Simultaneous approach authorized.		AS			
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

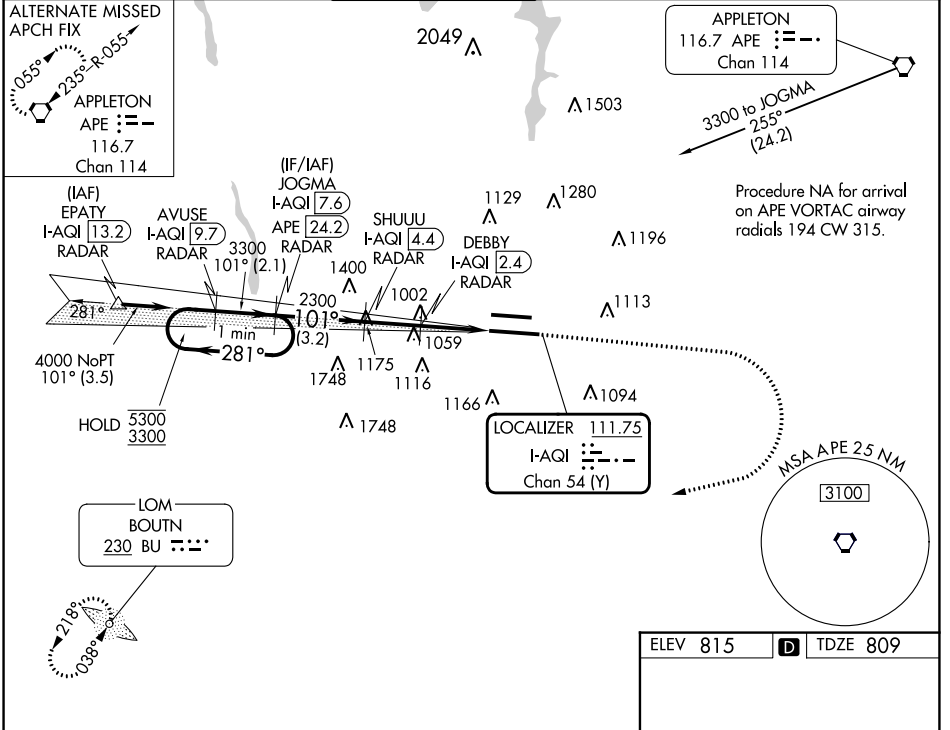

ELEV 815	D	TDZE 809			
TDZ/CL Rwy 10R-28L HIRL Rwys 10R-28L and 10L-28R FAF to MAP 4.5 NM					
Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

CATEGORY	A	B	C	D
S-ILS 10R	1009/18		200 (200-½)	
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2 ¼)

EC-2, 31 OCT 2024 to 28 NOV 2024

EC-2, 31 OCT 2024 to 28 NOV 2024