

KING SALMON, ALASKA

HI-VOR Z or TACAN Z RWY 12


VORTAC AKN 112.8 Chan 75	APCH CRS 116°	Rwy Idg 8501 TDZE 62 Arpt Elev 73	[USAF]	KING SALMON (AKN) (PAKN)
--	-------------------------	--	--------	--------------------------

DME required. RADAR required for procedure entry.


MALSR

MISSED APPROACH: Climbing right turn to 3000 on heading 238° and AKN VORTAC R-210 to OLLER/15 DME and hold.


ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	TOWER ★ 118.3 279.5	GND CON 121.9	CTAF 121.9 352.05	UNICOM 122.95
---------------	---------------------------------	------------------------	------------------	----------------------	------------------

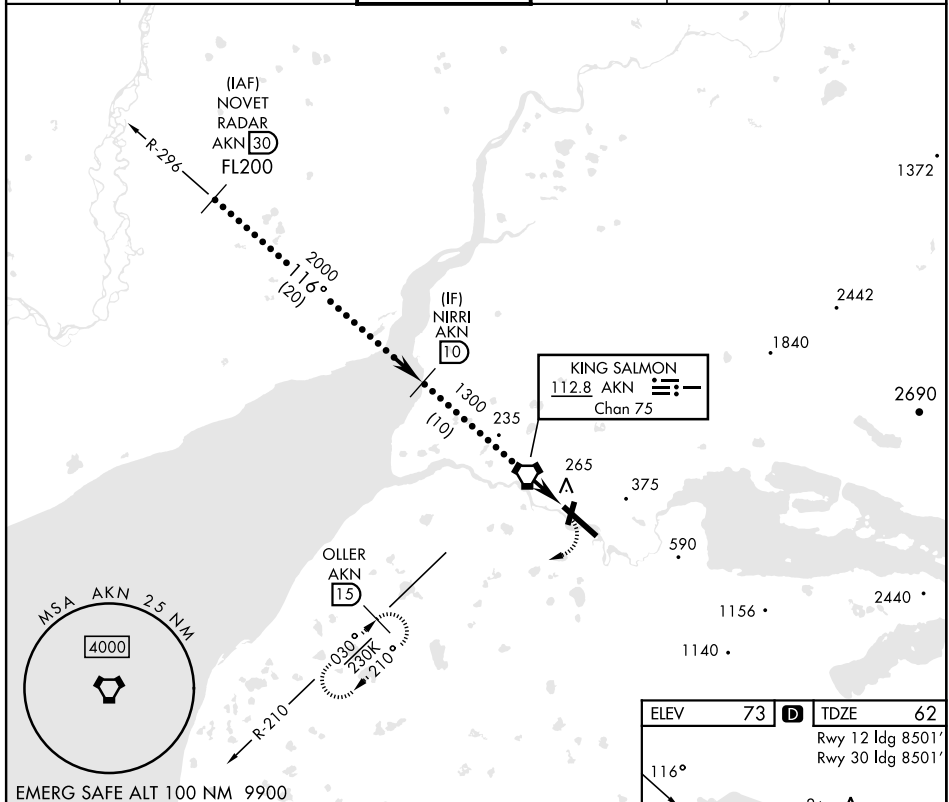

NIRRI AKN	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 66).
--------------	---

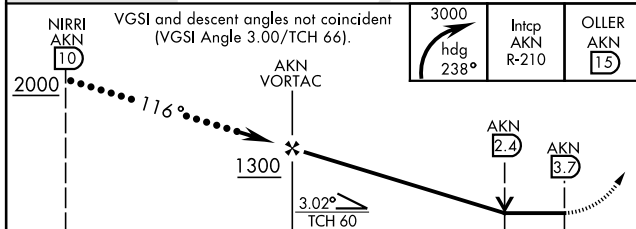

CATEGORY	C	D	E
S-12 *	520/45	458	(500-7%)
C CIRCLING	580-1½ 507 (600-1½)	900-2¾ 827 (900-2¾)	960-3 887 (900-3)

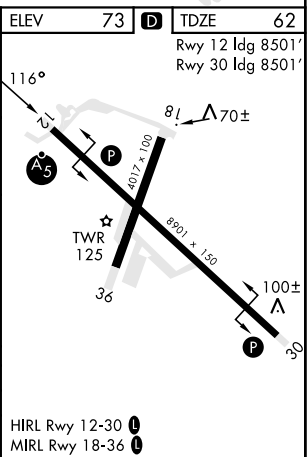

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (AKN) (PAKN)

Amdt 5 26DEC24

HI-VOR Z or TACAN Z RWY 12

AK, 20 FEB 2025 to 17 APR 2025

AK, 20 FEB 2025 to 17 APR 2025