


LOC/DME I-OSV 110.75 Chan 44 (Y)	APP CRS 094°	Rwy Idg 7001 TDZE 76 Apt Elev 76
--	------------------------	---

ILS or LOC RWY 9

BROOKSVILLE-TAMPA BAY RGNL (BKV)

RADAR required for procedure entry. DME required.	MALSR 	MISSED APPROACH: Climb to 3000 on heading 090° and LAL VORTAC R-330 to DADES/LAL VORTAC 25.8 DME and hold.
NA		

ASOS 134.725	TAMPA APP CON 125.3 316.05	BROOKSVILLE TOWER ★ 118.55 (CTAF) 0	GND CON 121.4	CLNC DEL 119.125 (When twr closed)	UNICOM 123.0
------------------------	--------------------------------------	--	-------------------------	---	------------------------

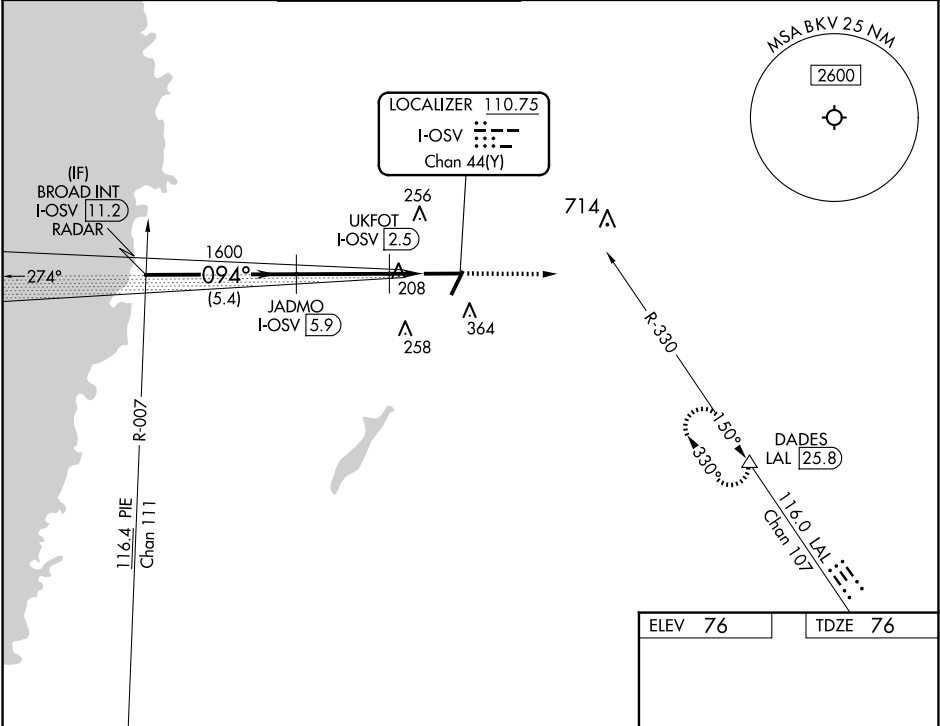

BROAD INT I-OSV 11.2 RADAR		JADMO I-OSV 5.9		3000 hdg 090°		LAL R-330		DADES △	
2000		1600		1600		UKFOT I-OSV 2.5		I-OSV 1.2	
094°		*520		*LOC only.					
GS 3.00° TCH 57									
5.4 NM		3.3 NM		1.3 NM					
CATEGORY	A		B		C		D		
S-ILS 9	276-½ 200 (200-½)								
S-LOC 9	460-½ 384 (400-½)			460-⅝ 384 (400-⅝)					
CIRCLING	680-1 604 (700-1)			680-1¾ 604 (700-1¾)			760-2¼ 684 (700-2¼)		

094°

AS

7001 X 150

TWR/BCN

27

230 X 150

MIRL Rwy 3-21 and 9-27