
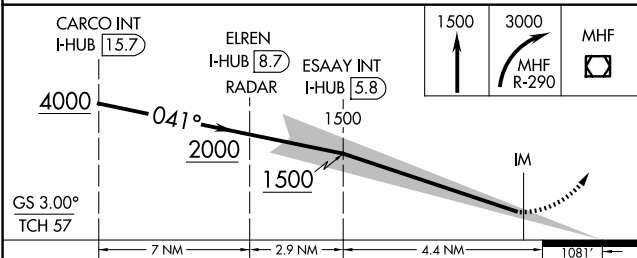


LOC/DME I-HUB	APP CRS	Rwy Idg	7602
109.9	041°	TDZE	44
Chan 36		Apt Elev	46

ILS RWY 4 (SA CAT I)
WILLIAM P HOBBY (HOU)

Aircraft not GPS equipped - RADAR required for procedure entry. From GEEEO: RNAV 1- GPS required.	ALSIF-2	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 on MHF VOR/DME R-290 to MHF VOR/DME and hold.
Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.		

D-ATIS	HOUSTON APP CON	HOBBY TOWER	GND CON	CLNC DEL	CPDLC
124.6	120.05 379.1 EAST 124.35 316.15 WEST	118.7 256.9	121.9	125.45	

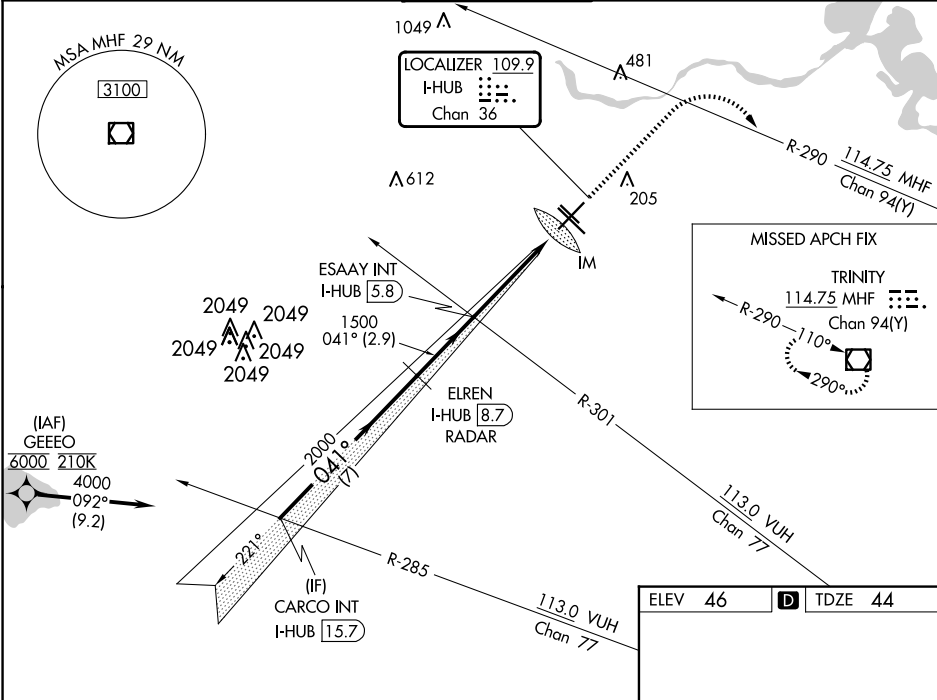

CATEGORY	A	B	C	D
S-ILS 4	RA 146/14	150 DA 194		

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

ELEV 46

TDZE 44

The diagram shows the airport layout with runways 4, 13L, 13R, and 31L. It also shows taxiways and the tower location. The diagram includes a missed approach fix (MISSED APCH FIX) for TRINITY, which is 114.75 MHF, Chan 94(Y), with a 110° turn and a 290° heading.

REIL Rwy 31L

MIRL Rwy 13L-31R

HIRL Rwy 4-22 and 13R-31L

TDZ/CL Rwy 4, 13R and 31L

SC-5, 17 APR 2025 to 15 MAY 2025

SC-5, 17 APR 2025 to 15 MAY 2025