


24249

ILS RWY 17L (CAT II & III)
ORLANDO INTL (MCO)

MISSED APPROACH: Climb to 500 then climbing left turn to 3000 on heading 100° and ORL VORTAC R-140 to PRESK INT/ORL 16.2 DME and hold, continue climb-in-hold to 3000.

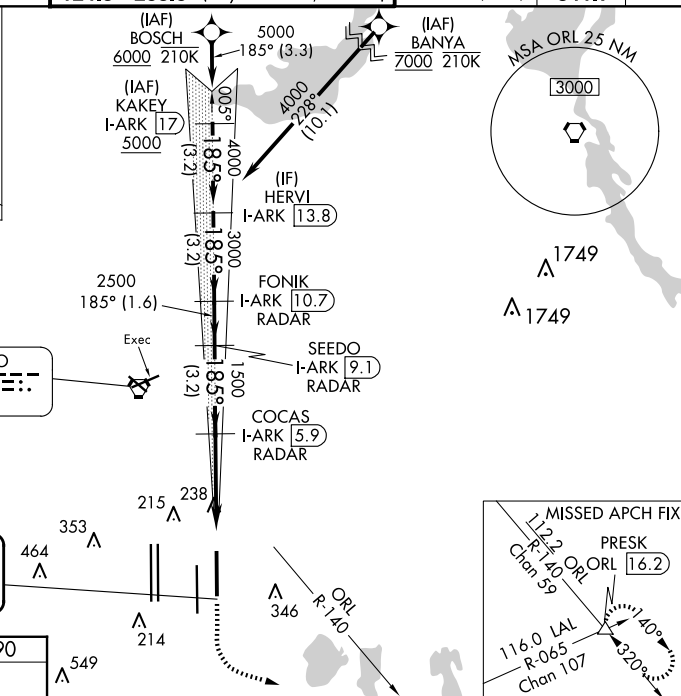

HIRL all Rwy's
REIL Rwy 36L
TDZ/CL Rwy's 17L/R, 18R, 35L/R
and 36R

BOSCH	KAKEY I-ARK	HERVL I-ARK	FONIK I-ARK	SEEDO I-ARK	COCAS I-ARK	ORL R-140	PRESK △
	17	13.8	10.7	9.1	5.9		

500
3000
hdg
100°

6000
5000
4000
3000
2500
1500
1500

185°

VGSi and ILS glidepath not coincident
(VGSi Angle 3.00/TCH 72).

GS 3.00°
TCH 55

3.3 NM 3.2 NM 3.2 NM 1.6 NM 3.2 NM 4.3 NM 1.040°

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

ORLANDO INTL (MCO)
ILS RWY 17L (CAT II & III)