
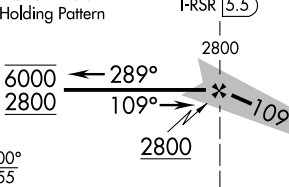


ILS or LOC RWY 11
WORCESTER RGNL (ORH)

- MISSED APPROACH:** Climb to 1800 then climbing right turn to 3100 on heading 230° and on GDM VOR/DME R-167 to LAWNRN/GDM 23 DME and hold, continue climb-in-hold to 3100.

CND C

One Minute Holding Pattern 		1800 3100 hdg 230° GDM R-167 LAWWRN GDM 23		
6000 ← 289° 2800 ← 109° 2800 GS 3.00° TCH 55		2800 109° I-RSR 1.4 IM 4.1 NM 1.4 NM 0.1		
CATEGORY	A	B	C	D
S-ILS 11	1180/18 200 (200-½)			
S-LOC 11	1500/24	520 (500-½)	1500/55	520 (500-1)
C CIRCLING	1560-1 551 (600-1)	1740-1 731 (800-1)	2000-3	991 (1000-3)