


WAAS CH 78022 W05B	APP CRS 052°	Rwy Idg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L

RICKENBACKER INTL (LCK)

RNP APCH - GPS.		MALSR		MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
Circling NA northwest of Rwy 5L-23R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 979 feet; increase LNAV/VNAV DA to 1042 feet; increase all MDAs 40 feet and Circling visibility Cat D ¼ SM.				
ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8

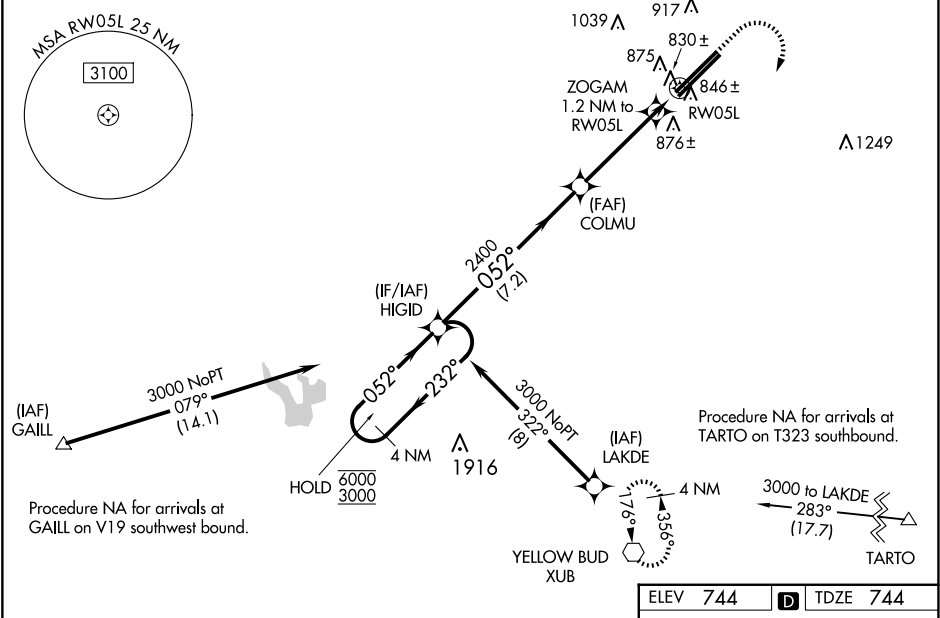

4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).		1500	3000	XUB
				↑	↷	⬡
HIGID		COLU		ZOGAM 1.2 NM to RW05L		
6000 ← 232°		2400		RW05L		
3000 → 052°		2400		1200		
GP 3.00° TCH 55		7.2 NM		3.8 NM		
				1.2 NM		
CATEGORY	A	B	C	D		
LPV DA	944-1½		200 (200-½)			
LNAV/VNAV DA	1007-1½		263 (300-½)			
LNAV MDA	1100-1½	356 (400-½)	1100-5⁄8	356 (400-5⁄8)		
CIRCLING	1240-1	496 (500-1)	1280-1½ 536 (600-1½)	1400-2 656 (700-2)		

