

ILS RWY 30 (CAT II & III)
OAKLAND INTL (OAK)

MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 260° and on SAU VOR/DME R-110 to SAU VOR/DME and hold, continue climb-in-hold to 4000.


A

MISSED APCH FIX

Λ 2025


Λ 3902

ALTERNATE
ISSUED APCH FIX

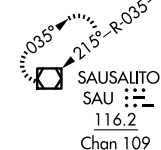
$$\begin{array}{r} \Lambda^{1974} \quad \Lambda^{1243 \pm} \\ \cdot 1619 \\ 731 \pm \Lambda \end{array}$$


AKLAND
OAK 
han 115

Δ 2016

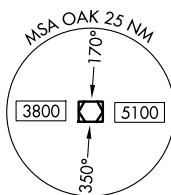


LOCALIZER 108.7
I-INB
Chan 24

ELEV	9	D	TDZE	9
------	---	----------	------	---

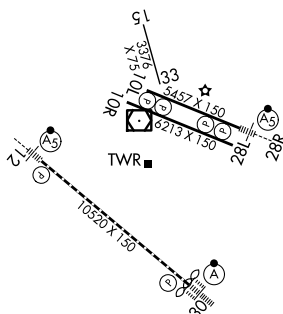

REIL Rwy 10R
TDZ/CL Rwy 30
MIRL Rwy 15-33
HIRL Rwy 12-30, 10L-28R, 10R-28L

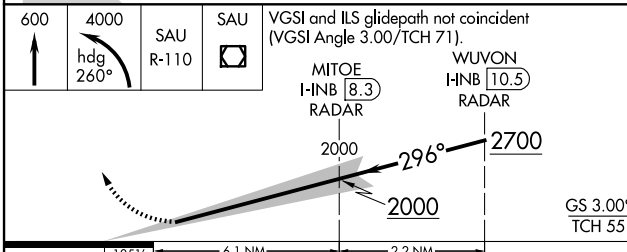

CATEGORY	A	B	C	D
S-ILS 30	CAT II RA 100/12 100 DA 109			
S-ILS 30	CAT III RVR 06			

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED