



JOHN EDWIN JONES SR FLD/METTER MUNI (MHP)

MISSED APPROACH: Climb to 700 then climbing left turn to 3000 direct LOTTS and hold.

UNICOM
123.0 (CTAF) **L**

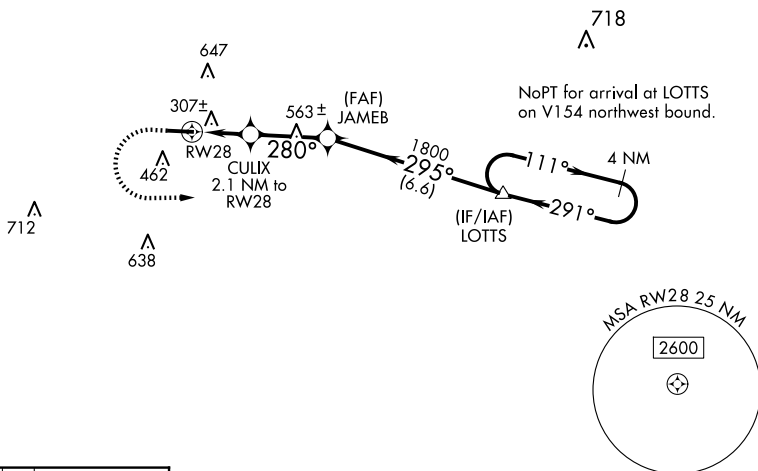

TDZE 197

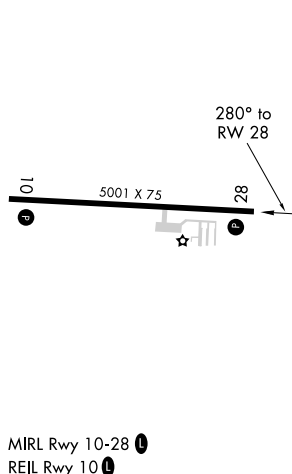

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 27).

4 NM Holding Pattern

LOTTS

3000

111°

291°

295°

1800

JAMEB

1800

CULIX

2.1 NM to RW28

RW28

280°

2.1 NM

2.8 NM

6.6 NM

GP 3.00° TCH 57

CATEGORY	A	B	C	D
LPV DA	494-1	297 (300-1)		
LNAV/VNAV DA	527-1	330 (400-1)		
LNABV MDA	620-1	423 (500-1)	620-1¼	423 (500-1¼)
CIRCLING	820-1 623 (700-1)	880-1 683 (700-1)	1060-2½ 863 (900-2½)	1060-2¾ 863 (900-2¾)

RNAV (GPS) RWY 28