
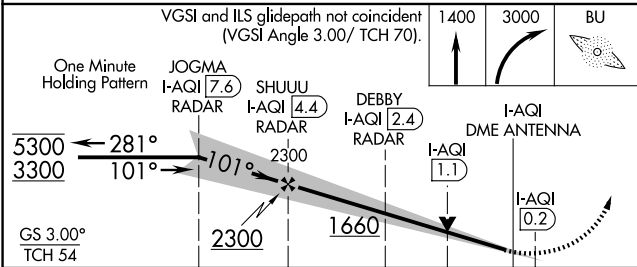


LOC/DME I-AQI 111.75 Chan 54 (Y)	APP CRS 101°	Rwy Ldg 10114 TDZE 809 Apt Elev 815
--	------------------------	--

ILS or LOC RWY 10R
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.		MALSR 		MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.	
Simultaneous approach authorized.					
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

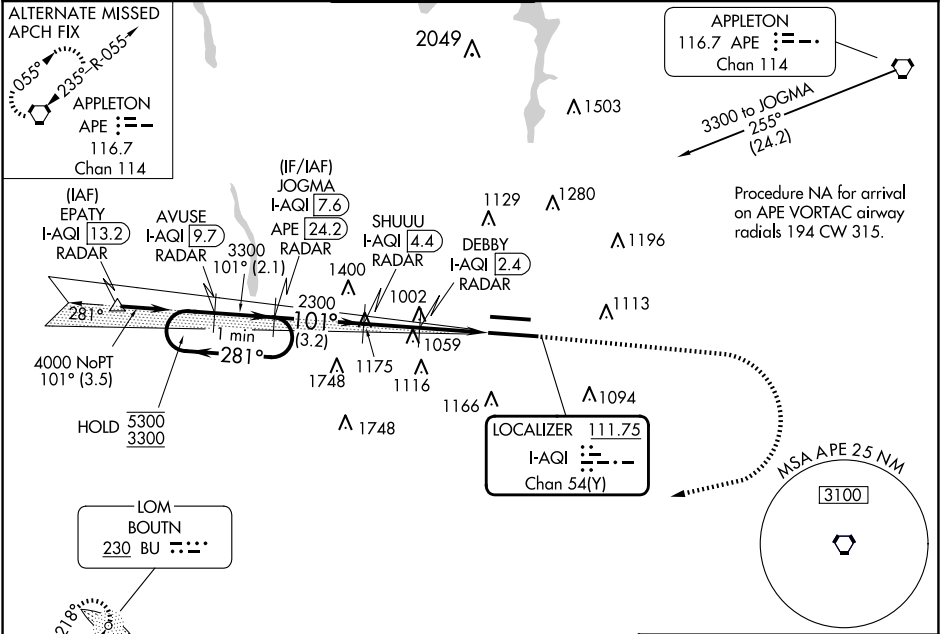

CATEGORY	A	B	C	D	TDZ/CL Rwy 10R-28L HIRL Rwy 10R-28L and 10L-28R FAF to MAP 4.5 NM
S-ILS 10R		1009/18	200 (200-½)		
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)	
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2¼)	
					Knots Min:Sec 4:30 3:00 2:15 1:48 1:30

EC-2, 04 SEP 2025 to 02 OCT 2025

EC-2, 04 SEP 2025 to 02 OCT 2025