

LOC/DME I-ONB 109.1 Chan 28	APP CRS 281°	Rwy Idg 8000 TDZE 813 Apt Elev 815
---	------------------------	---

ILS or LOC RWY 28R
JOHN GLENN COLUMBUS INTL (CMH)


DME or RADAR required.

T Simultaneous approach authorized. Autopilot coupled approach NA.
A For inop ALS, increase S-LOC 28R Cat C/D visibility to 1 $\frac{3}{8}$ SM.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
-----------------	------------------------------------	-------------------------------	------------------------	-------------------	-------

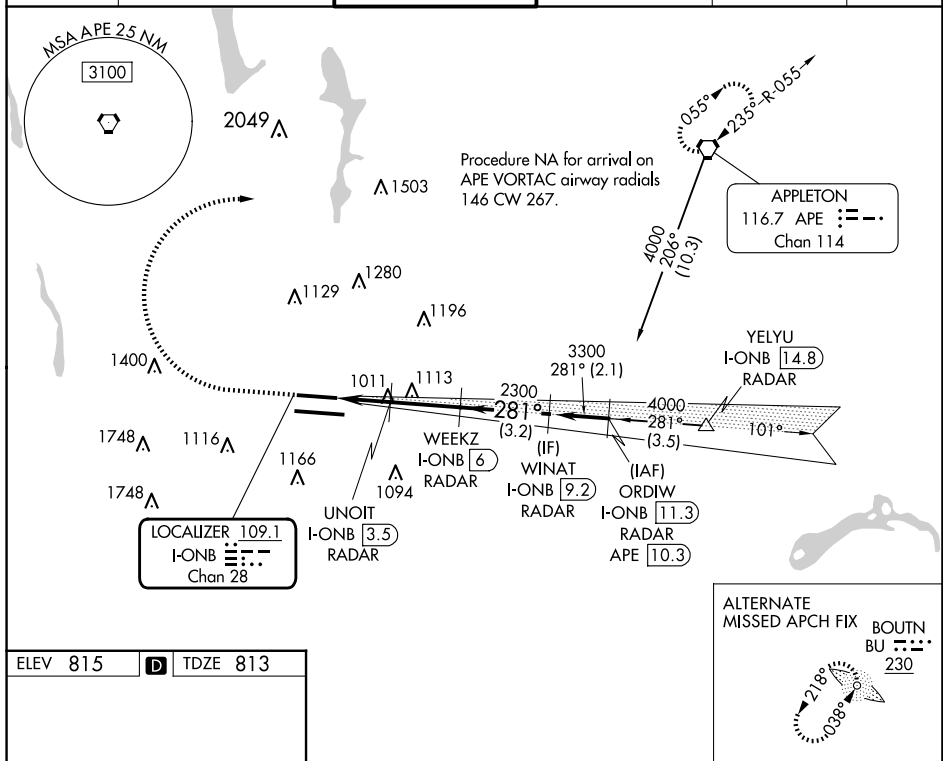

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and 10L-28R
FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30