
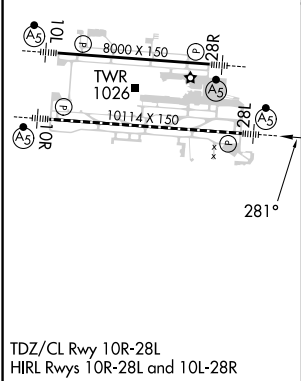



APP CRS	Rwy Ldg	10114
281°	TDZE	815
	Apt Elev	815

RNAV (RNP) Z RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.	MALSRR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BOUTN LOM and hold.
For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.30 all Cats visibility to 1½ SM. Simultaneous approach authorized.		

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
-----------------	------------------------------------	-------------------------------	------------------------	-------------------	-------

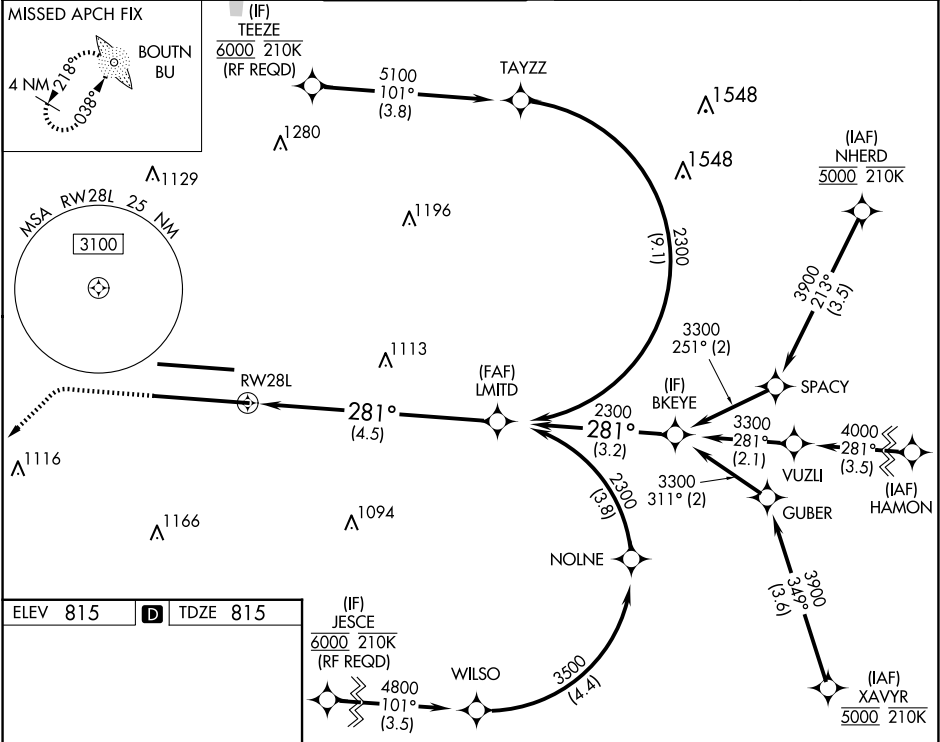

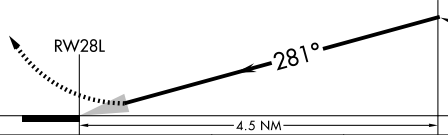1400 ↑	3000 ↷	BU 	VGSI and RNAV glidepath not coincident (VGSI Angle 3.00°/ TCH 68).	
			See planview for multiple IF locations.	
			GP 3.00° TCH 52	
CATEGORY	A	B	C	D
RNP 0.17 DA	1147/26 332 (400-½)			
RNP 0.30 DA	1314/50 499 (500-1)			
AUTHORIZATION REQUIRED				