

WAAS CH 48999 W28A	APP CRS 281°	Rwy Ldg TDZE Apt Elev	10114 815 815
--	------------------------	-----------------------------	--

RNAV (GPS) Y RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

RNP APCH.

T Simultaneous approach authorized. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inop ALS, increase LNAV Cat C/D visibility to 1½ SM.


MALSR




MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BOUTN LOM and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

MISSED APCH FIX

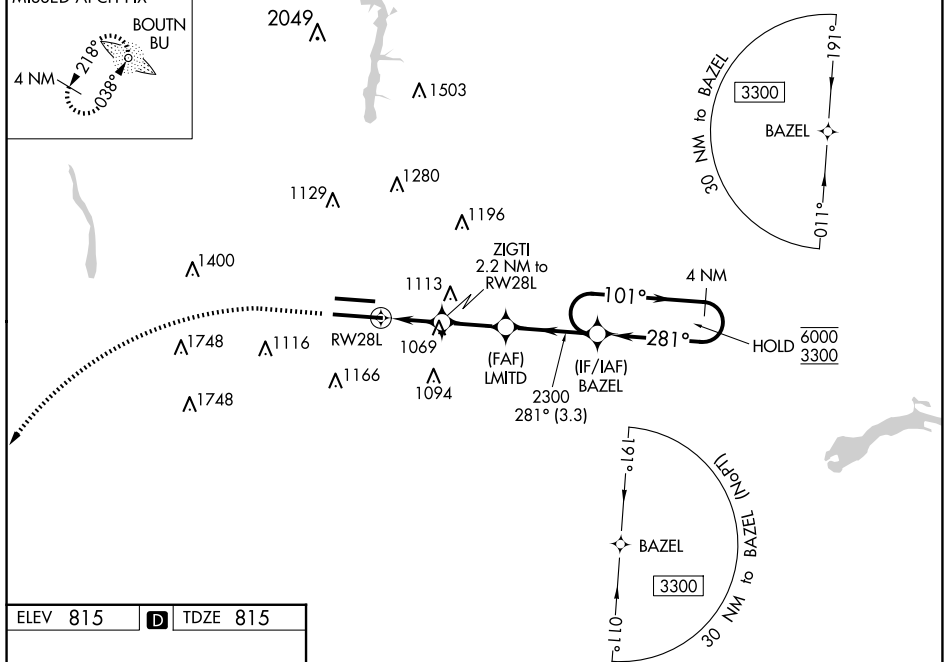

ELEV 815	D	TDZE 815
----------	----------	----------

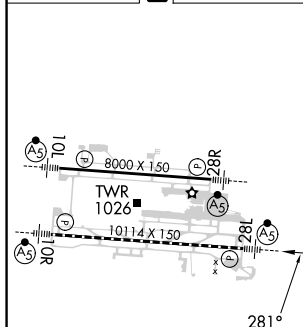

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and 10L-28R

		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 68).		4 NM Holding Pattern	
*LNAV only.		ZIGTI 2.2 NM to RW28L		LIMTD 2300	
RW28L		*1.4 NM to RW28L		BAZEL 2300	
1.4		0.8		2.3 NM	
101°		281°		101°	
6000		3300		GP 3.00° TCH 52	
CATEGORY		A		B	
LPV DA		1015/18		200 (200-½)	
LNAV/ VNAV DA		1237/40		422 (500-¾)	
LNAV MDA		1320/24		505 (600-½)	
1320/55		505 (600-1)		1520-2 705 (800-2)	
1520-2¼ 705 (800-2¼)		1340-1		525 (600-1)	
CIRCLING		1340-1		525 (600-1)	